
BOTTOM OF CAP

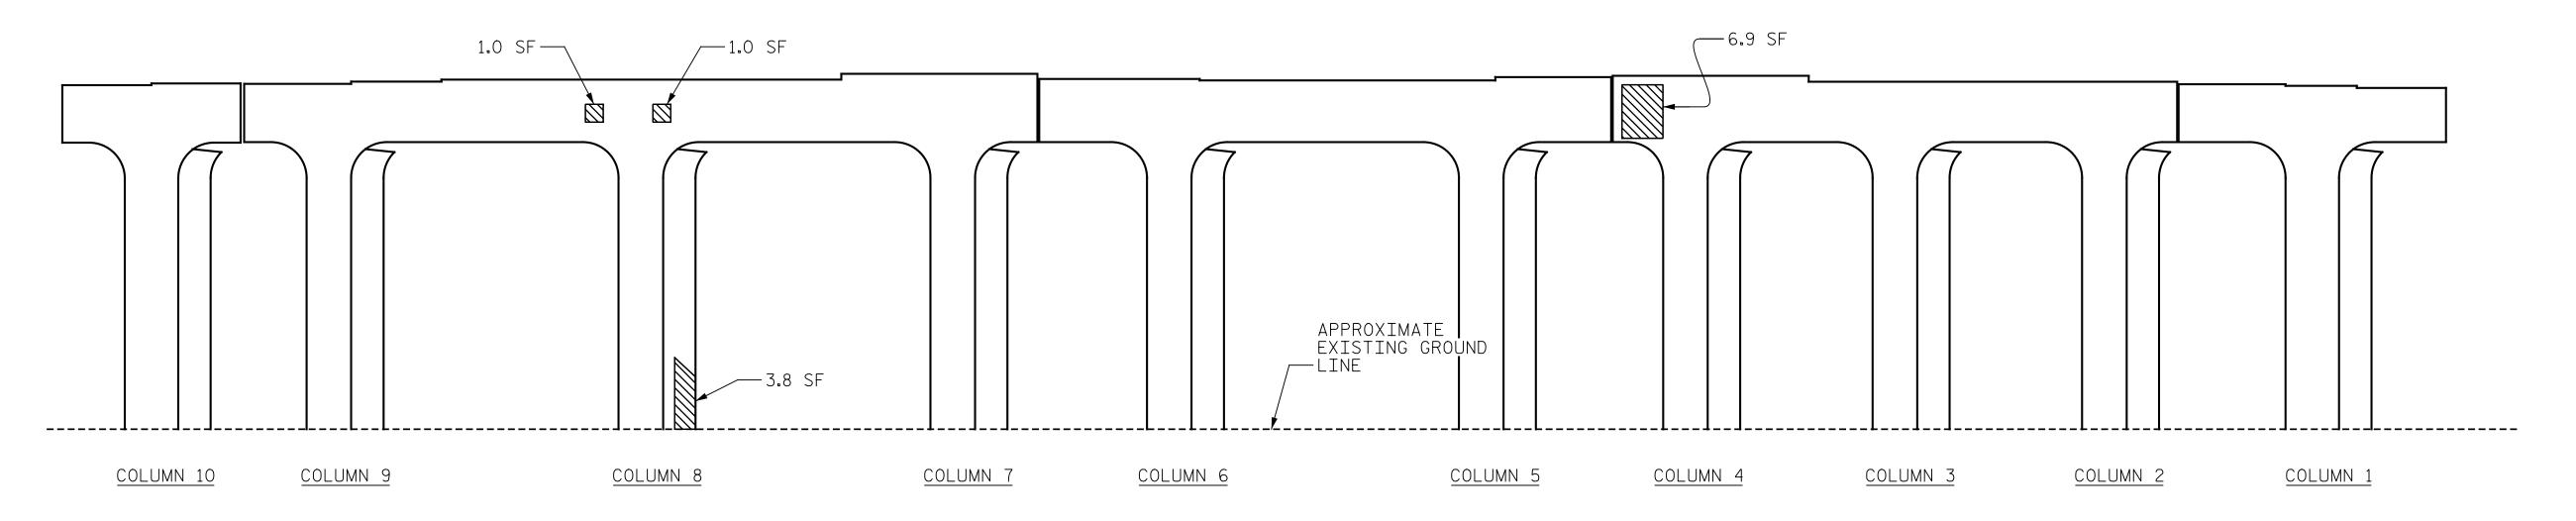

ELEVATION

NOTES:

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

FOR REPAIRS, SEE "TYPICAL CAP AND COLUMN REPAIR DETAILS" SHEET.

FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR CONCRETE REPAIRS, SEE SPECIAL PROVISIONS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

CLEAN AND REMOVE DEBRIS FROM THE TOP OF THE CAP AND APPLY EPOXY PROTECTIVE COATING. EPOXY COATING SHALL BE APPLIED TO THE TOP SURFACE OF THE CAP. THE CONTRACTOR SHALL NOT COAT THE AREA OF THE CAP BENEATH THE BEARING PADS. FOR EPOXY COATING, SEE SPECIAL PROVISIONS.

FOR EPOXY RESIN INJECTION, SEE SPECIAL PROVISIONS.

CONCRETE REPAIRS TO THE BENT CAP MAY REQUIRE BRIDGE JACKING. FOR BRIDGE JACKING, SEE "JACKING DETAILS" SHEET.

WHEN COLUMN REPAIRS ARE INDICATED TO GROUND LINE, EXTEND REPAIR ONE (1) FOOT MIN. BELOW GROUND LINE.

- SHOTCRETE REPAIR

- CONCRETE REPAIRS (FORM & POUR)

→ ERI - EPOXY RESIN INJECTION

I-5997 PROJECT NO.____ WAKE COUNTY 910242 BRIDGE NO. _

SHEET 2 OF 2

<u>SPAN B</u>

<u>SPAN C</u>

020208 GINEER

Ein Bhil J 11/22/2021 ACB8082119D74CD...

STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION

> BENT 2 SPAN "C" SIDE

PLANS PREPARED BY:

One Glenwood Avenue Gannett Fleming Raleigh, NC 27603 (919) 420-7660 Excellence Delivered As Promised NC Lic. No. F-0270

OCUMENT NOT CONSIDERE FINAL UNLESS ALL SIGNATURES COMPLETED

SHEET NO. REVISIONS NO. BY: S-14 DATE: DATE: BY: TOTAL SHEETS

J. MYA _ DATE : <u>08/2021</u> DRAWN BY : _ CHECKED BY: J. YANNACCONE ___ DATE : <u>09/2021</u> DESIGN ENGINEER OF RECORD: R. NELSON DATE: 09/2021