

6/22/2022 S:\DPG1\Division4\HI-0007\Plans\970225\401\_017\_HI-0007\_SMU\_B\*\_S1-9\_970225.dgn aabraha

## NOTES

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

CONCRETE REPAIRS MAYBE SUBSTITUTED IN LIEU OF SHOTCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.


FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR CONCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR CAP & COLUMN REPAIRS DETAILS, SEE TYPICAL CAP & COLUMN REPAIR DETAIL SHEET.



VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, 1" BEHIND REBAR AND MIN. 2" CLEARANCE TO SAWCUT.

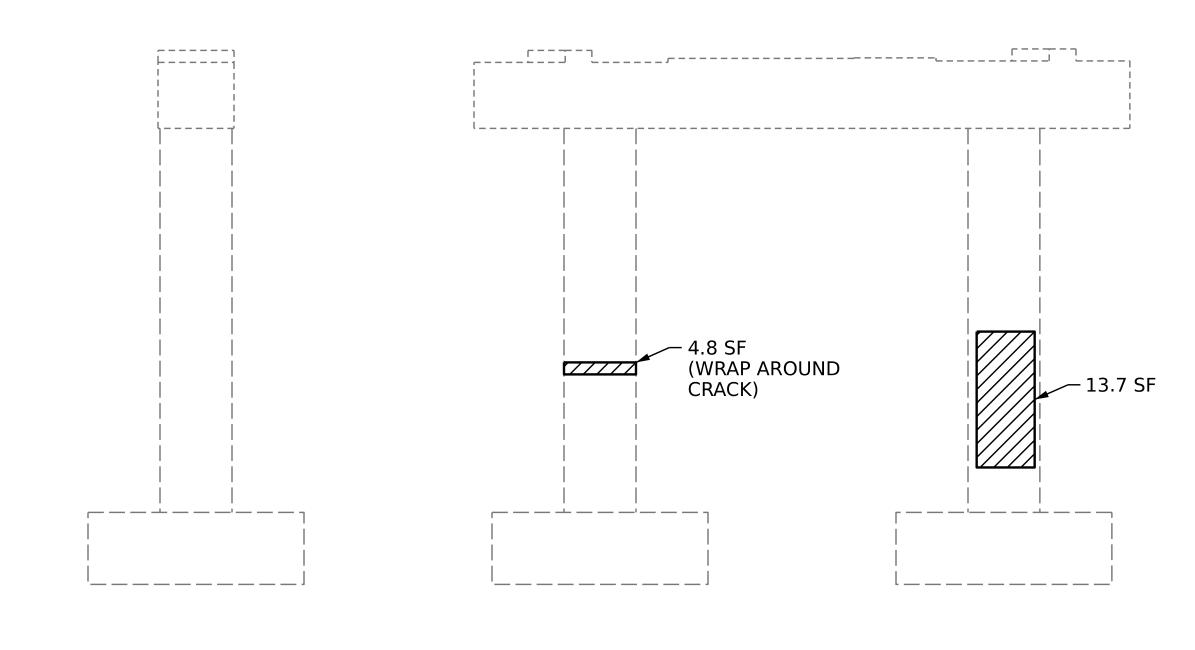




SPAN B SPAN C

SPAN C

SPAN B

REPAIR QUANTITY TABLE								
REPAIRS - BENT 2	QUANTITIES							
	ESTII	MATE	ACTUAL					
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF				
CAP	0	0						
COLUMN	18.5	9.3						
CONCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF				
CAP	0	0						
COLUMN	0	0						

## **REPAIR KEY**



SHOTCRETE REPAIR AREA

CONCRETE REPAIR AREA

	PROJECT NO. <u>HI-0007</u> <u>WILSON</u> COUNTY BRIDGE NO. <u>970225</u> SHEET 2 OF 3					
OR ESSIONE SEAL 030024	STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH SUBSTRUCTURE REPAIR BENT 2					
06/22/2022	REVISIONS SHEET NO.					
DOCUMENT NOT CONSIDERED	NO. BY:	DATE:	NO. BY:	DATE:	S1-9	
FINAL UNLESS ALL SIGNATURES COMPLETED	1 2		3 4		TOTAL SHEETS 11	