

NOTES

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

CONCRETE REPAIRS MAYBE SUBSTITUTED IN LIEU OF SHOTCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.


FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR CONCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR CAP & COLUMN REPAIR DETAILS, SEE TYPICAL CAP & COLUMN REPAIR DETAILS SHEET.

REPAIR QUANTITY TABLE				
REPAIRS - BENT 1	QUANTITIES			
	ESTIMATE		ACTUAL	
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF
CAP	0	0		
COLUMN	13.4	6.7		
CONCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF
CAP	0	0		
COLUMN	0	0		


VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, 1" BEHIND REBAR AND MIN. 2" CLEARANCE TO SAWCUT.

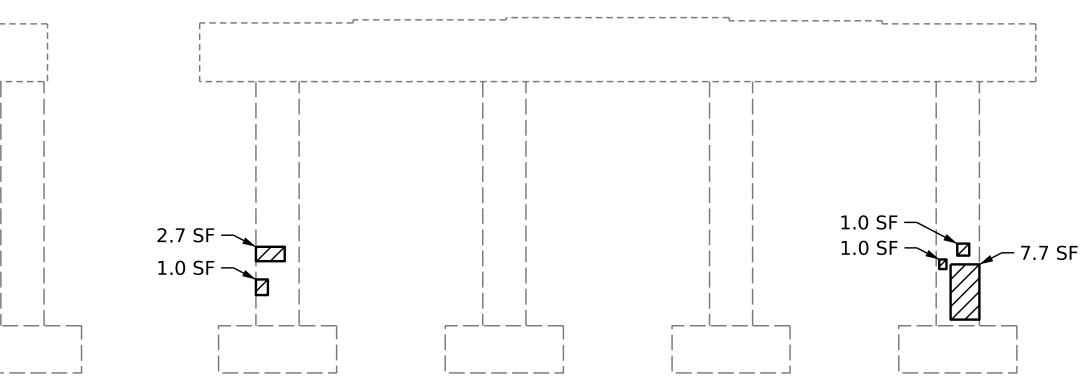

REPAIR KEY



SHOTCRETE REPAIR AREA

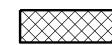

CONCRETE REPAIR AREA

END VIEW EAST END

ELEVATION NORTH SIDE (LOOKING SOUTH)

END VIEW

WEST END

<u>SPAN B</u>

ELEVATION SOUTH SIDE (LOOKING NORTH)

> PROJECT NO. HI-0007 WILSON COUNTY BRIDGE NO. 970287

Aster Abralia

STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH

SUBSTRUCTURE REPAIR BENT 1

SHEET NO.

S4-6

TOTAL SHEETS

DATE:

REVISIONS NO. BY: DATE: DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

PLAN

BOTTOM OF CAP

6/22/2022 S:\DPG1\Division4\HI-0007\Plans\970287\404_011_HI-0007_SMU_B*_S4-6_970287.dgn aabraha