


+

+

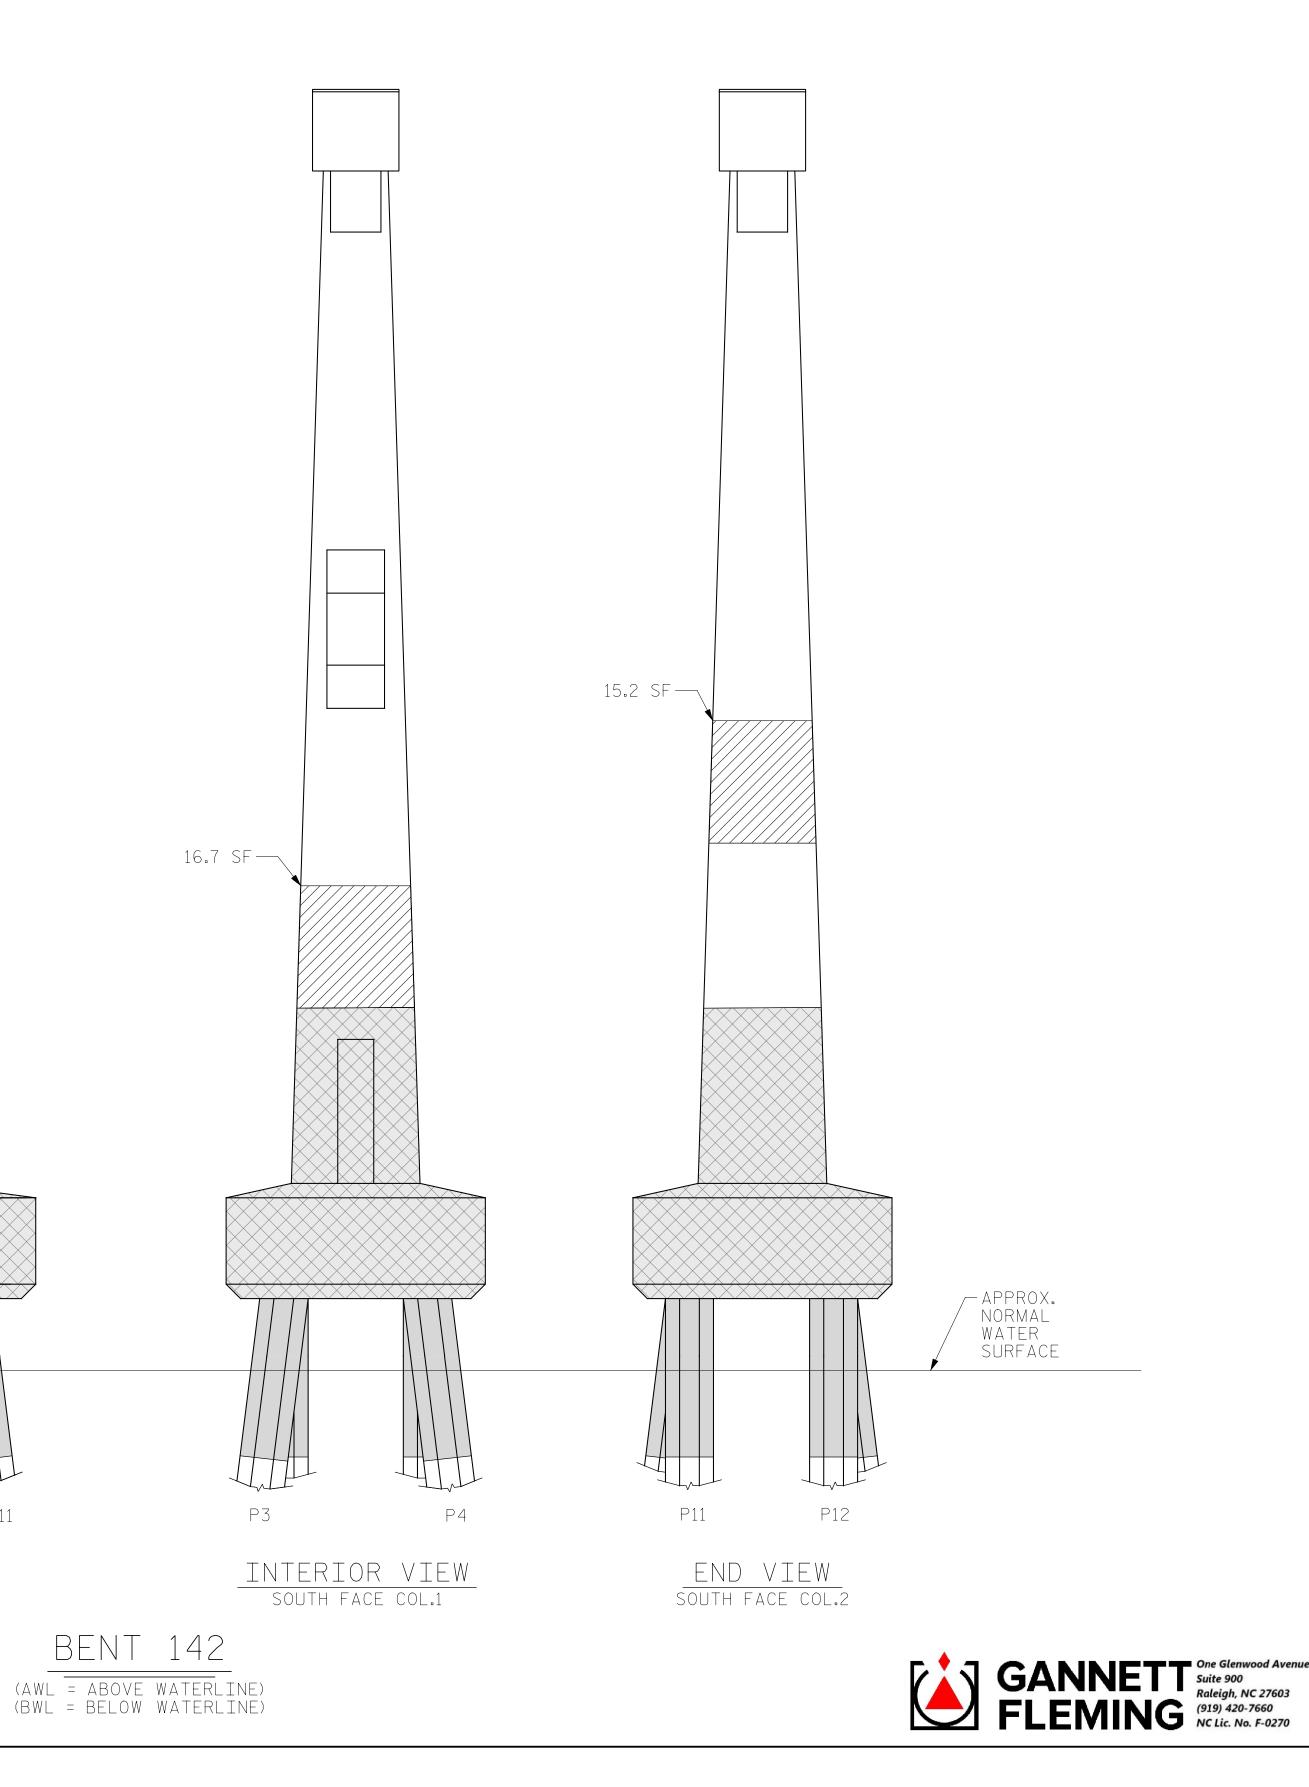

AS-BUILT REPA	IR QU	JANTI	TY TA	BLE					
BENT 142									
CAP REPAIRS	ESTI	МАТЕ	ACTUAL						
SHOTCRETE REPAIRS	3.0 SF	1.5 CF	SF	CF					
EPOXY RESIN INJECTION	_	LF		LF					
COLUMN REPAIRS	ESTI	МАТЕ	ACTUAL						
SHOTCRETE REPAIRS	55.6 SF	27.8 CF	SF	CF					
EPOXY RESIN INJECTION	- LF		LF						
PILE REPAIRS	ESTIMATE		ACTUAL						
FRP PROTECTIVE SYSTEM AWL	_	SF	SF						
FRP PROTECTIVE SYSTEM BWL		O SF	SF						

FOR CAP REPAIRS: VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1"BEHIND REBAR AND MIN. 2"CL TO SAWCUT. SEE REPAIR DETAILS.

NOTES:

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER THE CONTRACTOR SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.

FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR CONCRETE REPAIR DETAILS, SEE ``TYPICAL CAP, COLUMN & UNDERDECK REPAIR DETAILS''& ``PILE CONCRETE RESTORATION DETAILS'' SHEETS.

FOR FOOTING, COLUMN, AND STRUT REPAIR DETAILS, SEE ``PILE FOOTING RESTORATION' SHEET.

FOR PILE CONCRETE RESTORATION, SEE SPECIAL PROVISIONS.

FOR FRP PROTECTIVE SYSTEM, SEE SPECIAL PROVISIONS.

FOR FRP PROTECTIVE SYSTEM DETAILS AND UNDERWATER MORTAR REPAIRS, SEE ``PILE FRP PROTECTIVE SYSTEM DETAILS' SHEET.

ERI - EPOXY RESIN INJECTION

- FRP PROTECTIVE SYSTEM
- SHOTCRETE REPAIRS
- PILE FOOTING RESTORATION \times

▲ FRP PROTECTIVE SYSTEM BELOW WATERLINE MAY INCLUDE APPROVED UNDERWATER MORTAR REPAIRS

PROJECT NO	HB-0017
DARE	COUNTY
BRIDGE NO	270009

STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH





ACB0062119D/4CD							
	REVISIONS					SHEET NO.	
DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED	NO.	BY:	DATE:	NO.	BY:	DATE:	S-221 Total Sheets
SIGNATURES COMILLIED				4			355