

AS-BUILT REPAIR QUANTITY TABLE

SPAN B		
	ESTIMATE	ACTUAL
SCARIFYING BRIDGE DECK	602.0 SQ. YDS.	
SHOTBLASTING BRIDGE DECK	602.0 SQ. YDS.	
CLASS II SURFACE PREPARATION	6.0 SQ. YDS.	
CONCRETE DECK REPAIR FOR PC OVERLAY	6.0 SQ. YDS.	
POLYMER CONCRETE MATERIALS	20.9 CU. YDS.	
PLACING & FINISHING PC OVERLAY	602.0 SQ. YDS.	
GROOVING BRIDGE FLOORS	5000.0 SQ. FT.	
SHOTCRETE REPAIRS		
	ESTIMATE	ACTUAL
	AREA SQ. FT.	VOLUME CU. FT.
CONCRETE PARAPET	1.1	0.4

NOTES



REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

FOR CONCRETE DECK REPAIR FOR PC OVERLAY, PC MATERIALS, AND PLACING AND FINISHING PC OVERLAY, SEE POLYMER CONCRETE BRIDGE DECK OVERLAY SPECIAL PROVISION.

FOR SECTION B-B, SEE "JOINT DETAILS" SHEET.

TOP OF DECK SURFACE REPAIR QUANTITIES REPRESENT ESTIMATED VALUES OF CLASS II SURFACE PREPARATION AND CONCRETE DECK REPAIR FOR PC OVERLAY AFTER REMOVAL OF UNSOUND CONCRETE (MIN. 2" CLEAR TO SAWCUT.) SEE OVERLAY SURFACE PREPARATION FOR POLYMER CONCRETE SPECIAL PROVISION.


FOR SCARIFYING BRIDGE DECK, SHOTBLASTING BRIDGE DECK AND CLASS II SURFACE PREPARATION, SEE OVERLAY SURFACE PREPARATION FOR POLYMER CONCRETE SPECIAL PROVISION.

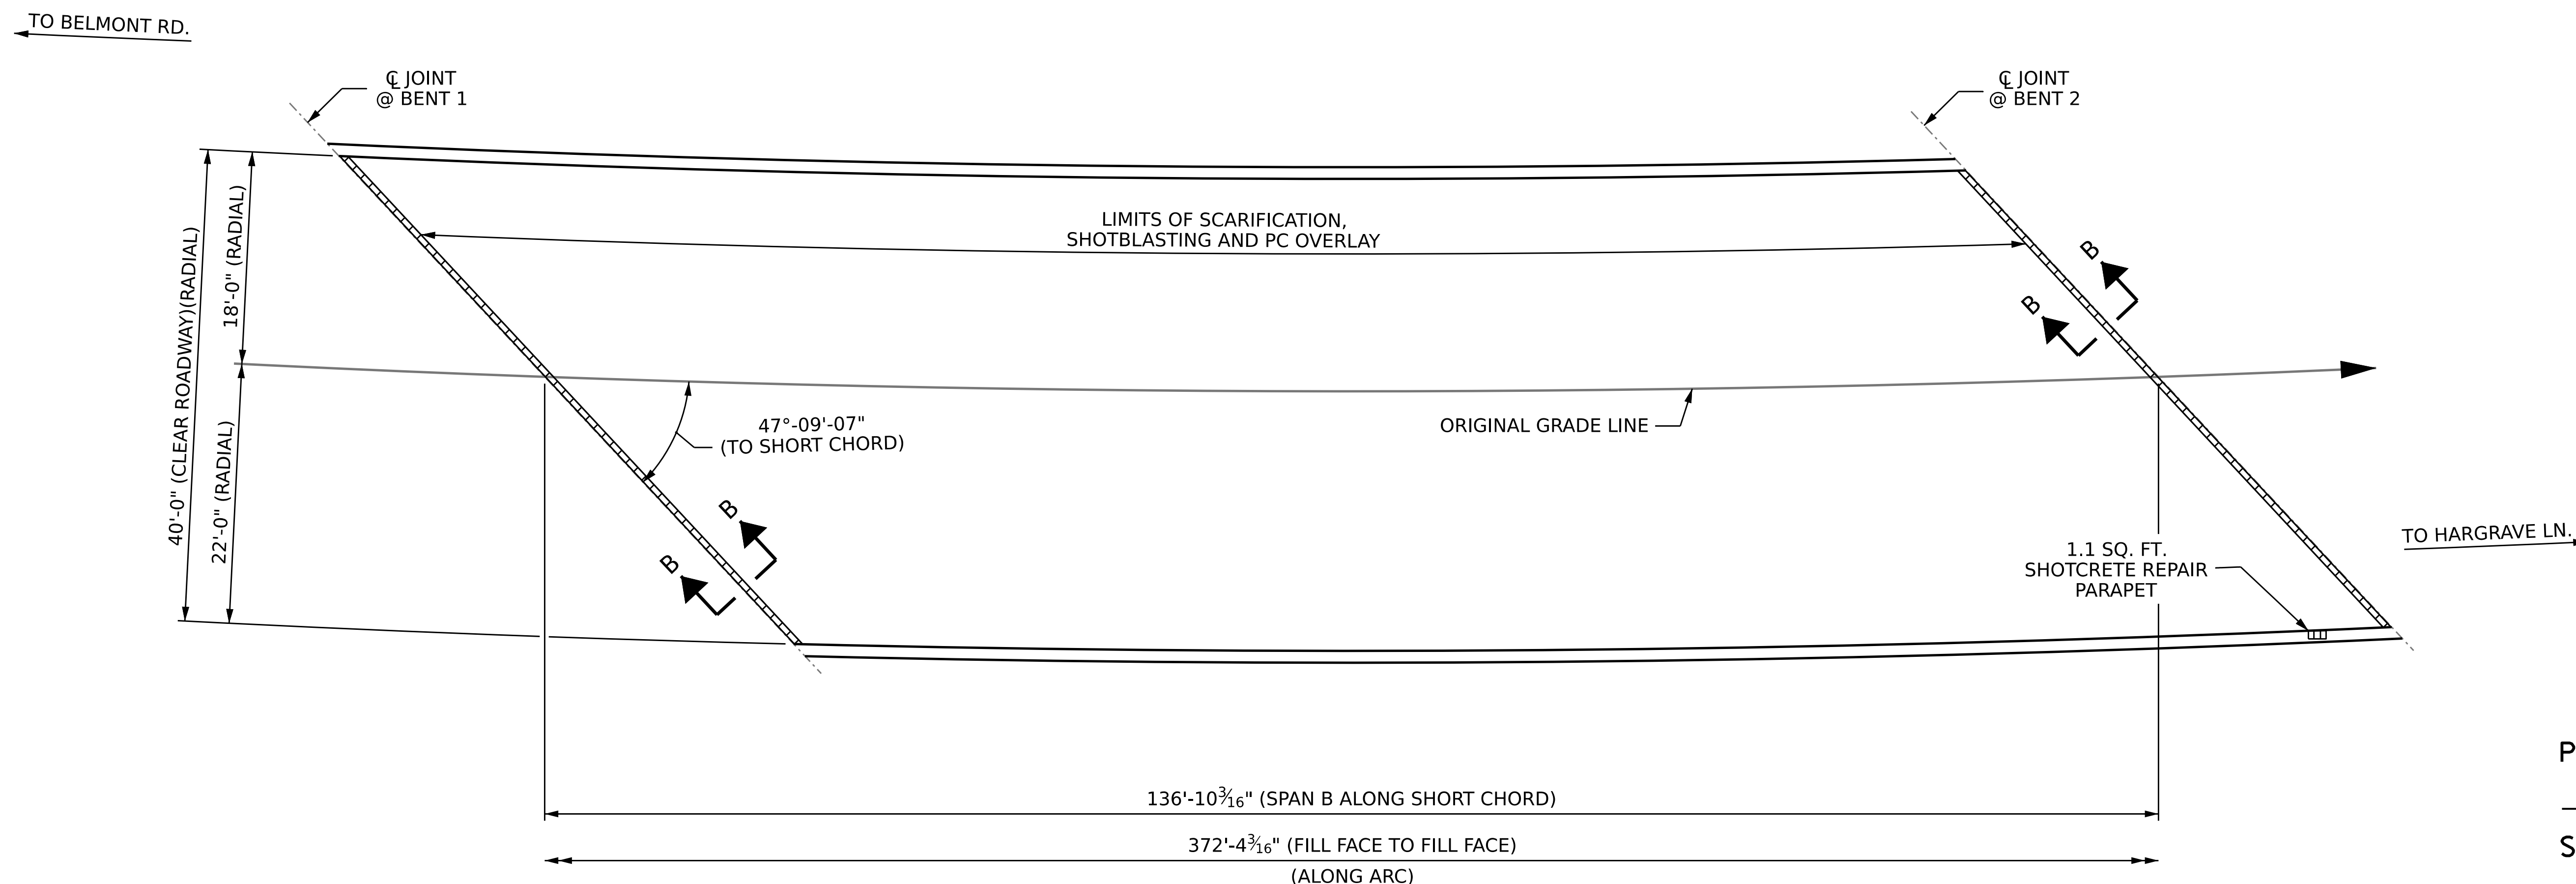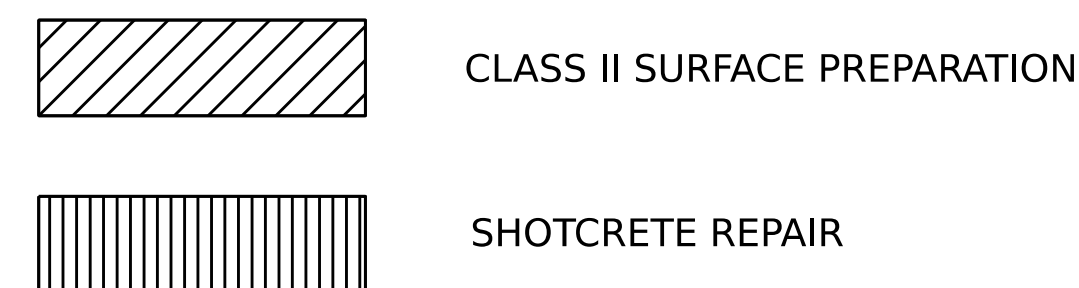

SPAN B

PROJECT NO. **I-5950**
DAVIDSON COUNTY
 STATION: **280137**

SHEET 2 OF 4

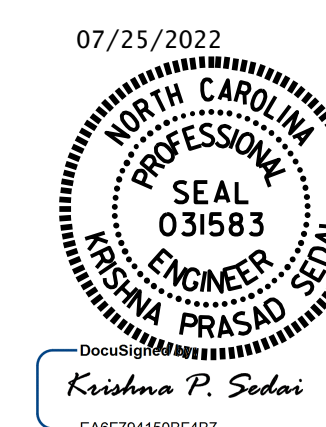

STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH

**DECK SURFACE REPAIR
 SPAN B**

DOCUMENT NOT CONSIDERED
 FINAL UNLESS ALL
 SIGNATURES COMPLETED

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	S2-05
1			3			TOTAL SHEETS
2			4			21

DRAWN BY : A. SORSENGINH DATE : 2/2022
 CHECKED BY : E. BAYISSA DATE : 4/2022