
DocuSign Envelope ID: 4ACFF300-E9E4-4332-AF3D-03F3420F8C1C

+

+



DRAWN BY :	ALLEN J.MCSWAIN	DATE :	01/2022
CHECKED BY :	FIDEL L.FLORES	DATE :	01/2022
DESIGN ENGINEER (DF RECORD:A.AGUIRRE	DATE :	01/2022

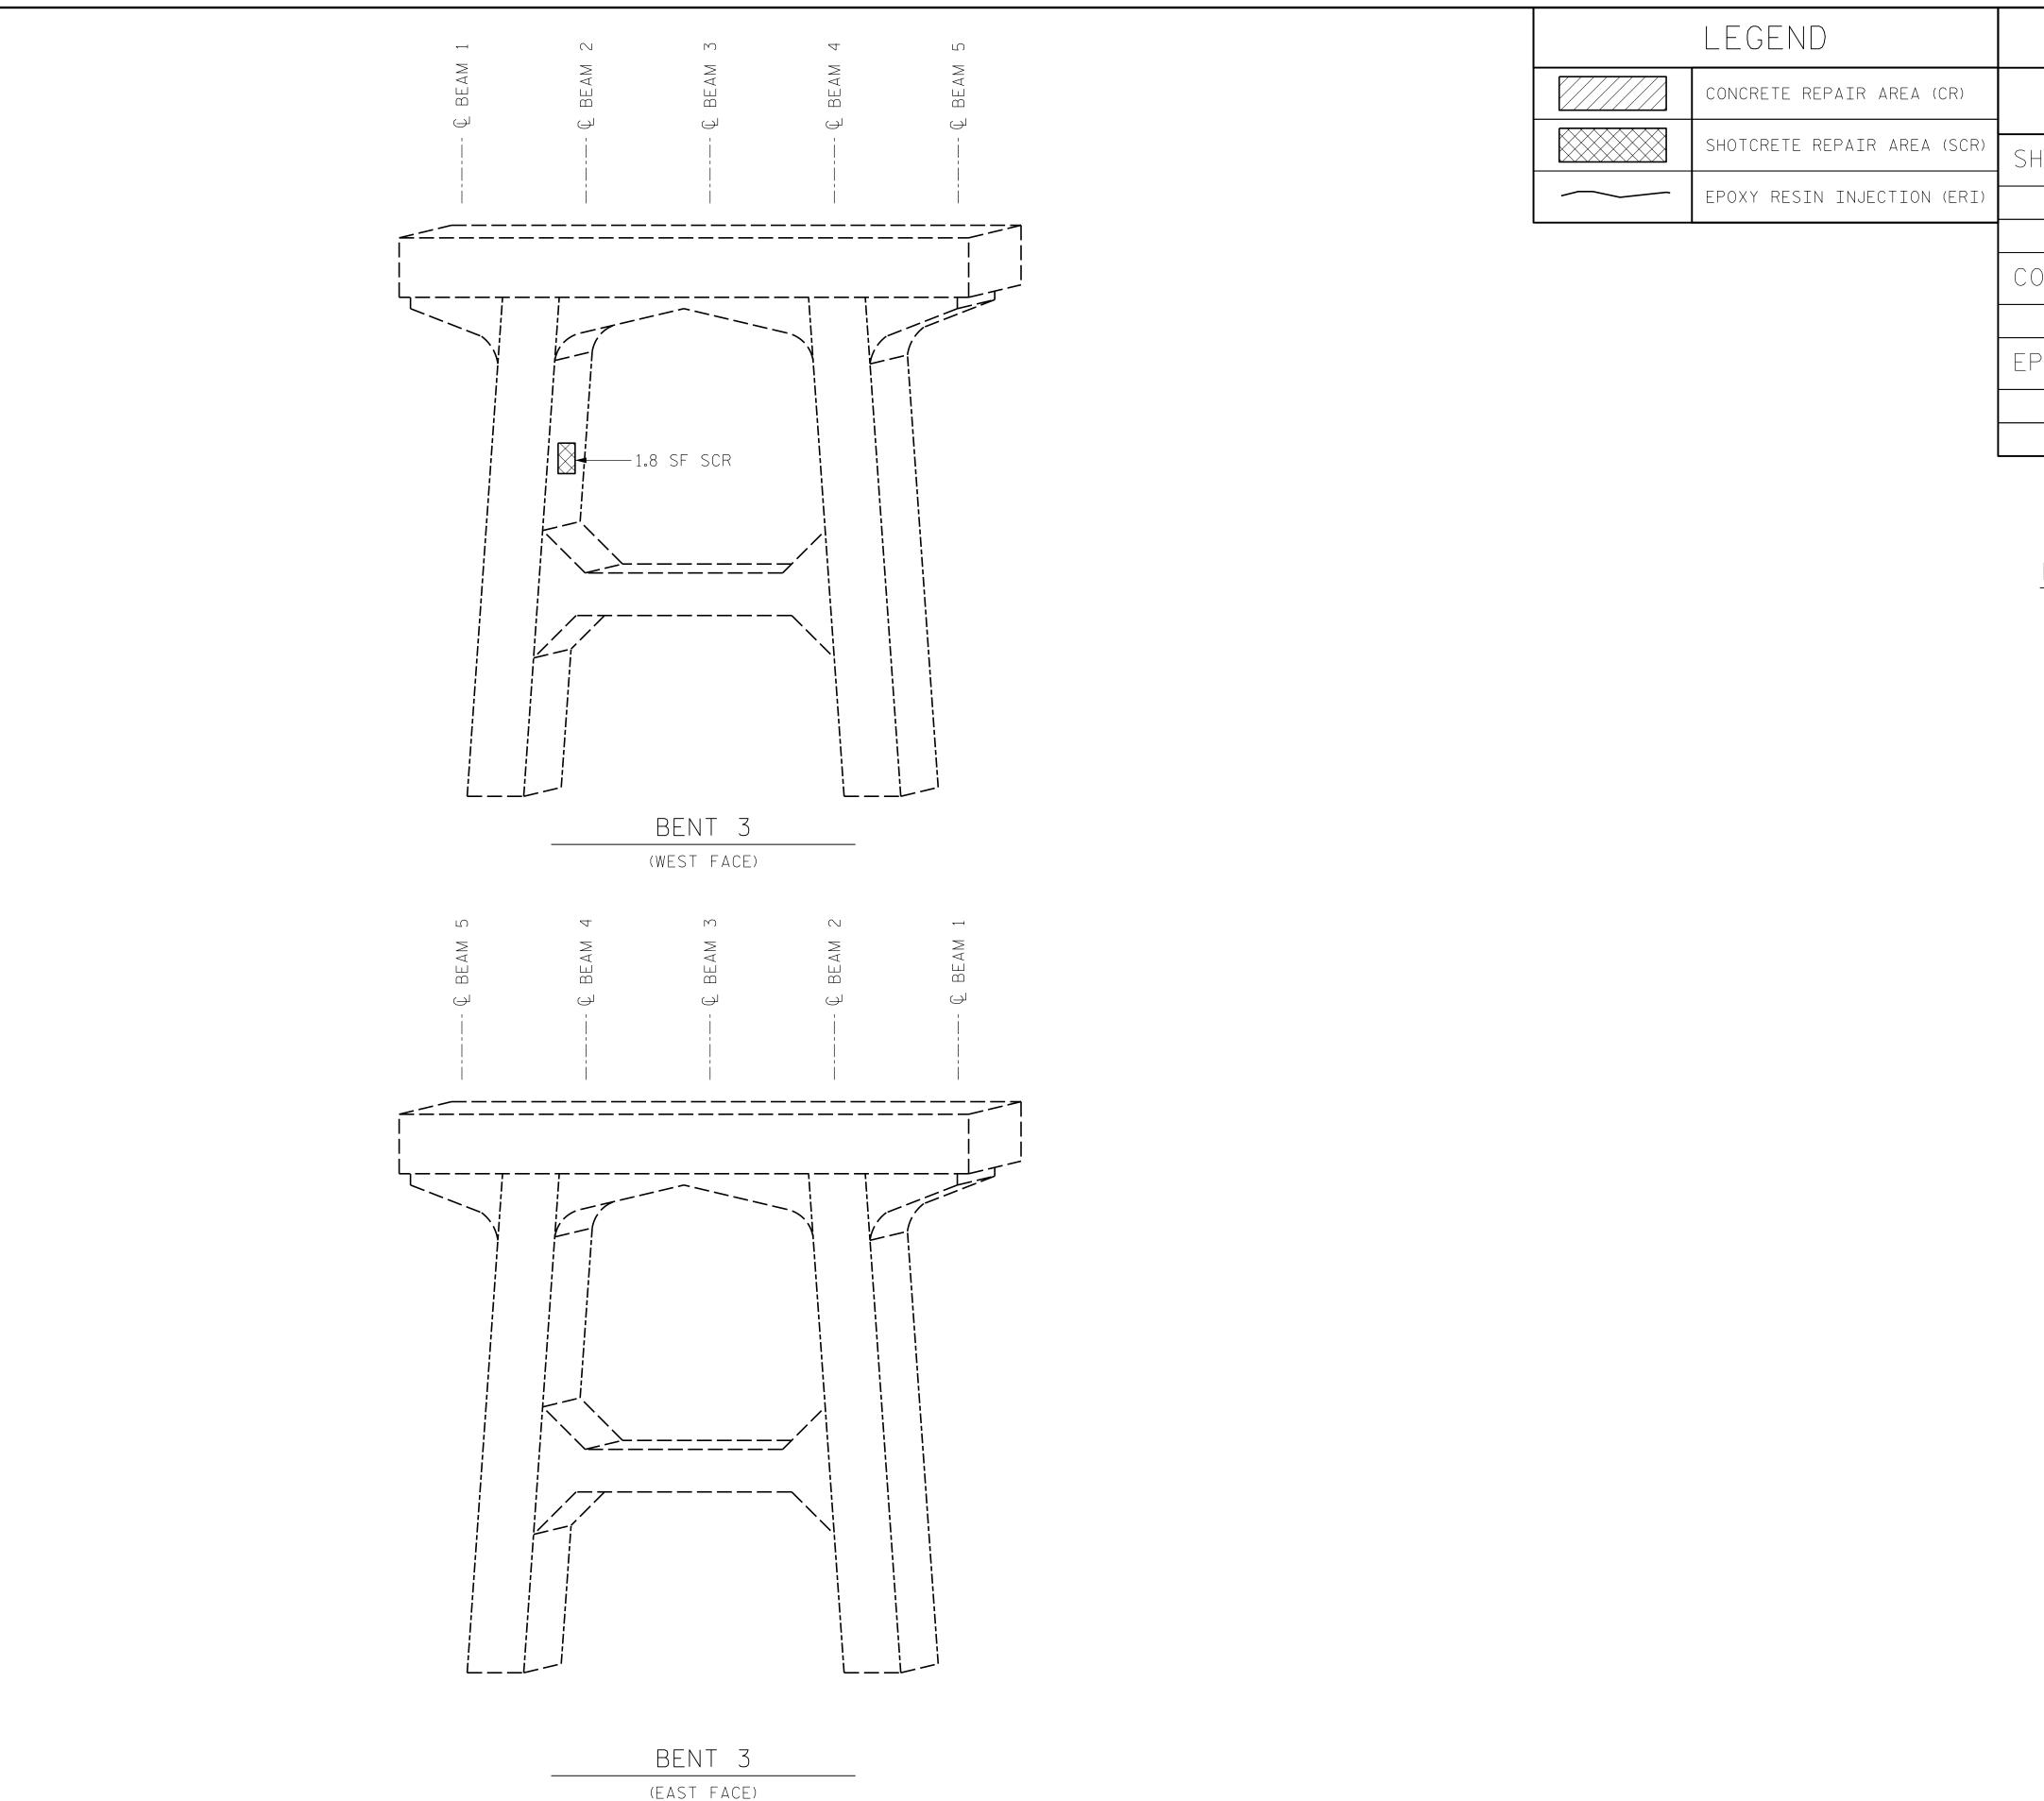

AS-BUILT REPAIR QUANTITY TABLE						
	QUANTITIES					
	ESTIMATE		ACTUAL			
HOTCRETE REPAIRS	AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.		
CAP/BACKWALL	-	-				
COLUMN/PILE	1.8	0.6				
ONCRETE REPAIRS	AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.		
САР	_	_				
POXY RESIN INJECTION	LIN.FT.		LIN.FT.			
CAP/BACKWALL	-	-				
COLUMN/PILE		-				

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE.MINIMUM OF 1″BEHIND REBAR AND MINIMUM 2″CLEARANCE TO SAWCUT.FOR REPAIR DETAILS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE.IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE TABLE ABOVE.

CRACKING LOCATIONS AND QUANTITIES FOR LOCATIONS DESCRIBED AS "SCATTERED THROUGHOUT" IN THE INSPECTION REPORT ARE BASED ON THE BEST INFORMATION AVAILABLE. THE ENGINEER AND CONTRACTOR SHALL IDENTIFY AND REPAIR ALL CRACKS >=1/16" AS DESCRIBED IN THE SPECIAL PROVISIONS AT EACH BENT.

AVERAGE CONCRETE COVER IS EXPECTED TO BE FROM 2"TO 3"ON THE CAP AND FROM $1^{1}/_{2}$ "TO 2"ON THE PILES.ACTUAL CONCRETE COVER SHALL BE DETERMINED BY THE CONTRACTOR AND PRESENTED TO THE ENGINEER PRIOR TO BEGINNING EXCAVATION/ DEMOLITION.

FOR CONCRETE AND SHOTCRETE REPAIRS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

REPAIRS TO THE BENT CAP MAY REQUIRE BRIDGE JACKING.FOR BRIDGE JACKING,SEE SPECIAL PROVISIONS.

	PROJECT NO. <u>I-5915B</u> <u>IREDELL</u> COUNTY BRIDGE NO. <u>480006</u> Sheet 4 of 11		
DocuSigned by SEAL Dicas A Marine 47259743083073D4Ft OF SUB A AGUINT	STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH SUBSTRUCTURE REPAIRS		
KCA	BENT 3		
	REVISIONS SHEET NO.		
ONSIDERED301 FAYETTEVILLE ST., SUITE 1500S ALLRALEIGH, NC 27601 (919) 882-7839	NO.BY:DATE:S5-1713TOTAL SHEETS		
MPLETED NC FIRM LICENSE: C-1506	1 0 SHEETS 2 4 24		