
+

+

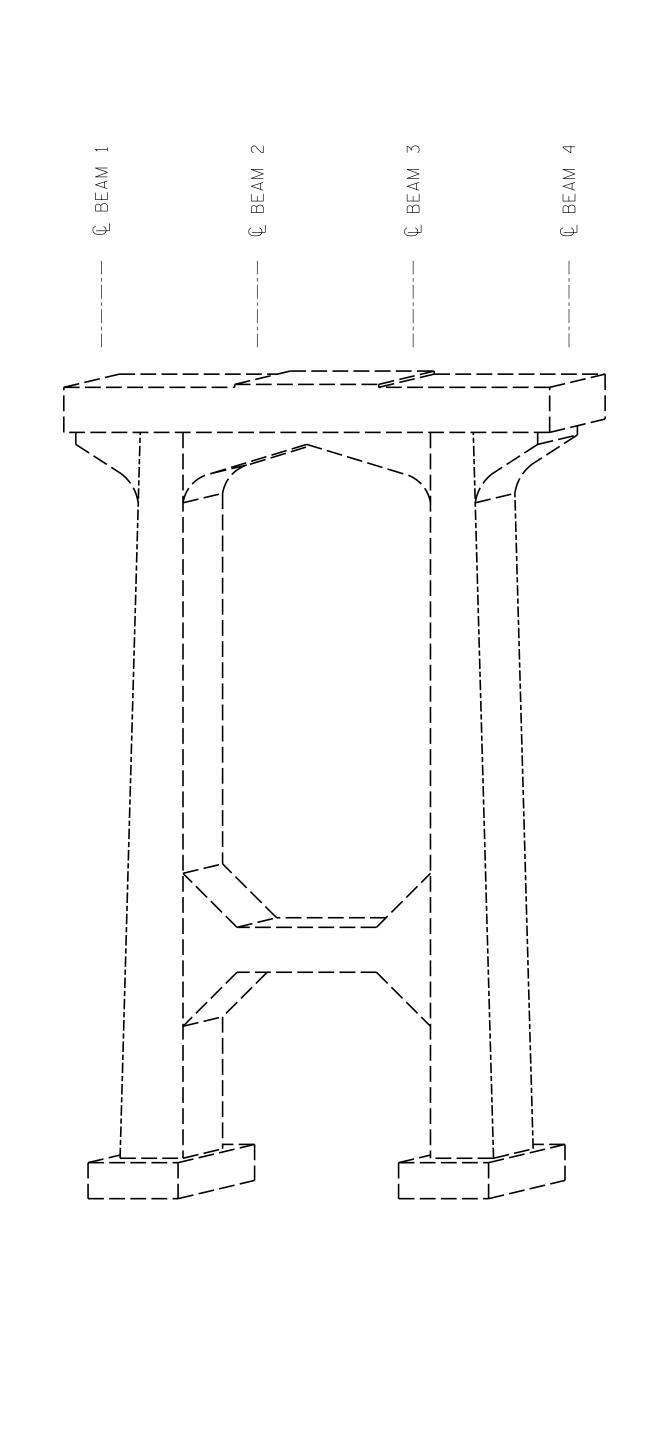


BENT 2 (West face)

DRAWN BY :	ALLEN J.MCSWAIN	DATE : <u>01/2022</u>
CHECKED BY :	FIDEL L.FLORES	DATE : <u>01/2022</u>
DESIGN ENGINEER	OF RECORD: <u>A.AGUIRRE</u>	DATE : <u>01/2022</u>

4/21/2022 I5915B\_SMU\_SBR02\_480102.dgn daguirre

		-		
LEGEND				
	CONCRETE REPAIR AREA (CR)			
	SHOTCRETE REPAIR AREA (SCR)	SF		
	EPOXY RESIN INJECTION (ERI)			

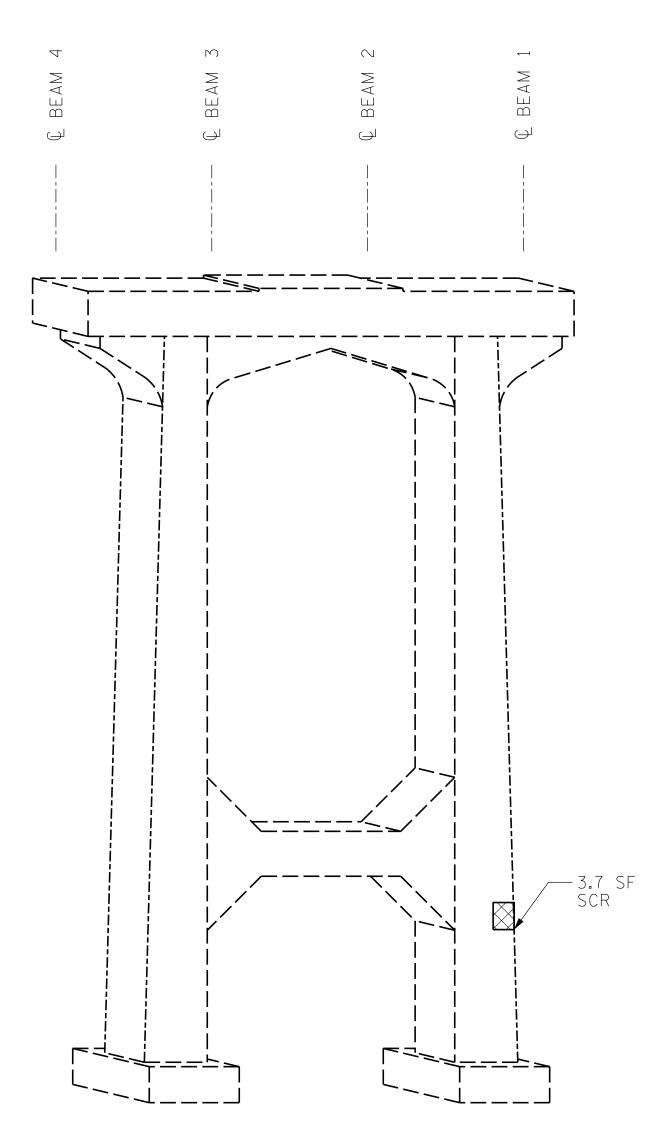

BENT 2 (EAST FACE)

AS-BUILT REPAIR QUANTITY TABLE							
	QUANTITIES						
	ESTIMATE		ACTUAL				
HOTCRETE REPAIRS	AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.			
CAP/BACKWALL	-	-					
COLUMN/PILE	3.7	1.9					
ONCRETE REPAIRS	AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.			
САР	_	_					
POXY RESIN INJECTION	LIN.FT.		LIN.FT.				
CAP/BACKWALL	-						
COLUMN/PILE	-						

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE.MINIMUM OF 1″BEHIND REBAR AND MINIMUM 2″CLEARANCE TO SAWCUT.FOR REPAIR DETAILS, SEE ″CONCRETE RESTORATION DETAILS″ SHEETS.

## NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE.IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE TABLE ABOVE.

CRACKING LOCATIONS AND QUANTITIES FOR LOCATIONS DESCRIBED AS "SCATTERED THROUGHOUT" IN THE INSPECTION REPORT ARE BASED ON THE BEST INFORMATION AVAILABLE. THE ENGINEER AND CONTRACTOR SHALL IDENTIFY AND REPAIR ALL CRACKS >=1/16" AS DESCRIBED IN THE SPECIAL PROVISIONS AT EACH BENT.

AVERAGE CONCRETE COVER IS EXPECTED TO BE FROM 2"TO 3"ON THE CAP AND FROM  $1^{1}/_{2}$ "TO 2"ON THE PILES.ACTUAL CONCRETE COVER SHALL BE DETERMINED BY THE CONTRACTOR AND PRESENTED TO THE ENGINEER PRIOR TO BEGINNING EXCAVATION/ DEMOLITION.

FOR CONCRETE AND SHOTCRETE REPAIRS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

REPAIRS TO THE BENT CAP MAY REQUIRE BRIDGE JACKING.FOR BRIDGE JACKING, SEE SPECIAL PROVISIONS.

		PROJEC 			-5915  co 3Ø1Ø2	UNTY
DocuSigned by: Dicgo & Agur 475874388303304FB	SEAL 048223	DEPA	RTMENT OF	RALEIGH	nsporta <sup>-</sup> TURE	TION
	<b>⟨C</b> ∧		BE	INT 2	) -	
KI	SINGER CAMPO		REVISION			SHEET NO.
SS ALL <b>ral</b> i	FAYETTEVILLE ST., SUITE 1500 EIGH, NC 27601 (919) 882-7839 FIRM LICENSE: C-1506	NO. BY: 1 2	DATE: NO. 3 4	BY:	DATE:	S14-9 TOTAL SHEETS 9