


BENT 2

(WEST FACE)

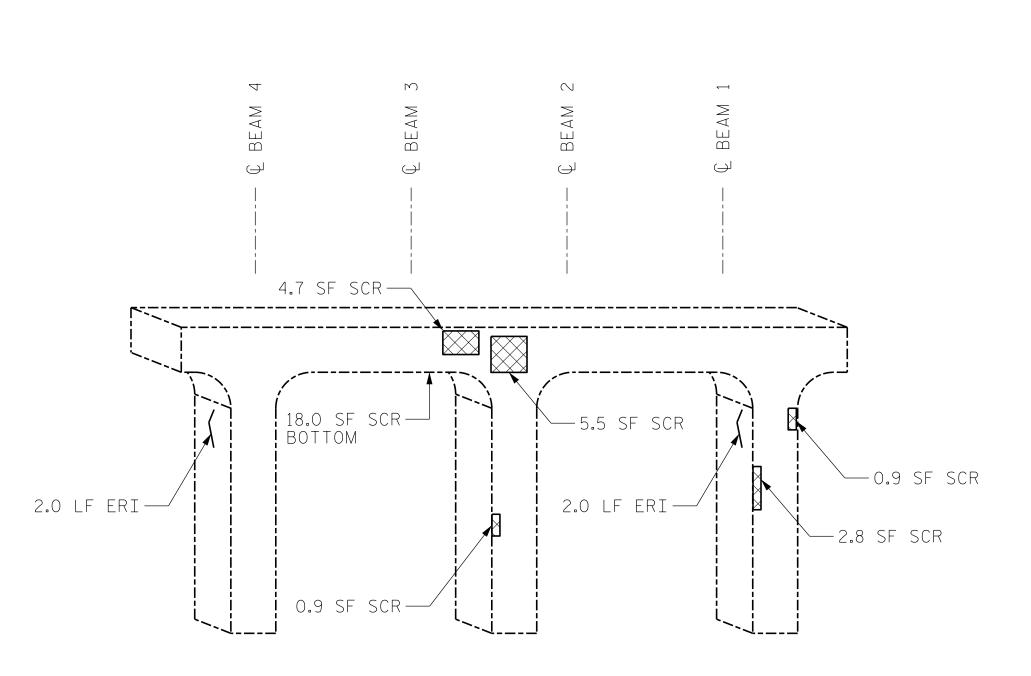

BENT 2

(EAST FACE)

DRAWN BY: ALLEN J.MCSWAIN DATE: 01/2022
CHECKED BY: FIDEL L.FLORES DATE: 01/2022
DESIGN ENGINEER OF RECORD: DIEGO A.AGUIRRE DATE: 01/2022

LEGEND AS-BUILT REPAIR QUANTITY TABLE QUANTITIES CONCRETE REPAIR AREA (CR) ACTUAL ESTIMATE SHOTCRETE REPAIR AREA (SCR) SHOTCRETE REPAIRS EPOXY RESIN INJECTION (ERI) 15.5 CAP/BACKWALL 45.5 COLUMN/PILE 6.2 VOLUME CU.FT. CONCRETE REPAIRS CAP EPOXY RESIN INJECTION LIN.FT. LIN.FT. CAP/BACKWALL \_ 4.0 COLUMN/PILE

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE.MINIMUM OF 1"BEHIND REBAR AND MINIMUM 2"CLEARANCE TO SAWCUT.FOR REPAIR DETAILS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

## NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE TABLE ABOVE.

CRACKING LOCATIONS AND QUANTITIES FOR LOCATIONS DESCRIBED AS "SCATTERED THROUGHOUT" IN THE INSPECTION REPORT ARE BASED ON THE BEST INFORMATION AVAILABLE. THE ENGINEER AND CONTRACTOR SHALL IDENTIFY AND REPAIR ALL CRACKS >= 1/16" AS DESCRIBED IN THE SPECIAL PROVISIONS AT EACH BENT.

AVERAGE CONCRETE COVER IS EXPECTED TO BE FROM 2"TO 3"ON THE CAP AND FROM  $1^{1}/_{2}$ "TO 2"ON THE PILES. ACTUAL CONCRETE COVER SHALL BE DETERMINED BY THE CONTRACTOR AND PRESENTED TO THE ENGINEER PRIOR TO BEGINNING EXCAVATION/ DEMOLITION.

FOR CONCRETE AND SHOTCRETE REPAIRS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

REPAIRS TO THE BENT CAP MAY REQUIRE BRIDGE JACKING. FOR BRIDGE JACKING, SEE SPECIAL PROVISIONS.

PROJECT NO. I-5915B

IREDELL COUNTY

BRIDGE NO. 480104

SHEET 3 OF 4



DEPARTMENT OF TRANSPORTATION
RALEIGH
SUBSTRUCTURE

REPAIRS

BENT 2

KISINGER CAMPO & ASSOCIATES

WISINGER CAMPO

& ASSOCIATES

301 FAYETTEVILLE ST., SUITE 1500

RALEIGH, NC 27601 (919) 882-7839

NC FIRM LICENSE: C-1506

GER CAMPO	REVISIONS						SHEET
SOCIATES	NO.	BY:	DATE:	NO.	BY:	DATE:	S15-
TEVILLE ST., SUITE 1500 IC 27601 (919) 882-7839	1			3			TOTAI SHEET
CENSE: C-1506	2			4			9

4/21/2022 I5915B\_SMU\_SBR02\_480104.dgn daguirre