

p:\gfn\p-w-bentley.com\gfn\p-w-01\Documents\Projects\67945\5-WorKing\Task 010 - I-5955 Greensboro Rehab\Structures\CAD\2.0 100% Plans\405_017_I-5955_SMU_FP_009_400329
 11/17/2022 9:53:47 AM pdf_color_gfclt_FS.plt I-5955.tbl

REPAIR QUANTITY TABLE		
GIRDER REPAIR		
BEAM PLATING REPAIR	ESTIMATE	ACTUAL
	120 LBS	


Ⓟ BEAM PLATING REPAIR

NOTES

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.


FOR BEAM PLATING REPAIR, SEE SPECIAL PROVISIONS.

FOR BEAM REPAIR, SEE "BEAM PLATING REPAIR DETAILS" SHEET.

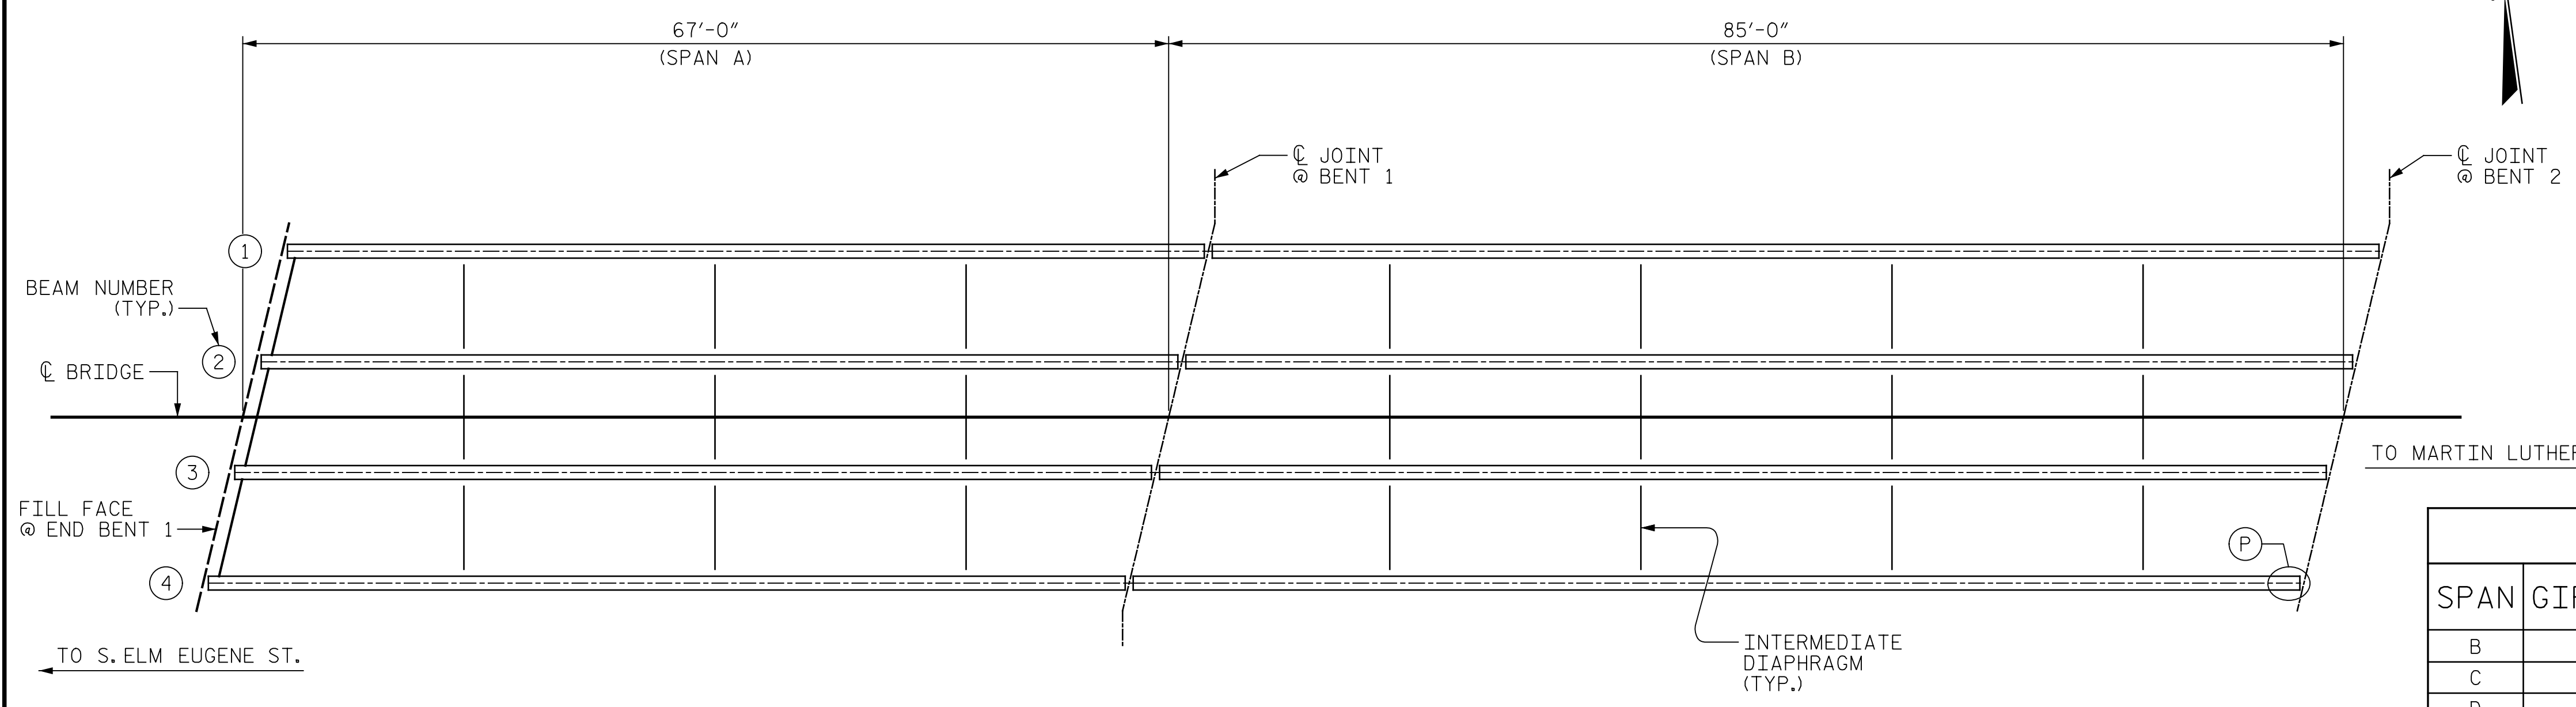


BEAM REPAIR LOCATIONS
(OTHER LOCATIONS MAY EXIST, SEE NOTES)

ANTICIPATED REPAIR LOCATIONS						
SPAN	GIRDER	LOCATION	DIM "A"	DIM "B"	DIM "C"	DIM "D"
B	4	BENT 2	1"	10"	1"	-
C	4	BENT 2	3"	11"	23"	-
D	2	BENT 3	3"	11"	1"	-
D	2	BENT 3	3"	10"	23"	-

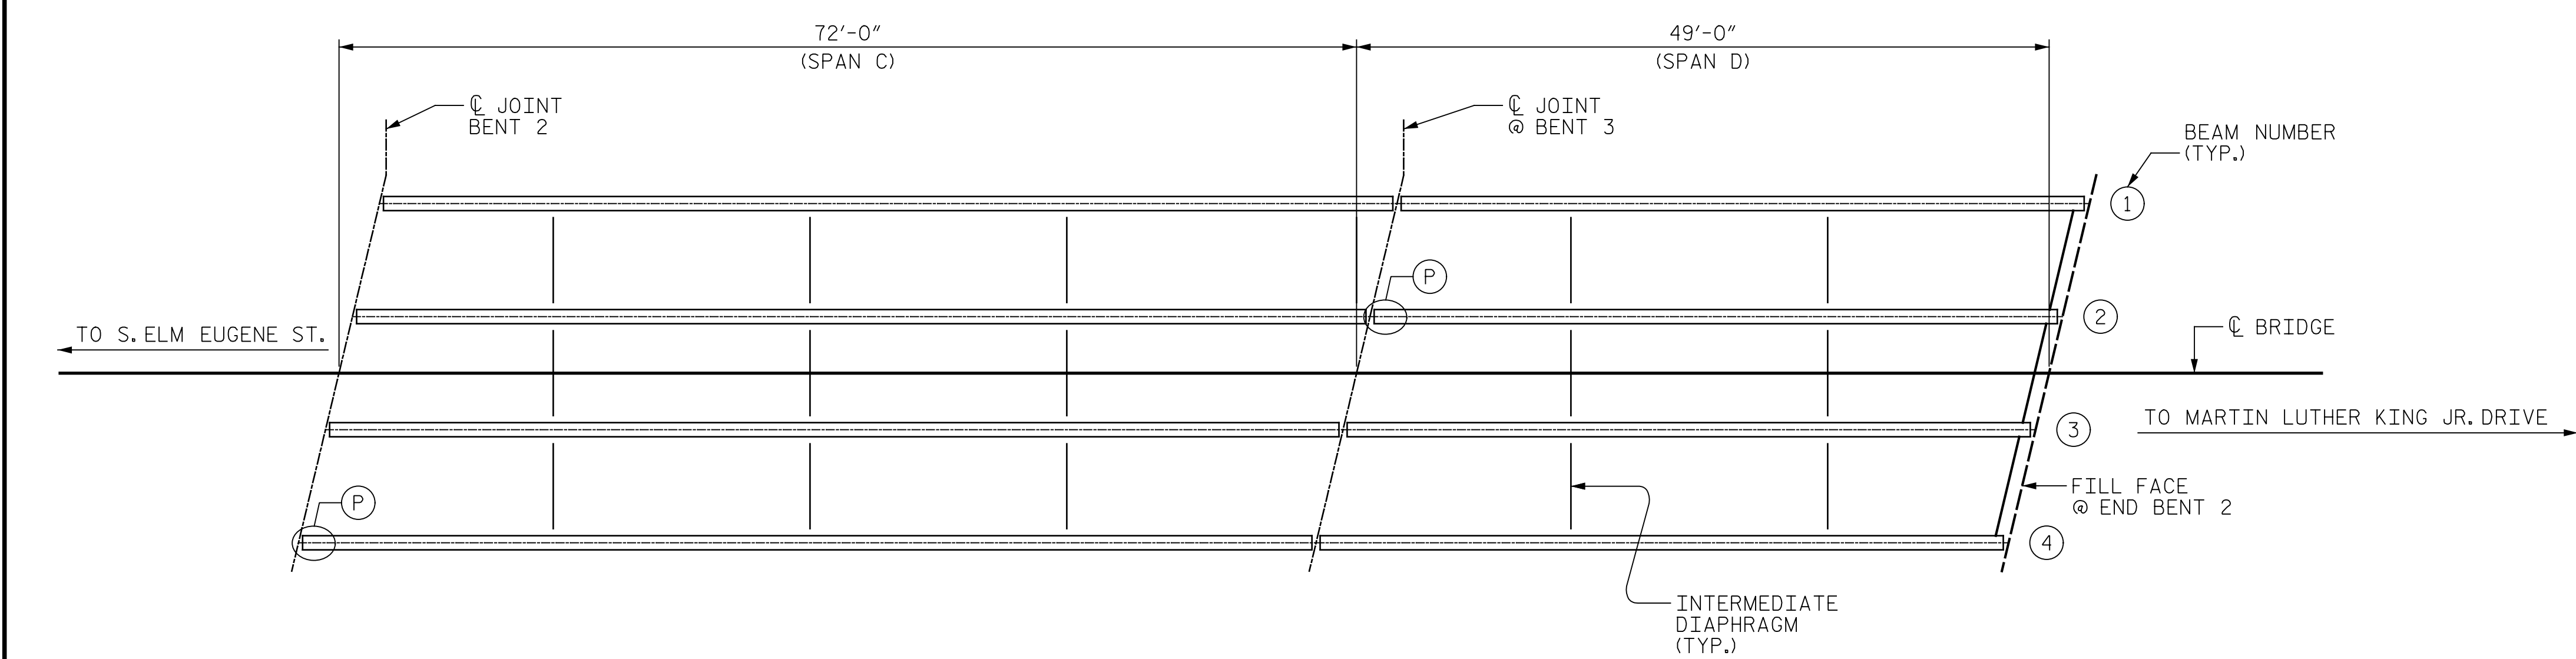

BEAM REPAIR LOCATIONS
(OTHER LOCATIONS MAY EXIST, SEE NOTES)

PROJECT NO. I-5955
GUILFORD COUNTY
 BRIDGE NO. 400329

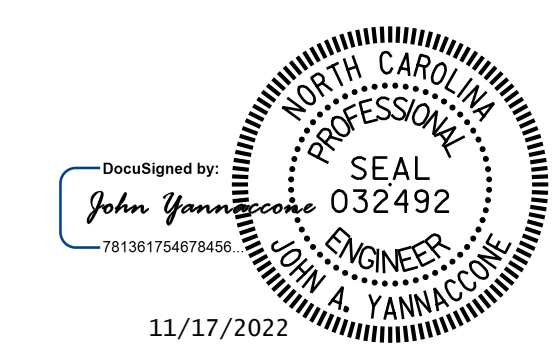

STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH

BEAM REPAIR LOCATIONS

DRAWN BY: J. MYA DATE: 10/2022
 CHECKED BY: J. YANNACCONE DATE: 10/2022



DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	
1			3			S5-9
2			4			TOTAL SHEETS 127