PROJECT REFERENCE NO.

MAXTIME OVERLAP PROGRAMMING DETAIL FOR DEFAULT PHASING

Front Panel

Main Menu >Controller >Overlap >Overlap Parameters/Overlap Timings

Web Interface

Home >Controller >Overlap Configuration >Overlaps

Overlap Plan 1

Overlap	1	2	3	4
Type	FYA 4 - Section			
Included Phases	2	4	6	8
Modifier Phases	1	3	5	7
Modifier Overlaps	=	-		-
Trail Green	0	0	0	0
Trail Yellow	0.0	0.0	0.0	0.0
Trail Red	0.0	0.0	0.0	0.0

MAXTIME OVERLAP PROGRAMMING DETAIL FOR ALTERNATE PHASING

Front Panel

Main Menu > Controller > Overlap > Overlap Parameters / Overlap Timings

Web Interface

Home >Controller >Overlap Configuration >Overlaps

In the table view of the web interface, right click on "Overlap" in the top left corner of the table. Copy the entire contents of Overlap Plan 1. Paste Overlap Plan 1 into Overlap Plan 2. Modify Overlap Plan 2 as shown below and save changes.

Overlap Plan 2

•					
Overlap	1	2	3	4	
Туре	FYA 4 - Section				
Included Phases	-	4	-	8	
Modifier Phases	1	3	5	7	
Modifier Overlaps	-	-	=	-	
Trail Green	0	0	0	0	
Trail Yellow	0.0	0.0	0.0	0.0	
Trail Red	0.0	0.0	0.0	0.0	

NOTICE REMOVED INCLUDED PHASES FOR OL1 AND OL3

FLASHER CIRCUIT MODIFICATION DETAIL

IN ORDER TO INSURE THAT SIGNALS FLASH CONCURRENTLY ON THE SAME APPROACH, MAKE THE FOLLOWING FLASHER CIRCUIT CHANGES:

- 1. ON REAR OF PDA REMOVE WIRE FROM TERM. T2-4 AND TERMINATE ON T2-2.
- 2. ON REAR OF PDA REMOVE WIRE FROM TERM. T2-5 AND TERMINATE ON T2-3.
- 3. REMOVE FLASHER UNIT 2.

THE CHANGES LISTED ABOVE TIES ALL PHASES AND OVERLAPS TO FLASHER UNIT 1.

MAXTIME DETECTOR PROGRAMMING DETAIL FOR ALTERNATE PHASING LOOPS 1A AND 5A

Front Panel

Main Menu >Controller >Detector >Veh Det Plans

Web Interface

Home >Controller >Detector Configuration >Vehicle Detectors

In the table view of web interface right click on "Detector" in the top left corner of the table. Copy the entire contents of Detector Plan 1. Paste Detector Plan 1 into Detector Plan 2. Modify Detector Plan 2 as shown below and save changes.

Plan 2

1A

Detector	Call Phase	Delay
1	1	3
29	0	3

Detector	Call Phase	Delay
15	5	3
31	0	3


THIS ELECTRICAL DETAIL IS FOR THE SIGNAL DESIGN: 08-0506T1 DESIGNED: AUGUST 2021 SEALED: 05/21/2024 **REVISED**:

Signal Upgrade Temporary Design 1 Electrical Detail - Sheet 2 of 3

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

TH CAROL

031464

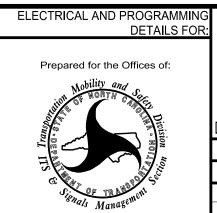

NC 49 (Albemarle Rd) SR 1144 (Mack Rd)

Randolph County Ashebor REVIEWED BY: A.D. Klinksiek August 2021 REVIEWED BY: N.K. Vlanich N.R. Simmons

* CONEER

SIG. INVENTORY NO.

HNTB NORTH CAROLINA, P.C.
343 E. Six Forks Road, Suite 200
Raleigh, North Carolina 27609
NC License No: C-1554
(919) 546-8997

REVISIONS