

STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION

ROY COOPER
GOVERNOR

JAMES H. TROGDON, III
SECRETARY

June 22, 2018

MEMORANDUM TO: Brian Ketner

NCDOT Division 7 Project Engineer

FROM: Gordon Box, PG

GeoEnvironmental Project Manager

GeoEnvironmental Section Geotechnical Engineering Unit

TIP NO: U-6011 WBS: 47146.1.1 COUNTY: ALAMANCE

DIVISION 7

DESCRIPTION: US 70 (SOUTH CHURCH STREET) AT SR 1158 (HUFFMAN

MILL ROAD) IN BURLINGTON. INTERSECTION

DocuSianed by

IMPROVEMENTS.

SUBJECT: GeoEnvironmental Planning Report

The GeoEnvironmental Section of the Geotechnical Engineering Unit performed a Phase I field investigation on May 25, 2018 for the above referenced project to identify geoenvironmental sites of concern. The purpose of this report is to document sites of concern within the project study area that are or may be contaminated. These sites of concern should be included in the environmental planning document in an effort to assist the project stakeholders in reducing or avoiding impacts to these sites. Sites of concern may include, but are not limited to, underground storage tank (UST) sites, dry cleaning facilities, hazardous waste sites, regulated landfills and unregulated dumpsites.

Findings

Five (5) sites of concern were identified within the proposed study area. We anticipate low to moderate monetary and scheduling impacts resulting from these sites. See the following table and figure for details.

Please note that discovery of additional sites not recorded by regulatory agencies and not reasonably discernible during the project reconnaissance may occur. The GeoEnvironmental Section should be notified immediately after discovery of such sites so their potential impact(s) may be assessed.

If there are questions regarding the geoenvironmental issues, please contact me, at 919-707-6859.

Telephone: (919) 707-6850

Customer Service: 1-877-368-4968

cc:

File

roadwaydesign@ncdot.gov

John Pilipchuk, LG, PE, State Geotechnical Engineer
Stephen R. Morgan, PE, State Hydraulics Engineer
Andrew McDaniel, PE, Stormwater NPDES Permit Program - Engineering Supervisor
Brian Hanks, PE, State Structures Engineer
Dale Burton, PE, PLS, State Locations and Surveys Engineer
Carl Barclay, PE, State Utilities Manager
Patty Eason, PE, Division Construction Engineer
Alan Rothrock, Division Right of Way Agent
Chris Chen, PhD, PE, Geotechnical Regional Manager
Cheryl Youngblood, LG, Regional Geological Engineer
Steve Grimes, ROW Unit, Negotiations, State Negotiator
row-notify@ncdot.gov

(01) Property Name:

Lowes

125 Huffman Mill Rd Burlington, NC 27215


Facility ID: NA

Incident Type/Number: 6136 UST Number: WS-2660 **Property Owner:**

Aragon C/O Lowes Co. 1000 Lowes Blvd Mooresville, NC 28115

UST Owner:

Lowe's - Burlington 125 Huffman Mill Rd. Burlington, NC 27215

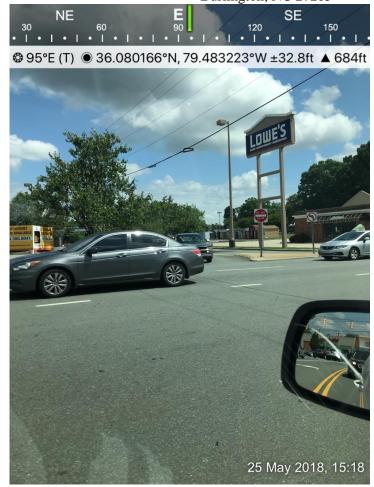

Anticipated Impacts: LOW

This parcel is the site of Lowes home supplies. It is located at approximately 400' south of southeastern intersection Huffman Mill Rd. and S. Church St. The entrance to the parcel is located along the project. A NCDEQ Incident was attributed to Lowes and was closed out 4/4/2001 with No Further Action status.

(02) Property Name:

Fast Med Urgent Care 104 Huffman Mill Rd Burlington, NC 27215

Facility ID: 1087

Incident Type/Number: 15518 UST Number: WS-5816

Property Owner:

Southstar Holdings Burl Ii Llc C/O Collett PO Box 36799 Charlotte, NC 28236

UST Owner:

Jack Church Exxon 101 Huffman Mill Burlington, NC 27215



Anticipated Impacts: LOW

This parcel is the current site of an urgent care office and mattress store but was apparently formerly the site of Jack Church Exxon. It is located at the southeastern intersection of Huffman Mill Rd. and S. Church St. It was apparently a former gas station(s) according to NCDOT Historical Aerial Photography Missions 783, c. 1969 and 616, c. 1957, and 520, c. 1965. An incident was attributed to 101 Huffman Mill Rd., which is apparently this site (as the addresses have apparently changed over time)- the NCDEQ Incident was closed out 3/3/2004 with a Notice of Residual Petroleum attached to the deed.

(03) Property Name:

Sears

309 Huffman Mill Rd Burlington, NC 27215

Facility ID: 23172

Incident Type/Number: 20921 & 14398 **UST Number:** WS-4766 & WS-4432

Property Owner:

Holly Hill Mall Llc 309 Huffman Mill Rd Burlington, NC 27215

UST Owner:

Sears - Holly Hill Mall - B 102 Holly Hill Mall Burlington, NC 27215



Anticipated Impacts: LOW

This parcel is the site of Sears retailer. It is located approximately 800' south of southwestern intersection Huffman Mill Rd. and S. Church St. It formerly may have had a Sears auto center or fueling facility, possibly also with hydraulic lifts. Two UST incidents were closed out 8/11/2000 and 3/17/1999.

(04) Property Name:

A Cleaner World Dry Cleaner/Harris Teeter Gas 2753-2727 S Church St Burlington, NC 27215

Facility ID: 41109

Incident Type/Number: NA/DSCA 10003

UST Number: NA

Property Owner:

Newmarket-Burlington Llc 610 E Morehead St Charlotte, NC 28202

UST Owner:

Harris Teeter Prop. 701 Crestdale Rd Matthews, NC 28105



Anticipated Impacts: Moderate

This parcel is the site of Harris Teeter grocery store and A Cleaner World dry cleaner. These two stores, among others at this small mall, are located at the northwestern intersection of Huffman Mill Rd. and S. Church St. Harris Teeter has new gas station that has no known NCDEQ Incidents. The drycleaner, A Cleaner World, is registered with DSCA DC10003 suggesting they have contaminated soil and/or groundwater.

(05) Property Name:

Walgreens 2585 S Church St Burlington, NC 27215

Facility ID: NA

Incident Type/Number: NA

UST Number: NA

Property Owner:

MLG Burlington LLC c/o Walgreen Co Tax

Dept. 12045 PO Box 1159 Deerfield, IL 60015

UST Owner:

NA



Anticipated Impacts: LOW

This parcel is the site of Walgreens. It is located at the northeastern intersection of Huffman Mill Rd. and S. Church St. The site was formerly a gas station per NCDOT Historical Aerial Photography Mission 783, c. 1969.

