


4-SECTION PPLT FYA OUTPUT REMAPPING PROGRAMMING DETAIL

(program controller as shown below)

1. Before proceeding with output programming, be sure to switch the “RUN ENABLE STATUS” to “OFF”. The “RUN ENABLE STATUS” setting is located from Main Menu, key strokes 1-7.
2. The Flashing Yellow Arrow in a 4-section PPLT FYA head is controlled by a normally unused PED Yellow output. This programming takes a specific PED Yellow output and remaps it to the appropriate Overlap Green output.

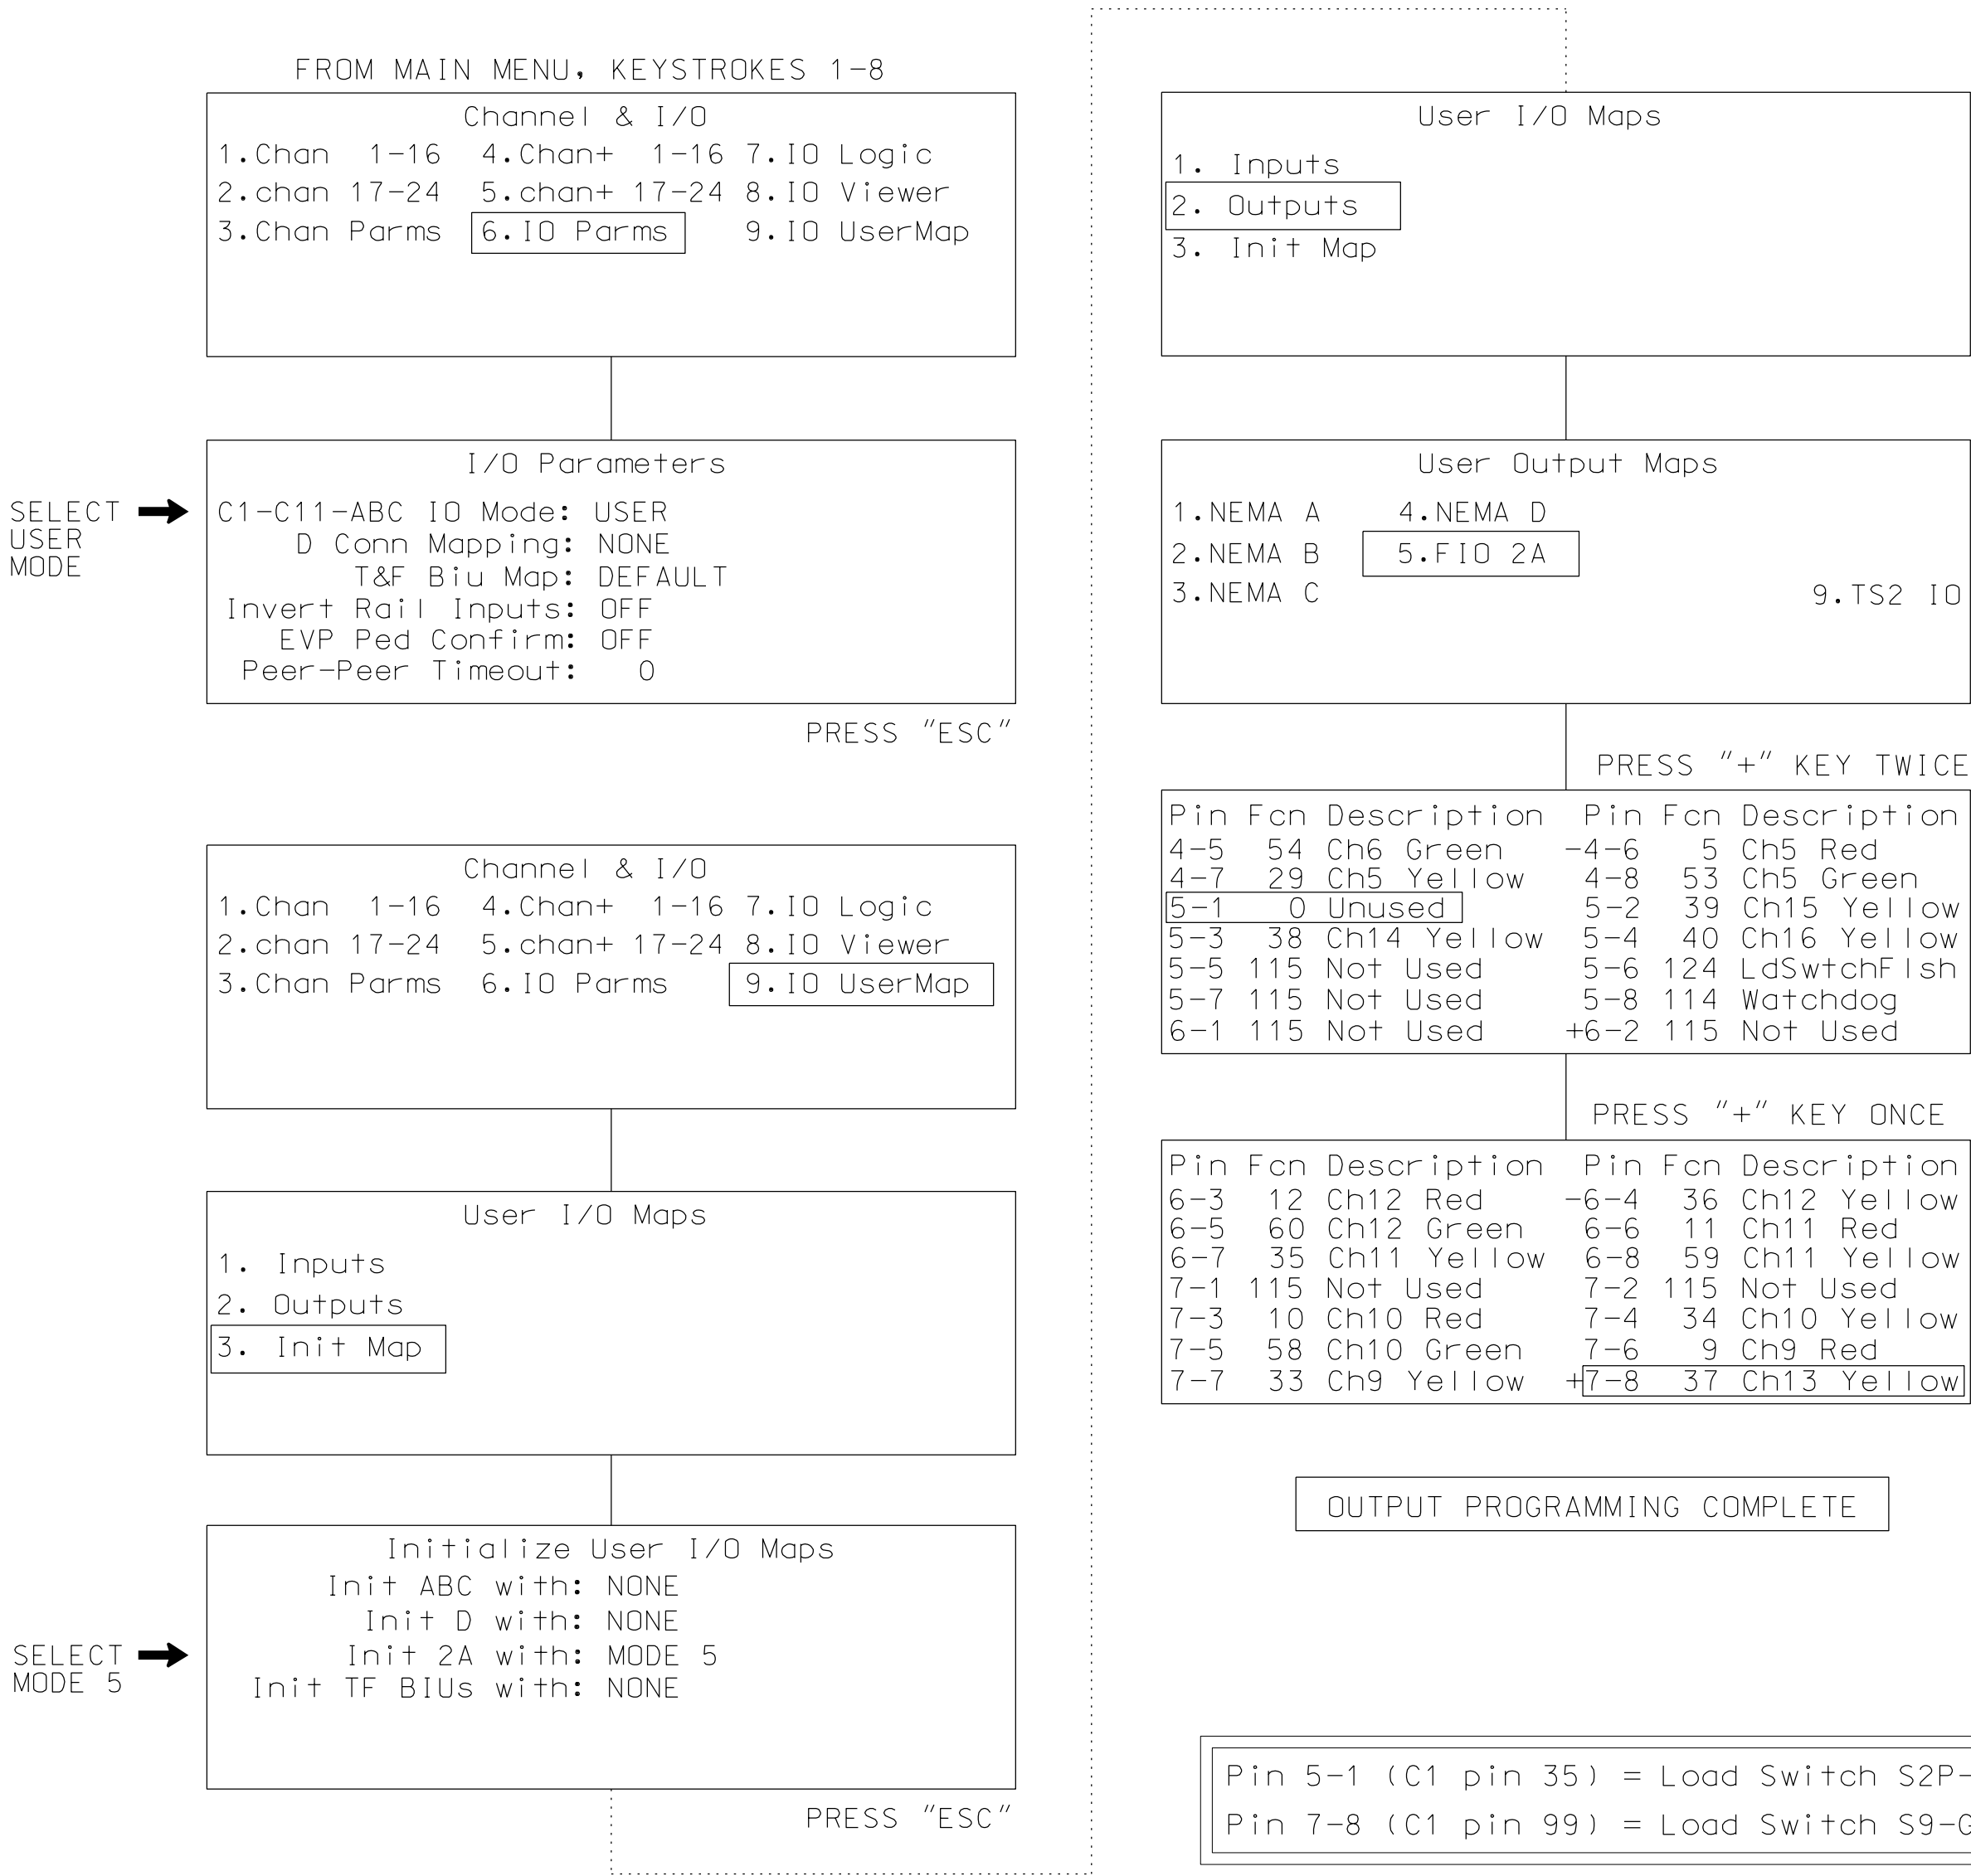

- ! Press the “*” key to return to Main Menu. Now
- o go back to “RUN-ENABLE STATUS” and switch to “ON”.


NOTE

I/O re-programming is necessary for proper FYA operation. See Channel & I/O Programming Detail for FYA Operation on this sheet.

CHANNEL & I/O PROGRAMMING DETAIL FOR FYA OPERATION

(program controller as shown below)

This programming takes the output that drives a Flashing Yellow Arrow and makes it flash. It also specifies which overlap is to be overridden for the FYA to display properly.


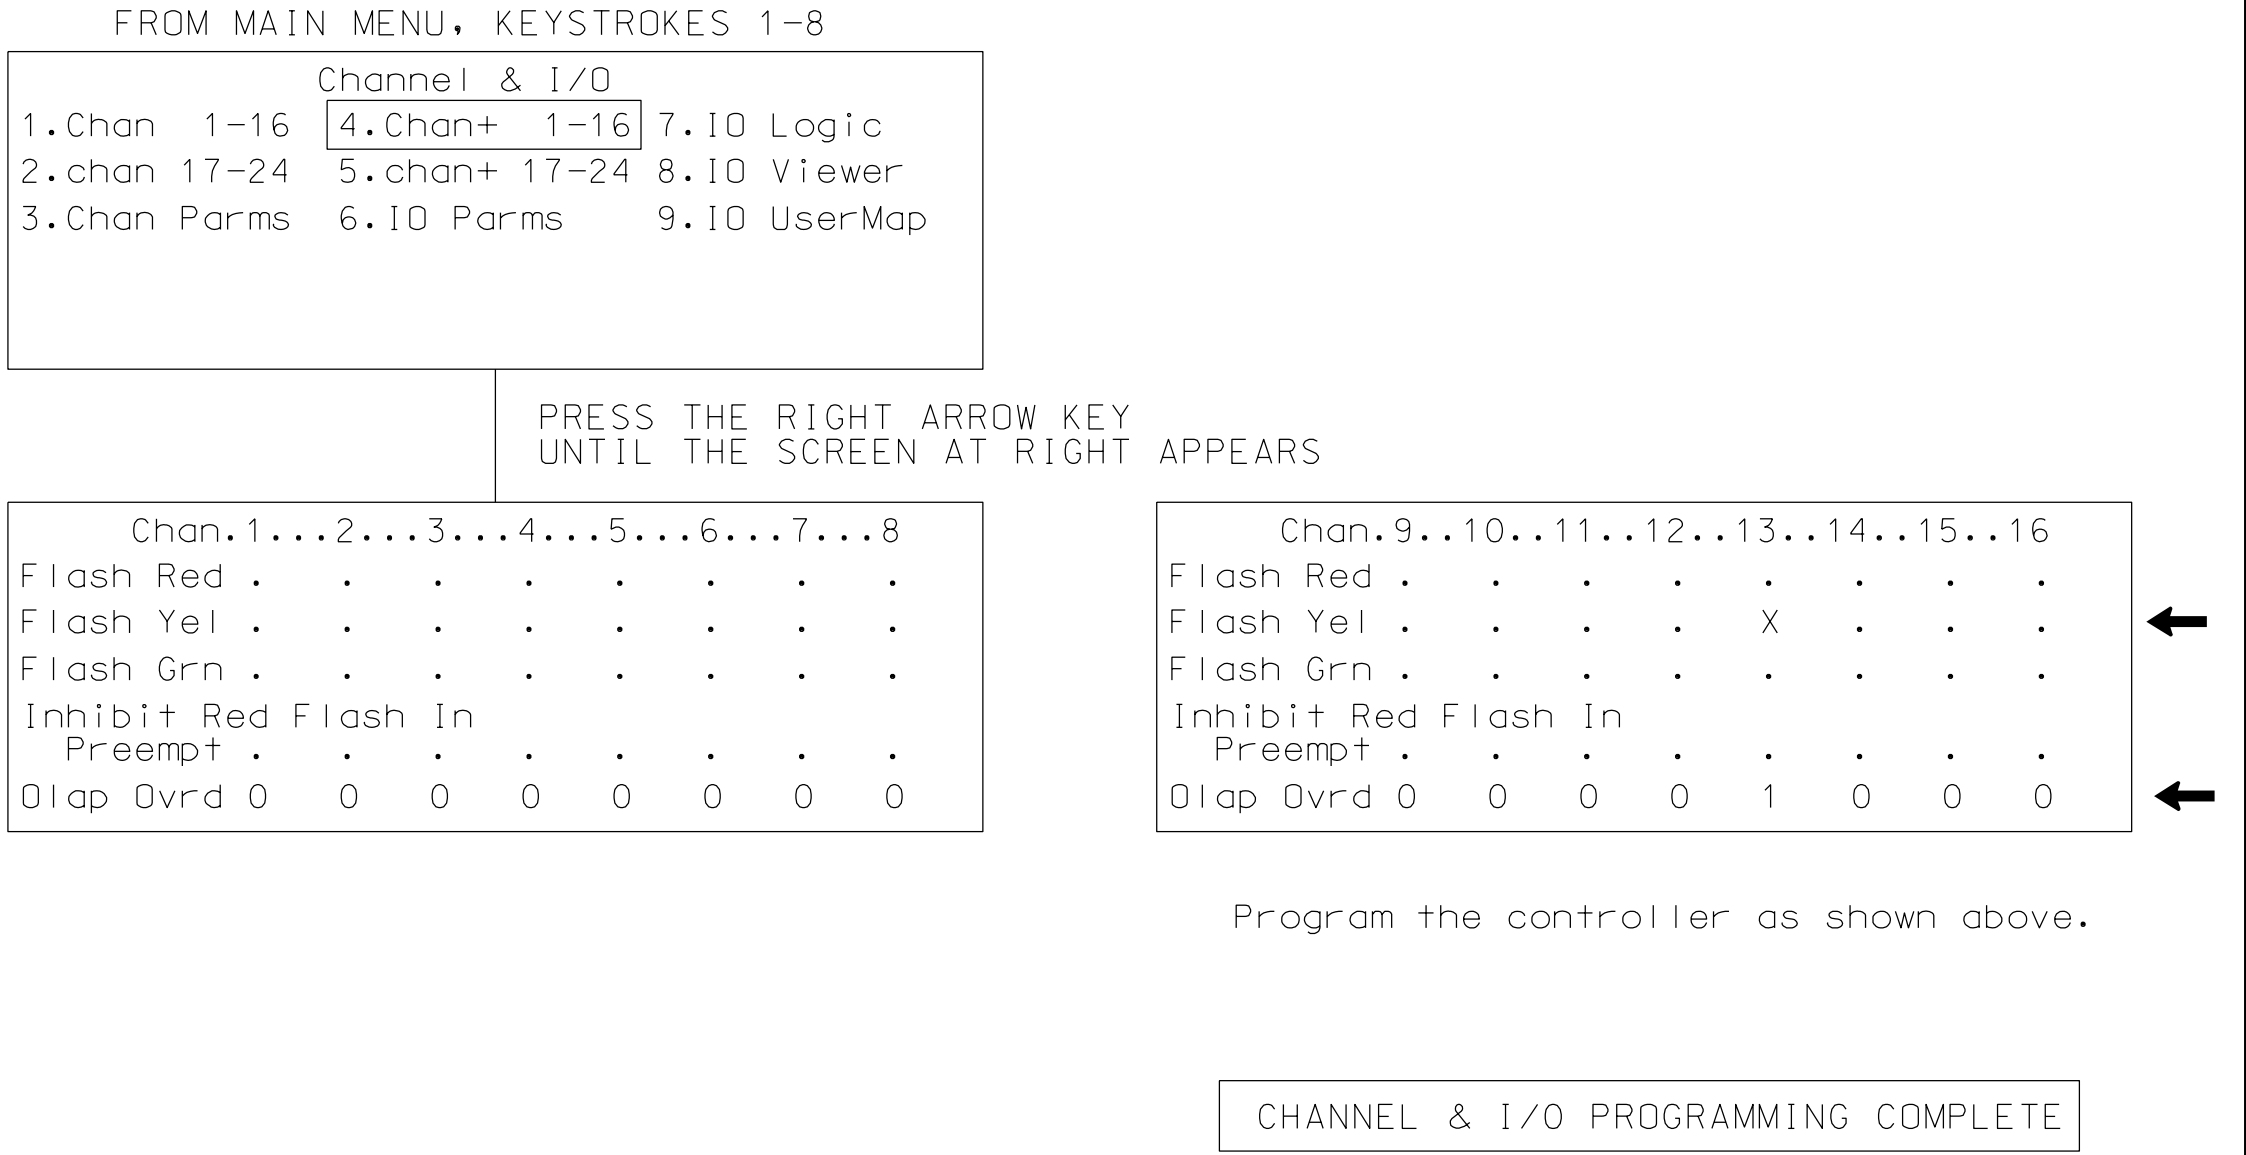


NOTE

Output remapping is necessary for proper FYA operation. See the 4-Section PPLT FYA Output Programming Detail on this.

THIS ELECTRICAL DETAIL IS FOR THE SIGNAL DESIGN: 07-1648T1
DESIGNED: January 2025
SEALED: 03-14-2025
REVISED: N/A

Electrical Detail - Sheet 3 of 3
Temporary Design 1

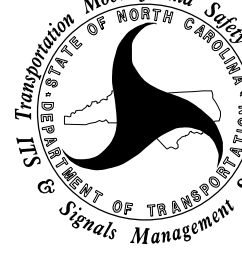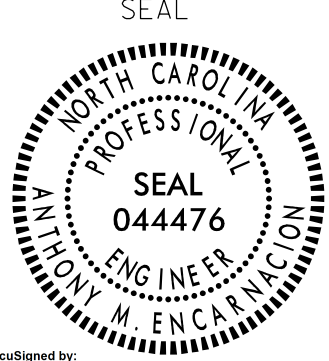ELECTRICAL AND PROGRAMMING DETAILS FOR: Prepared for the Offices of:  750 N.Greenfeld Pkwy,Garner,NC 27529	SR 1850 (Sandy Ridge Road) at I-40 EB Ramps		DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED SEAL  SEAL 044476 ENGINEER Designed by: Anthony Encarnacion 3/14/2025 SIGNATURE DATE SIG. INVENTORY NO. 07-1648T1	
	Division 7	Guilford County		Greensboro
	PLAN DATE: January 2025	REVIEWED BY: AM Encarnacion		
	PREPARED BY: JT Stiff	REVIEWED BY: PL Alexander		
	REVISIONS	INIT.		DATE

 **AtkinsRéal**
1616 EAST MILLBROOK ROAD, SUITE 160
RALEIGH, NORTH CAROLINA 27609
(919) 876-6888 NCBEES #F-0326