



STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION

BEVERLY EAVES PERDUE
GOVERNOR

EUGENE A. CONTI, JR.
SECRETARY

April 15, 2009

Addendum No. 1

RE: Contract ID: C202254
WBS# 42298.3.GV1
F.A. # IMS-040-1(197)45
Buncombe County (I-5108)
I-40 From MP-46 To MP-50

April 21, 2009 Letting

To Whom It May Concern:

Reference is made to the proposal form recently furnished to you on this project.

The following revisions have been made to the proposal:

On Page Nos. 53 and 54 the project special provision entitled "Concrete Deck Repair using Elastomeric Concrete" has been revised. Please void Page Nos. 53 and 54 in your proposal and staple the revised Page Nos. 53 and 54 thereto.

On Page No. 3 of the existing item sheets, by copy of this addendum, the following pay item is hereby deleted: "28-8893000000-E-SP Concrete Deck Repair Using Elastomeric Concrete (Quantity = 1,182 SY)". The Contractor's bid must not include this pay item. On Page No.2 of the new item sheets the following three new pay items are hereby added: 29-8893000000-E-SP Concrete Deck Repair (Class I) Using Elastomeric Concrete (Quantity = 768 SY), 30-8893000000-E-SP Concrete Deck Repair (Class II) Using Elastomeric Concrete (Quantity = 355 SY), 31-8893000000-E-SP Concrete Deck Repair (Class III) Using Elastomeric Concrete (Quantity = 59 SY). The Contractor's bid must include these new pay items. The contract will be prepared accordingly.

The Summary of Quantities in the sketch maps will not be changed to reflect this revision.

MAILING ADDRESS:
NC DEPARTMENT OF TRANSPORTATION
CONTRACT STANDARDS AND DEVELOPMENT UNIT
1591 MAIL SERVICE CENTER
RALEIGH NC 27699-1591


TELEPHONE: 919-250-4128
FAX: 919-250-4119
WEBSITE: WWW.NCDOT.ORG

LOCATION:
CENTURY CENTER COMPLEX
ENTRANCE B-2
1020 BIRCH RIDGE DRIVE
RALEIGH NC 27610

Contract ID: C202254
Buncombe County (I-5108)

The Expedite File has been updated to reflect this revision. Please download the Expedite Addendum File and follow the instructions for applying the addendum. Bid Express will not accept your bid unless the addendum has been applied.

Sincerely,

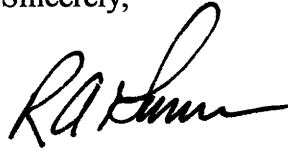

R. A. Garris, PE
Contract Officer

RAG/jag

cc: Mr. J. G. Nance, PE
Mr. Ron Hancock, PE
Mr. J. J. Swain, Jr., PE
Ms. D. M. Barbour, PE
Mr. Art McMillan, PE
Mr. J. V. Barbour, PE
Mr. Mark Staley (2)
Ms. Penny Higgins
Project File (2)

Mr. Robert Memory
Mr. R. E. Davenport, Jr., PE
Ms. Norma Smith
Mr. Ronnie Higgins
Mr. Larry Strickland
Ms. Lori Strickland
Ms. Marsha Sample
Ms. Jaci Kincaid

CONCRETE DECK REPAIR USING ELASTOMERIC CONCRETE:

(4-23-09)

SPI

Description

This work consists of concrete deck repair as designated by the Engineer. The Contractor shall begin work within 60 days of notification.

Materials

Elastomeric concrete is a mixture of a two-part polymer consisting of polyurethane and/or epoxy, and kiln-dried aggregate. Have the manufacturer supply it as a unit.

Use one of the following products:

Ceva Crete by Chase Construction Products, 401 New Karner Road, Albany, NY 12205.

E-Crete #57 by Chase Construction Products, 401 New Karner Road, Albany, NY 12205

Ply-Krete HS by Polyset, Company, P.O. Box 111, Mechanicville, NY 12118

Wabocrete Elastomeric Concrete by Watson Bowman Acme Corporation, 95 Pineview Drive, Amherst, NY 14120 716-691-7566

Or approved equal.

Construction Methods

All areas of concrete deck repairs shall be made with elastomeric concrete. The Engineer will determine the areas where Class I, Class II and Class III deck repair shall be performed. These areas shall be saw cut and material shall be applied according to the material specifications.

Do not place elastomeric concrete if the ambient air temperature is below 45°F (7°C). Prepare and apply a primer, as per manufacturer's recommendations, to all vertical concrete faces, all steel components to be in contact with elastomeric concrete, and to areas specified by the manufacturer. Align the angles with the joint opening.

Prepare, batch, and place the elastomeric concrete in accordance with the manufacturer's instructions. Place the elastomeric concrete while the primer is still tacky and within 2 hours after applying the primer. Properly consolidate the elastomeric concrete around the steel and anchors.

Tarps shall be utilized under the mixing areas, and the bridge deck joint shall be taped off to protect the bridge deck from spills during elastomeric concrete installation.

Class I Deck Repair: Remove all loose, unsound deck concrete to a depth of 1/2 inch (13 mm), remove and dispose concrete, and thoroughly clean the surface. In areas where reinforcing steel

is located in the 1/2 inch (13 mm) depth to be scarified, use another method with the Engineer's approval.

Class II Deck Repair (Partial Depth): Remove by chipping with hand tools all loose, unsound and contaminated deck concrete and in areas where reinforcing steel is exposed, by scarifying to an average depth of approximately one-half the deck thickness, but no less than 3/4 inch (19 mm) below the top mat of steel. Dispose of the removed concrete, clean, repair or replace rusted or loose reinforcing steel, and thoroughly clean the newly exposed surface.

When chipping, be careful not to cut, stretch, or damage any exposed reinforcing steel.

In overhangs, removing concrete areas of less than 0.60 ft²/ft (0.2 m²/m) length of bridge without overhang support is permitted unless the Engineer directs otherwise. For concrete areas greater than 0.60 ft²/ft (0.2 m²/m) length of bridge, approval of the overhang support is required.

Refill areas where concrete was removed with elastomeric concrete.

Class III Deck Repair (Full Depth): Remove full depth all loose, unsound and contaminated deck concrete. Thoroughly clean the routed out area and dispose of concrete removed. Clean, repair, or replace reinforcing bars and fill the areas from which unsound concrete has been removed with elastomeric concrete up to the bottom of the proposed concrete overlay.

Clean or replace reinforcing bars and place elastomeric concrete.

For areas of less than 3 ft² (0.3 m²), suspending forms from existing reinforcing steel using wire ties is permitted. For larger areas, support forms by blocking from the beam flanges.

Submit for approval detailed plans for Class III deck repair. Detail how waste and debris is kept from falling below. When Class III repairs adjacent to the rail are necessary, support the rail in a manner approved by the Engineer.

Measurement and Payment

Class I, Class II and Class III deck repair will be measured in square yards for the appropriate areas so prepared. The entire cost for concrete deck repair using elastomeric concrete including, but not limited to, materials, labor, maintenance, equipment, tools, and incidentals will be included in the unit price per square yard for *Concrete Deck Repair (Class _____) using Elastomeric Concrete*. Also the Contractor shall clean up built up material out from under the guardrail for 100' on the approach and trailing end of the bridge, as directed by the Engineer as part of the work of Concrete Deck Repair using Elastomeric Concrete.

Payments will be made under:

Pay Item	Pay Unit
Concrete Deck Repair (Class _____) using Elastomeric Concrete	Square Yard