


TIP PROJECT: I-5927

CONTRACT: C204784

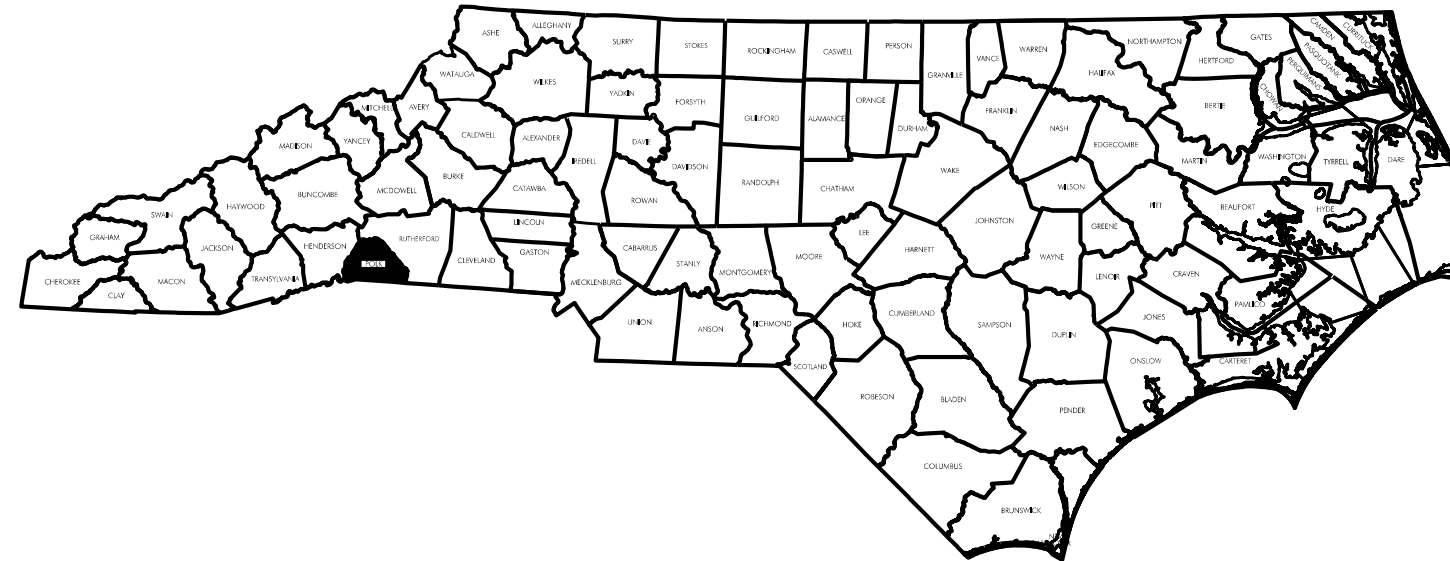

STATE OF NORTH CAROLINA
DIVISION OF HIGHWAYS

POLK COUNTY

LOCATION:

BRIDGE #740023 ON I-26 WBL OVER SR1501 (HUNTING COUNTRY RD).
 BRIDGE #740025 ON I-26 EBL OVER SR1501 (HUNTING COUNTRY RD).
 BRIDGE #740048 ON I-26 WBL OVER N. PACOLET RIVER, SR1516 (RIVER RD).
 BRIDGE #740050 ON I-26 EBL OVER N. PACOLET RIVER, SR1516 (RIVER RD).

STATE	STATE PROJECT REFERENCE NO.	SHEET NO.	TOTAL SHEETS
N.C.	I-5927	1A	
STATE PROJECT NO.	F. A. PROJ. NO.	DESCRIPTION	
45936.1.1	0026026	PE	
45936.1.1	0026026	CONSTR.	

VOLKERT
 5430 Wade Park Blvd, Suite 410
 Raleigh, NC 27607
 Tel. 919-854-0344 Fax. 919-854-0355
 NC License No. F-0765

INDEX OF SHEETS

STRUCTURE NO.	DESCRIPTION	SHEET NUMBER
	TITLE SHEET	1
	INDEX OF SHEETS & SUMMARY OF QUANTITIES	1A
740023	BRIDGE ON I-26 WBL OVER SR1501 (HUNTING COUNTRY RD).	S-1 TO S-14
740025	BRIDGE ON I-26 EBL OVER SR1501 (HUNTING COUNTRY RD).	S-15 TO S-28
740048	BRIDGE ON I-26 WBL OVER N. PACOLET RIVER, SR1516 (RIVER RD).	S-29 TO S-52
740050	BRIDGE ON I-26 EBL OVER N. PACOLET RIVER, SR1516 (RIVER RD).	S-53 TO S-75
	DETAILS	S-76 TO S-79
	STANDARD NOTES	SN


TOTAL BILL OF MATERIAL

BRIDGE NO.	POLLUTION CONTROL	GROOVING BRIDGE FLOORS	CLASS II SURFACE PREPARATION	CONCRETE REPAIRS	SHOTCRETE REPAIRS	EPOXY RESIN INJECTION	CLEANING & REPAINTING OF BRIDGE NO. ____	PAINTING CONTAINMENT FOR BRIDGE NO. ____	FOAM JOINT SEALS FOR PRESERVATION	POLYESTER POLYMER CONCRETE MATERIALS	EPOXY POLYMER CONCRETE MATERIALS (ALTERNATE)	BEAM REPAIR CUT-OUT
	LUMP SUM	SQ. FT.	SQ. YD.	CU. FT.	CU. FT.	LF	LUMP SUM	LUMP SUM	LF	CU. YD.	CU. YD.	LB
740023	LUMP SUM	4493.3	10.0	7.7	27.2	49.5	LUMP SUM	LUMP SUM	90.1	15.2	15.2	424.0
740025	LUMP SUM	4853.5	10.0	0.0	21.2	30.2	LUMP SUM	LUMP SUM	90.1	16.4	16.4	166.0
740048	LUMP SUM	13131.3	43.2	10.5	122.7	45.1	LUMP SUM	LUMP SUM	393.8	77.2	77.2	0.0
740050	LUMP SUM	13133.3	43.2	3.4	48.5	14.2	LUMP SUM	LUMP SUM	393.8	77.4	77.4	0.0
TOTAL	LUMP SUM	35611.4	106.4	21.6	219.6	139.0	LUMP SUM	LUMP SUM	967.8	186.2	186.2	590.0

TOTAL BILL OF MATERIAL

BRIDGE NO.	BEAM REPAIR PLATING	EPOXY COATING	SCARIFYING BRIDGE DECK	SHOTBLASTING BRIDGE DECK	PLACING AND FINISHING POLYMER CONCRETE OVERLAY	CONCRETE DECK REPAIR FOR POLYMER CONCRETE OVERLAY	TYPE I BRIDGE JACKING
	LB	SQ. FT.	SQ. YD.	SQ. YD.	SQ. YD.	SQ. YD.	EA
740023	30.0	444.0	546.4	546.4	546.4	10.0	2.0
740025	314.0	444.0	589.8	589.8	589.8	10.0	1.0
740048	32.0	1149.0	1589.6	1589.6	1589.6	43.2	0.0
740050	0.0	1149.0	1589.8	1589.8	1589.8	43.2	0.0
TOTAL	376.0	3186.0	4315.6	4315.6	4315.6	106.4	3.0

DRAWN BY : D. A. GLADDEN DATE : 7/21
 CHECKED BY : E. MURRAY DATE : 12/22

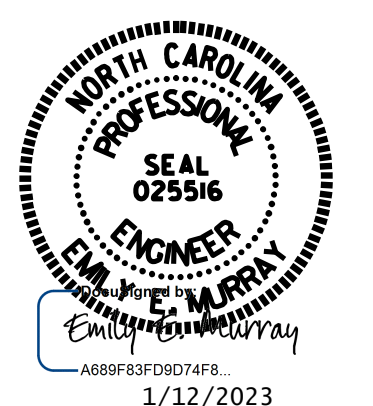

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED