


EDI MODEL 2018ECL-NC CONFLICT MONITOR PROGRAMMING DETAIL

(remove jumpers and set switches as shown)


REMOVE DIODE JUMPERS 1-6, 1-15, 2-5, 2-6, 2-12, 2-15, 3-16, 4-12, 4-14, 5-12, 6-15, and 12-14.

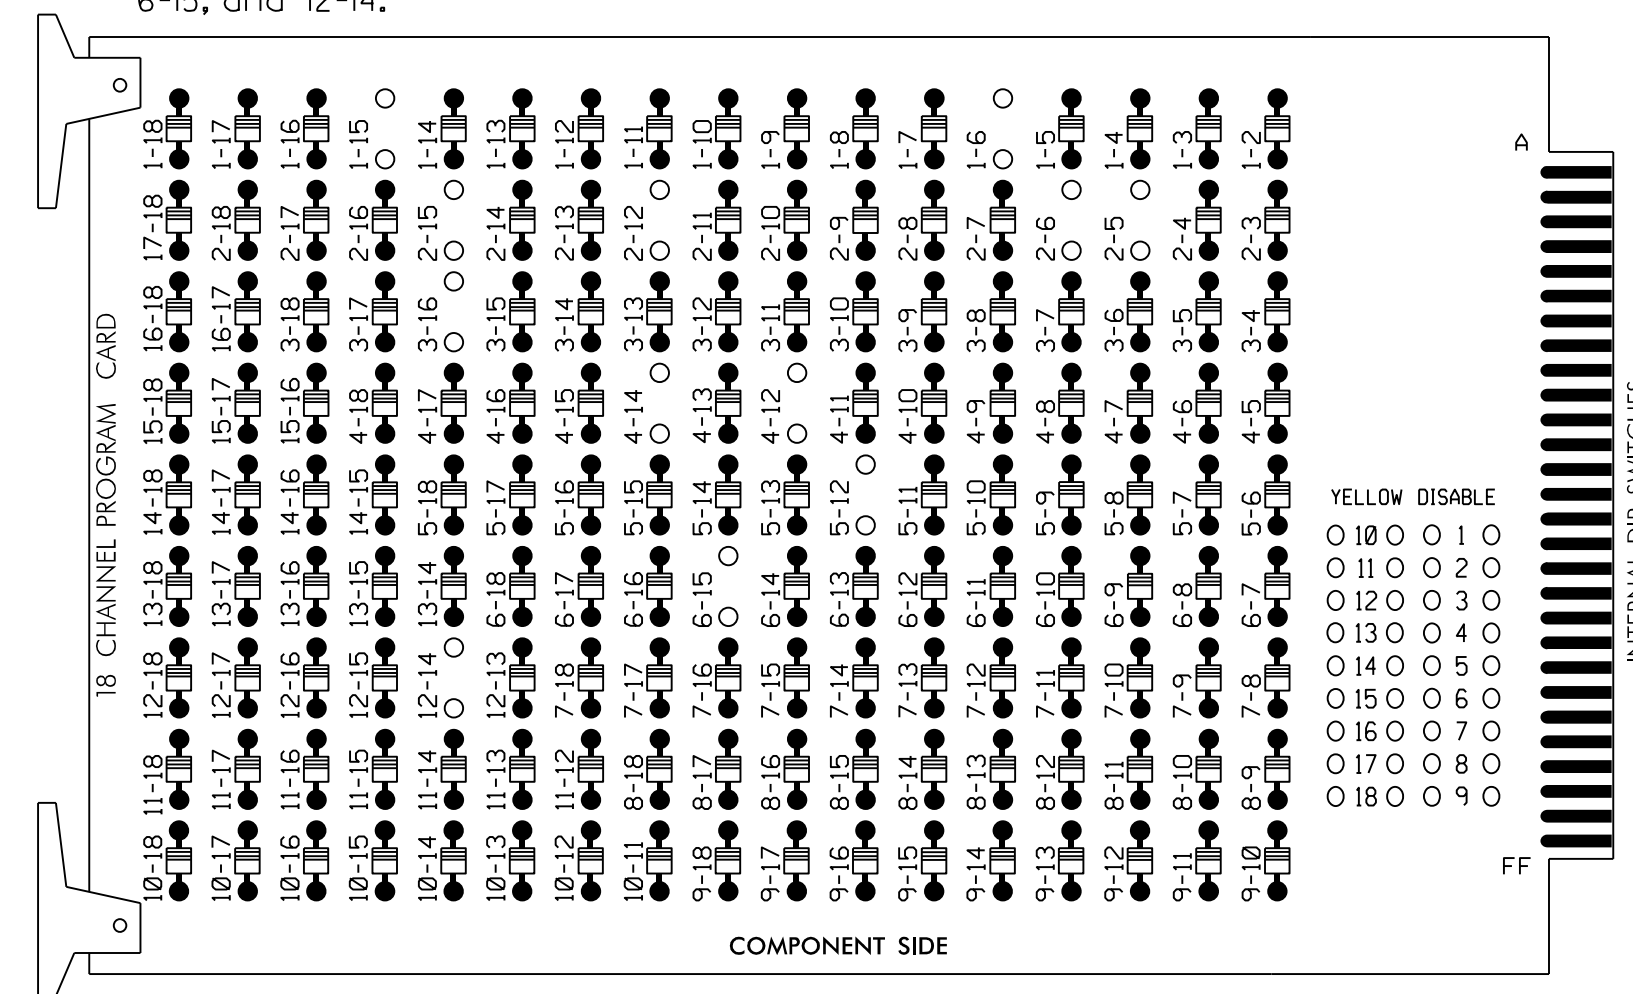

REMOVE JUMPERS AS SHOWN

NOTES:

- 1. Card is provided with all diode jumpers in place. Removal of any jumper allows its channels to run concurrently.
2. Ensure jumpers SEL2-SEL5 and SEL9 are present on the monitor board.
3. Ensure that Red Enable is active at all times during normal operation.
4. Connect serial cable from conflict monitor to comm. port 1 of 2070 controller. Ensure conflict monitor communicates with 2070.

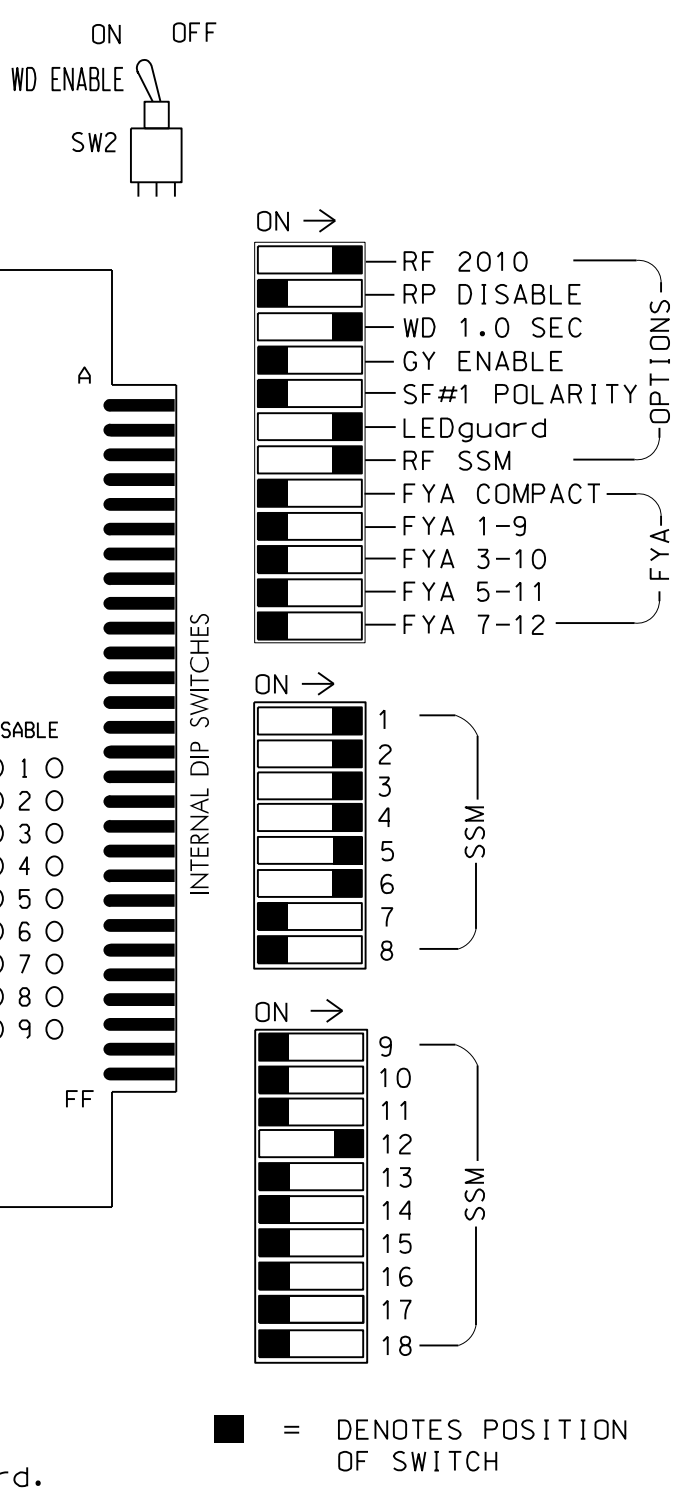

NOTES

- 1. To prevent "flash-conflict" problems, insert red flash program blocks for all unused vehicle load switches in the output file.
2. Return controller to Factory Defaults before programming per this electrical detail.
3. Enable Simultaneous Gap-Out for all Phases.
4. Program phases 2 and 6 for Variable Initial and Gap Reduction.
5. Program phases 2 and 6 for Startup In Green.
6. Program phases 3, 4 and 6 for Startup Ped Call.
7. Program phases 2 and 6 for Yellow Flash.
8. If this signal will be managed by an ATMS software, enable controller and detector logging for all detectors used at this location.

EQUIPMENT INFORMATION

CONTROLLER.....2070
CABINET.....332 W/ AUX
SOFTWARE.....ECONOLITE OASIS
CABINET MOUNT.....BASE
OUTPUT FILE POSITIONS...18 WITH AUX. OUTPUT FILE LOAD SWITCHES USED.....S1,S2,S4,S5,S6,S7,S8,S9,S12,AUX S5
PHASES USED.....1,2,3,3PED,4,4PED,5,6,6PED
OVERLAP "A".....NOT USED
OVERLAP "B".....NOT USED
OVERLAP "C".....NOT USED
OVERLAP "D".....4+5

SIGNAL HEAD HOOK-UP CHART

Table with columns for Load Switch No., S1-S12, AUX S1-S6, and Signal Head No. (RED, YELLOW, GREEN, RED Arrow, Yellow Arrow, Green Arrow). Includes pedestrian symbols for hand and foot detection.

NU = Not Used

★ See pictorial of head wiring in detail this sheet.

OVERLAP PROGRAMMING DETAIL

(program controller as shown below)

FROM MAIN MENU PRESS '8' (OVERLAPS), THEN '1' (VEHICLE OVERLAP SETTINGS).


PRESS '+' FOUR TIMES

PAGE 1: VEHICLE OVERLAP 'D' SETTINGS
PHASE: 12345678910111213141516
VEH OVL PARENTS: XX
VEH OVL NOT VEH:
VEH OVL NOT PED:
VEH OVL GRN EXT:
STARTUP COLOR: _ RED _ YELLOW _ GREEN
FLASH COLORS: _ RED _ YELLOW _ GREEN
SELECT VEHICLE OVERLAP OPTIONS: (Y/N)
FLASH YELLOW IN CONTROLLER FLASH?...Y
GREEN EXTENSION (0-255 SEC)...0
YELLOW CLEAR (0=PARENT,3-25.5 SEC)...0.0
RED CLEAR (0=PARENT,0.1-25.5 SEC)...0.0
OUTPUT AS PHASE # (0=NONE, 1-16)...0

OVERLAP PROGRAMMING COMPLETE

INPUT FILE POSITION LAYOUT

(front view)

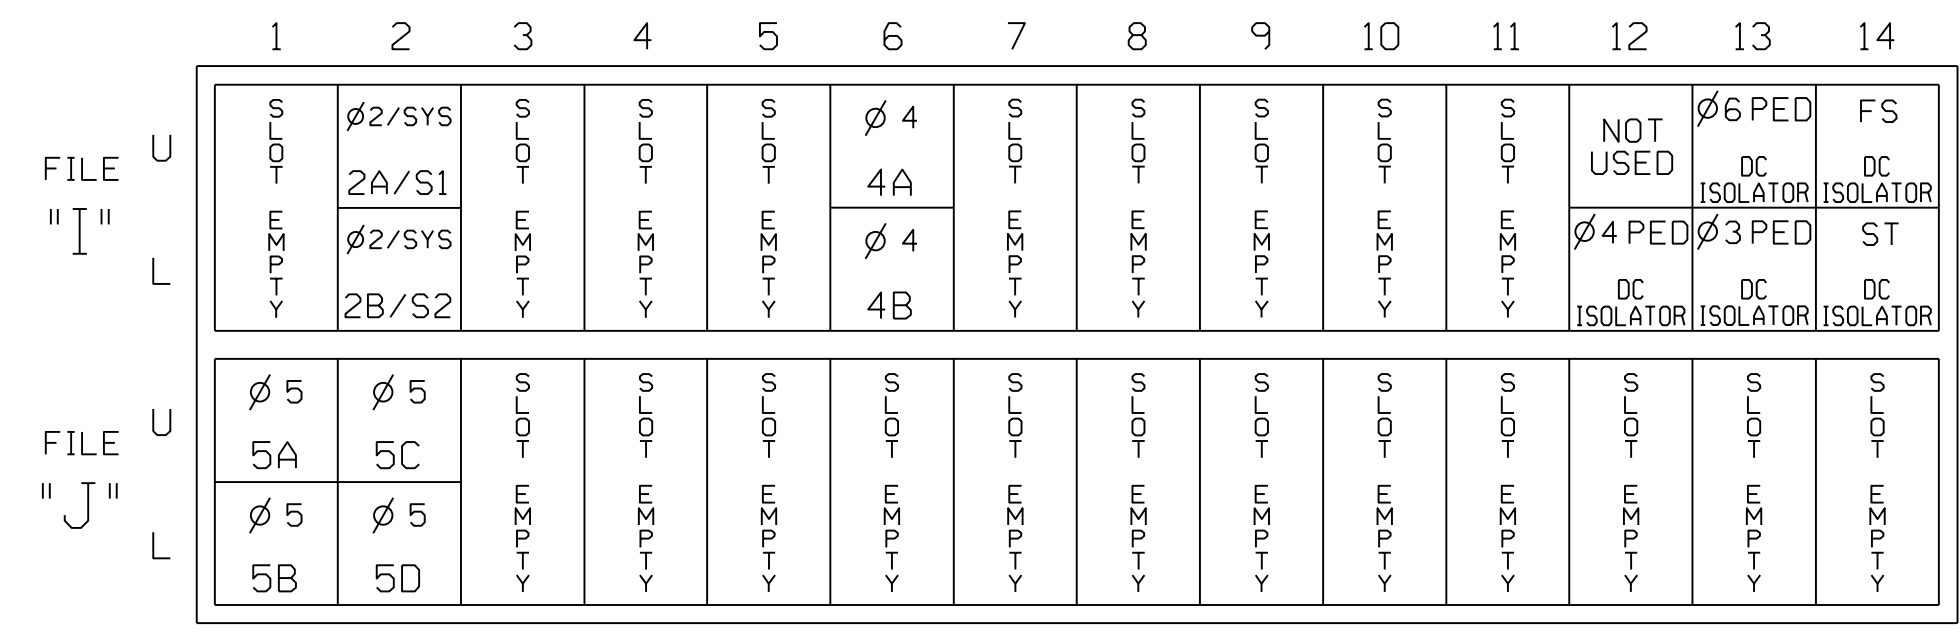


EX. : 1A, 2A, ETC. = LOOP NO.'S

FS = FLASH SENSE
ST = STOP TIME

INPUT FILE CONNECTION & PROGRAMMING CHART

Table with columns: LOOP NO., LOOP TERMINAL, INPUT FILE POS., PIN NO., INPUT ASSIGNMENT NO., DETECTOR NO., NEMA PHASE, CALL, EXTEND, FULL TIME DELAY, STRETCH TIME, DELAY TIME. Includes rows for 2A/S1, 2B/S2, 4A, 4B, 5A, 5B, 5C, 5D, PED PUSH BUTTONS, P41,P42, P61,P62, P31,P32.

NOTE:
INSTALL DC ISOLATORS IN INPUT FILE SLOTS 112 AND 113.

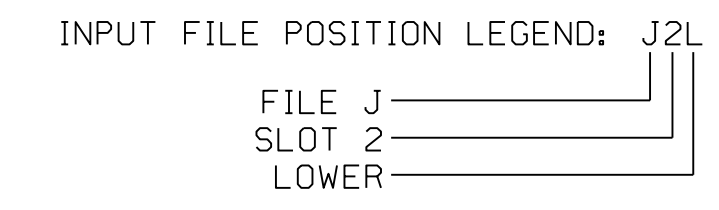

SPECIAL DETECTOR NOTE

For Detector Zones 1A, 3A, 6A and 6B, install a temporary video detection system for vehicle detection. Perform installation according to manufacturer's directions and NCDOT engineer approved mounting locations to accomplish the detection schemes shown on the Signal Design Plans.

COUNTDOWN PEDESTRIAN SIGNAL OPERATION

Countdown Ped Signals are required to display timing only during Ped Clearance Interval. Consult Ped Signal Module user's manual for instructions on selecting this feature.

FLASHER CIRCUIT MODIFICATION DETAIL

IN ORDER TO INSURE THAT SIGNALS FLASH CONCURRENTLY ON THE SAME APPROACH, MAKE THE FOLLOWING FLASHER CIRCUIT CHANGES:

- 1. ON REAR OF PDA - REMOVE WIRE FROM TERM. T2-4 AND TERMINATE ON T2-2.
2. ON REAR OF PDA - REMOVE WIRE FROM TERM. T2-5 AND TERMINATE ON T2-3.
3. REMOVE FLASHER UNIT 2.

THE CHANGES LISTED ABOVE TIES ALL PHASES AND OVERLAPS TO FLASHER UNIT 1.

Temporary Design 2 - TMP Phase II Electrical Detail - Sheet 1 of 2

Stantec logo and contact information: Stantec Consulting Services Inc., 801 Jones Franklin Road-Suite 300, Raleigh, NC 27606.

Professional Engineer Seal for Derrick A. Waller, State of North Carolina, License No. 042678.

Project information: SR 1100 (Brawley School Road) at SR 1116 (Talbert Road)/SR 2906 (Sunfish Drive). Division 12, Iredell County, Mooresville. Plan Date: May 2022. Prepared by: D A Waller. Reviewed by: E D Harris, R M Muncey.

Document status: DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED. Date: 3/24/2023. Inventory No: 12-1689T2.