

SPAN A

SPAN B

PLAN OF SPAN

TOP OF DECK SLAB SHOWN, FOR LIMITS OF APPROACH SLABS, SEE SHEET 1 OF 3.

REPAIR QUANTITY TABLE						
TOP OF DECK & APPROACH SLAB REPAIRS						
ITEMS	APPROACH SLAB 1		SPAN A		SPAN B	
	ESTIMATE	ACTUAL	ESTIMATE	ACTUAL	ESTIMATE	ACTUAL
CLASS II SURFACE PREPARATION	1.0 CY		1.0 CY		1.0 CY	
CLASS III SURFACE PREPARATION	1.0 CY		1.0 CY		1.0 CY	

PAYMENT FOR CLASS II & CLASS III SURFACE PREPARATION IS BASED ON THE SQ. FEET OF ADDITIONAL DEMOLITION REQUIRED FOLLOWING HYDRO-DEMOLITION OF THE BRIDGE DECK. SEE SPECIAL PROVISIONS.

CLASS III SURFACE PREPARATION AND CONCRETE FOR DECK REPAIR ARE NOT ANTICIPATED. TOKEN PAY ITEMS ARE INDICATED FOR PRICING PURPOSES IN CASE UNANTICIPATED CLASS III SURFACE PREPARATION AREAS ARE ENCOUNTERED.

NOTES:


REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.

FOR DECK JOINT REPAIR DETAILS, SEE SHEET S-53.

FOR CONCRETE DECK REPAIR FOR POLYESTER POLYMER CONCRETE BRIDGE DECK OVERLAY, SEE SPECIAL PROVISIONS.

PROJECT NO. I-5788
HARNETT COUNTY
 BRIDGE NO. 73

SHEET 2 OF 3

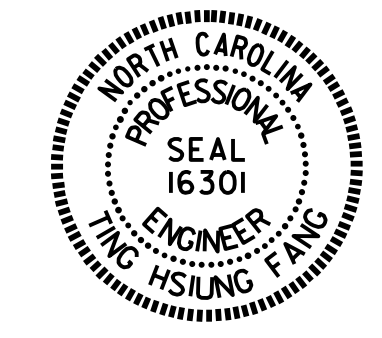

DocuSigned by:
 1/28/2016

STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH
 SUPERSTRUCTURE
 SURFACE PREPARATION
 TOP OF DECK
 NBL
 SPANS A & B

REVISIONS						SHEET NO. S-51
NO.	BY:	DATE:	NO.	BY:	DATE:	
1			3			TOTAL SHEETS 72
2			4			

DRAWN BY : A. SORSENGINH DATE : 10/2015
 CHECKED BY : S.B. WILLIAMS DATE : 10/2015