

**NOTES:**

INFORMATION INDICATED ON THE LOCATION SKETCH SHALL BE CONSIDERED GENERAL INFORMATION, ONLY. CONTRACTOR SHALL CONFIRM, THROUGH OTHER SOURCES, SPECIFIC INFORMATION REGARDING THE BRIDGES, ROADWAYS, UTILITIES, THE SURROUNDING AREA, AND ANY OTHER ASPECTS THAT MAY BE NECESSARY TO PERFORM AND COMPLETE THE PROJECT.

EXISTING DIMENSIONS AND BRIDGE CONDITION ARE FROM BEST INFORMATION AVAILABLE. THE CONTRACTOR SHALL FIELD VERIFY THE INFORMATION SHOWN ON THE PLANS AND NOTIFY THE ENGINEER IF ACTUAL DIMENSIONS AND CONDITIONS DIFFER.

IT IS THE CONTRACTOR'S RESPONSIBILITY TO FOLLOW ALL STATE AND FEDERAL SAFETY REQUIREMENTS.

EXISTING JOINTS AND DECK DRAINS SHALL BE SEALED PRIOR TO BEGINNING SURFACE PREPARATION OF BRIDGE DECK.

LONGITUDINAL CONSTRUCTION JOINTS OF OVERLAYS SHALL BE LOCATED ALONG THE CENTERLINE OR EDGE OF TRAVEL LANES.

FOR BRIDGE JOINT DEMOLITION, SEE SPECIAL PROVISIONS.

FOR FOAM JOINT SEALS, SEE SPECIAL PROVISIONS.

FOR ELASTOMERIC CONCRETE, SEE SPECIAL PROVISIONS.

FOR SUBMITTAL OF WORKING DRAWINGS, SEE SPECIAL PROVISIONS.

FOR FALSEWORK AND FORMWORK, SEE SPECIAL PROVISIONS.

FOR CRANE SAFETY, SEE SPECIAL PROVISIONS.

FOR GROUT FOR STRUCTURES, SEE SPECIAL PROVISIONS.

FOR CONTROL OF TRAFFIC AND LIMITS ON PHASING OF CONSTRUCTION, SEE TRANSPORTATION MANAGEMENT PLAN.

FOR EPOXY OVERLAY SYSTEM - MECHANICALLY DISTRIBUTED, SEE SPECIAL PROVISIONS.

FOR CONCRETE DECK REPAIR FOR EPOXY OVERLAY, SEE SPECIAL PROVISIONS.

FOR PAINTING EXISTING STRUCTURES, SEE SPECIAL PROVISIONS.


FOR EXPANSION JOINT SEAL REPAIR, SEE SPECIAL PROVISIONS.

—TOTAL BILL OF MATERIAL—

BRIDGE NO.	POLLUTION CONTROL	FOAM JOINT SEALS	CLEANING AND PAINTING EXISTING WEATHERING STEEL BRIDGE NO...	PAINTING CONTAINMENT FOR BRIDGE NO...	BRIDGE JOINT DEMOLITION	EXPANSION JOINT SEAL REPAIR	* CONCRETE DECK REPAIR FOR EPOXY OVERLAY	EPOXY OVERLAY SYSTEM - MECHANICALLY DISTRIBUTED	ELASTOMERIC CONCRETE
	LUMP SUM	LUMP SUM	LUMP SUM	LUMP SUM	SQ. FT.	LN. FT.	SQ. FT.	SQ. FT.	CU. FT.
45	LUMP SUM	LUMP SUM	LUMP SUM	LUMP SUM	56	56	3	11,228	14
46	LUMP SUM	LUMP SUM	LUMP SUM	LUMP SUM	136	--	3	13,601	34
70	LUMP SUM	LUMP SUM	LUMP SUM	LUMP SUM	182	--	3	16,362	46
75	LUMP SUM	LUMP SUM	LUMP SUM	LUMP SUM	154	--	3	13,941	39
114	LUMP SUM	LUMP SUM	LUMP SUM	LUMP SUM	--	82	3	20,978	--
116	LUMP SUM	LUMP SUM	LUMP SUM	LUMP SUM	--	75	3	20,078	--
658	LUMP SUM	LUMP SUM	LUMP SUM	LUMP SUM	--	88	3	12,823	--
TOTAL	LUMP SUM	LUMP SUM	LUMP SUM	LUMP SUM	528	301	21	109,011	133

\* CONCRETE DECK REPAIR FOR EPOXY OVERLAY IS NOT ANTICIPATED. TOKEN PAY ITEMS ARE INDICATED FOR PRICING PURPOSE IN CASE UNANTICIPATED REPAIR AREAS ARE ENCOUNTERED.

PROJECT NO. I-5768  
MECKLENBURG COUNTY  
 BRIDGE NO. 45, 46, 70, 75,  
114, 116, & 658

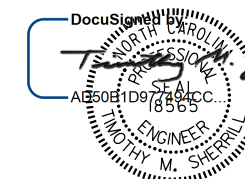

STATE OF NORTH CAROLINA  
 DEPARTMENT OF TRANSPORTATION  
 RALEIGH  
**GENERAL DRAWING**  
 LOCATION SKETCHES  
 &  
 TOTAL BILL OF MATERIAL

8/12/2016

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	
1			3			S-1
2			4			TOTAL SHEETS 21

DRAWN BY : D.V. JOYNER DATE : 7/2016  
 CHECKED BY : W. C. SMITH DATE : 7/2016