



Fabrication Details - Strain Pole Attachments

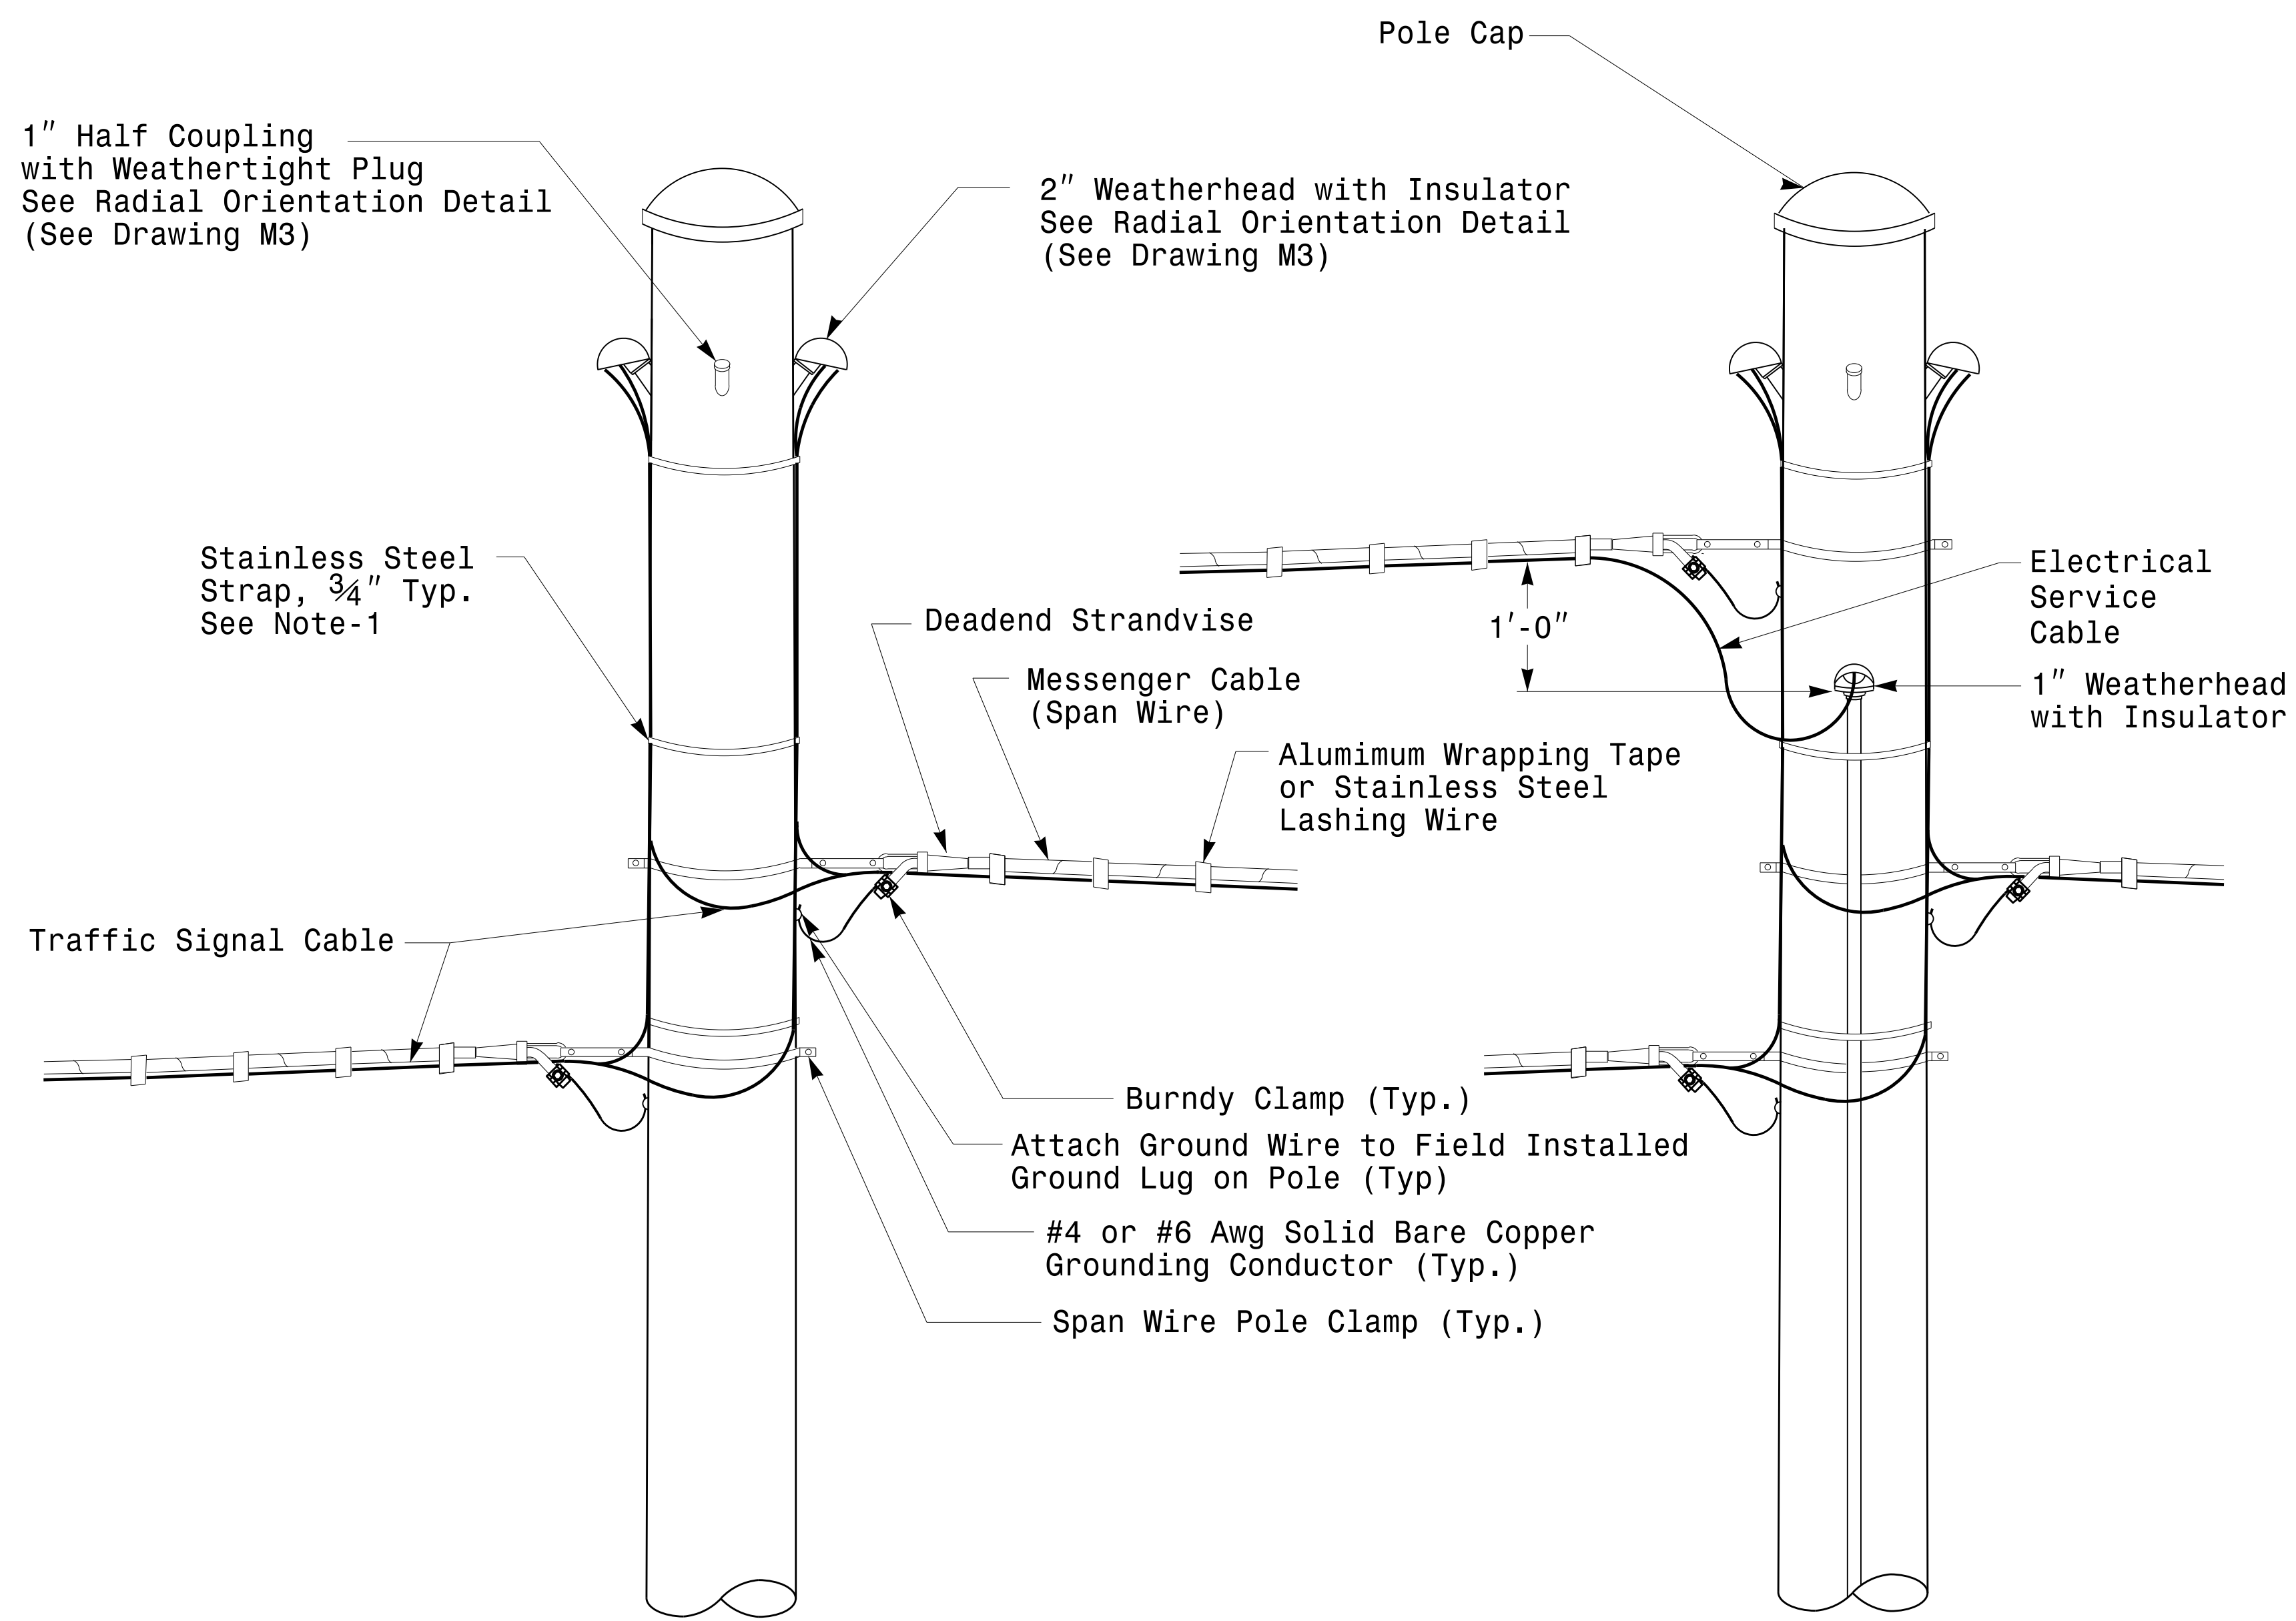


Strain Pole Attachments

NOTE:

1. Strap all signal cables to the side of the pole with 3/4" stainless steel straps when the distance between the spanwire attachment clamp and the weatherheads exceeds 3'-0".
2. Provide minimum two spanwire pole clamps per pole.
3. It is prohibited to attach two span wires at one pole clamp.
4. For general requirements refer to NCDOT Standard Specifications for Roadway and Structures, January 2012.

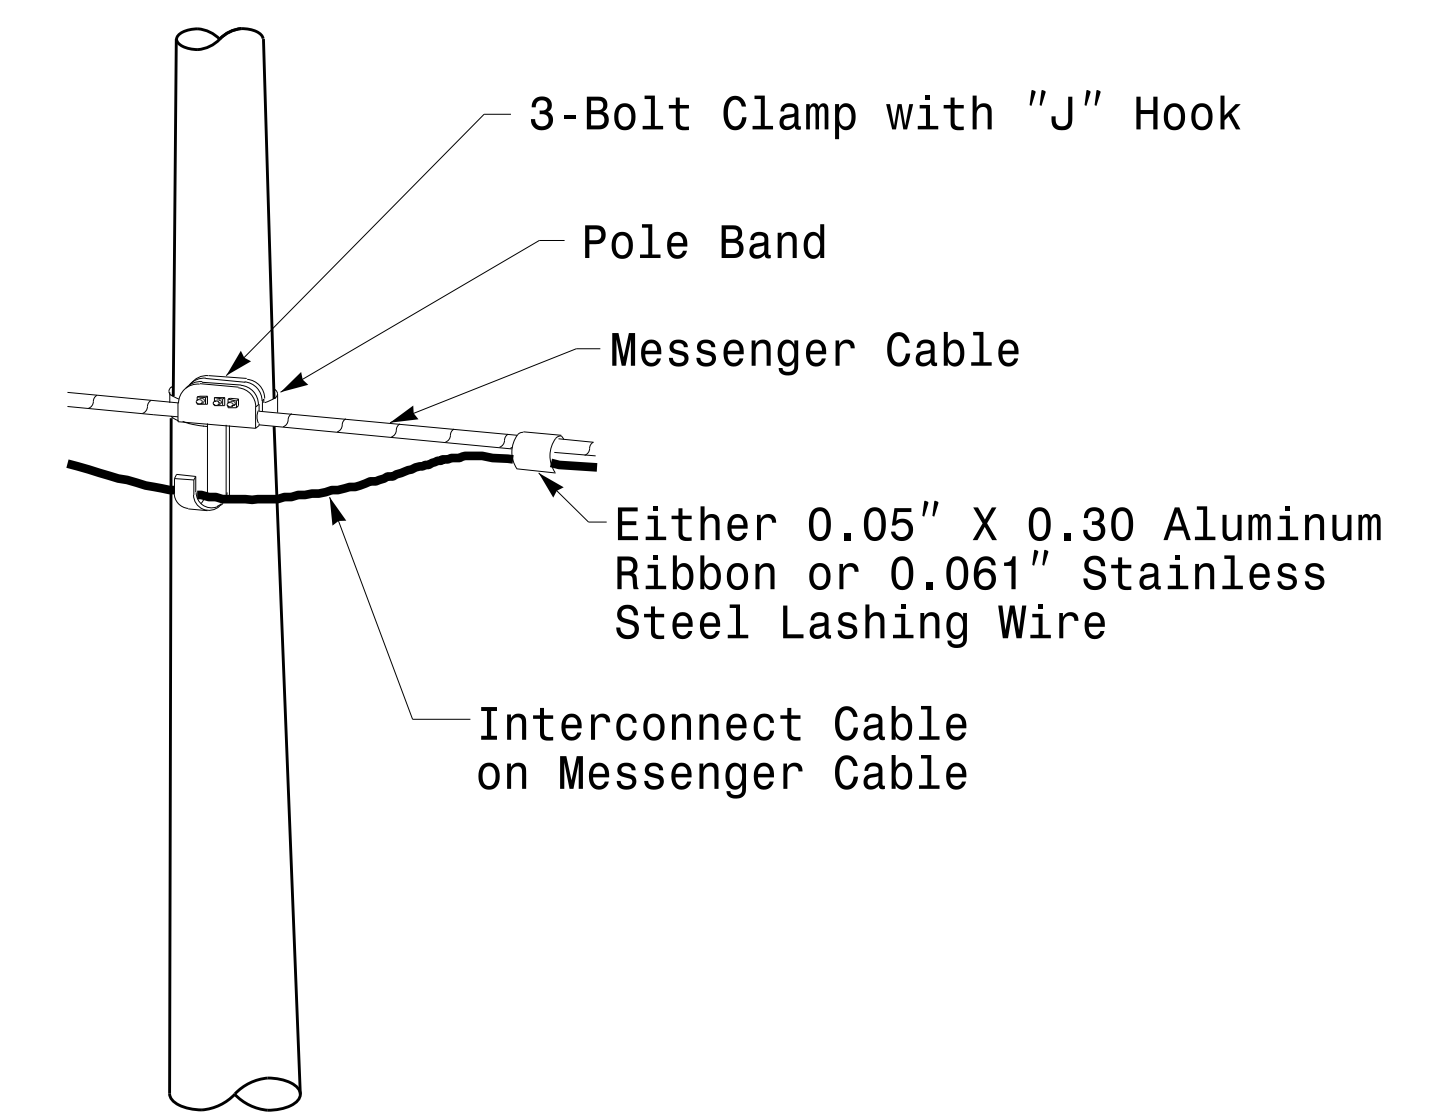

Attachment of Cable to Intermediate Metal Pole

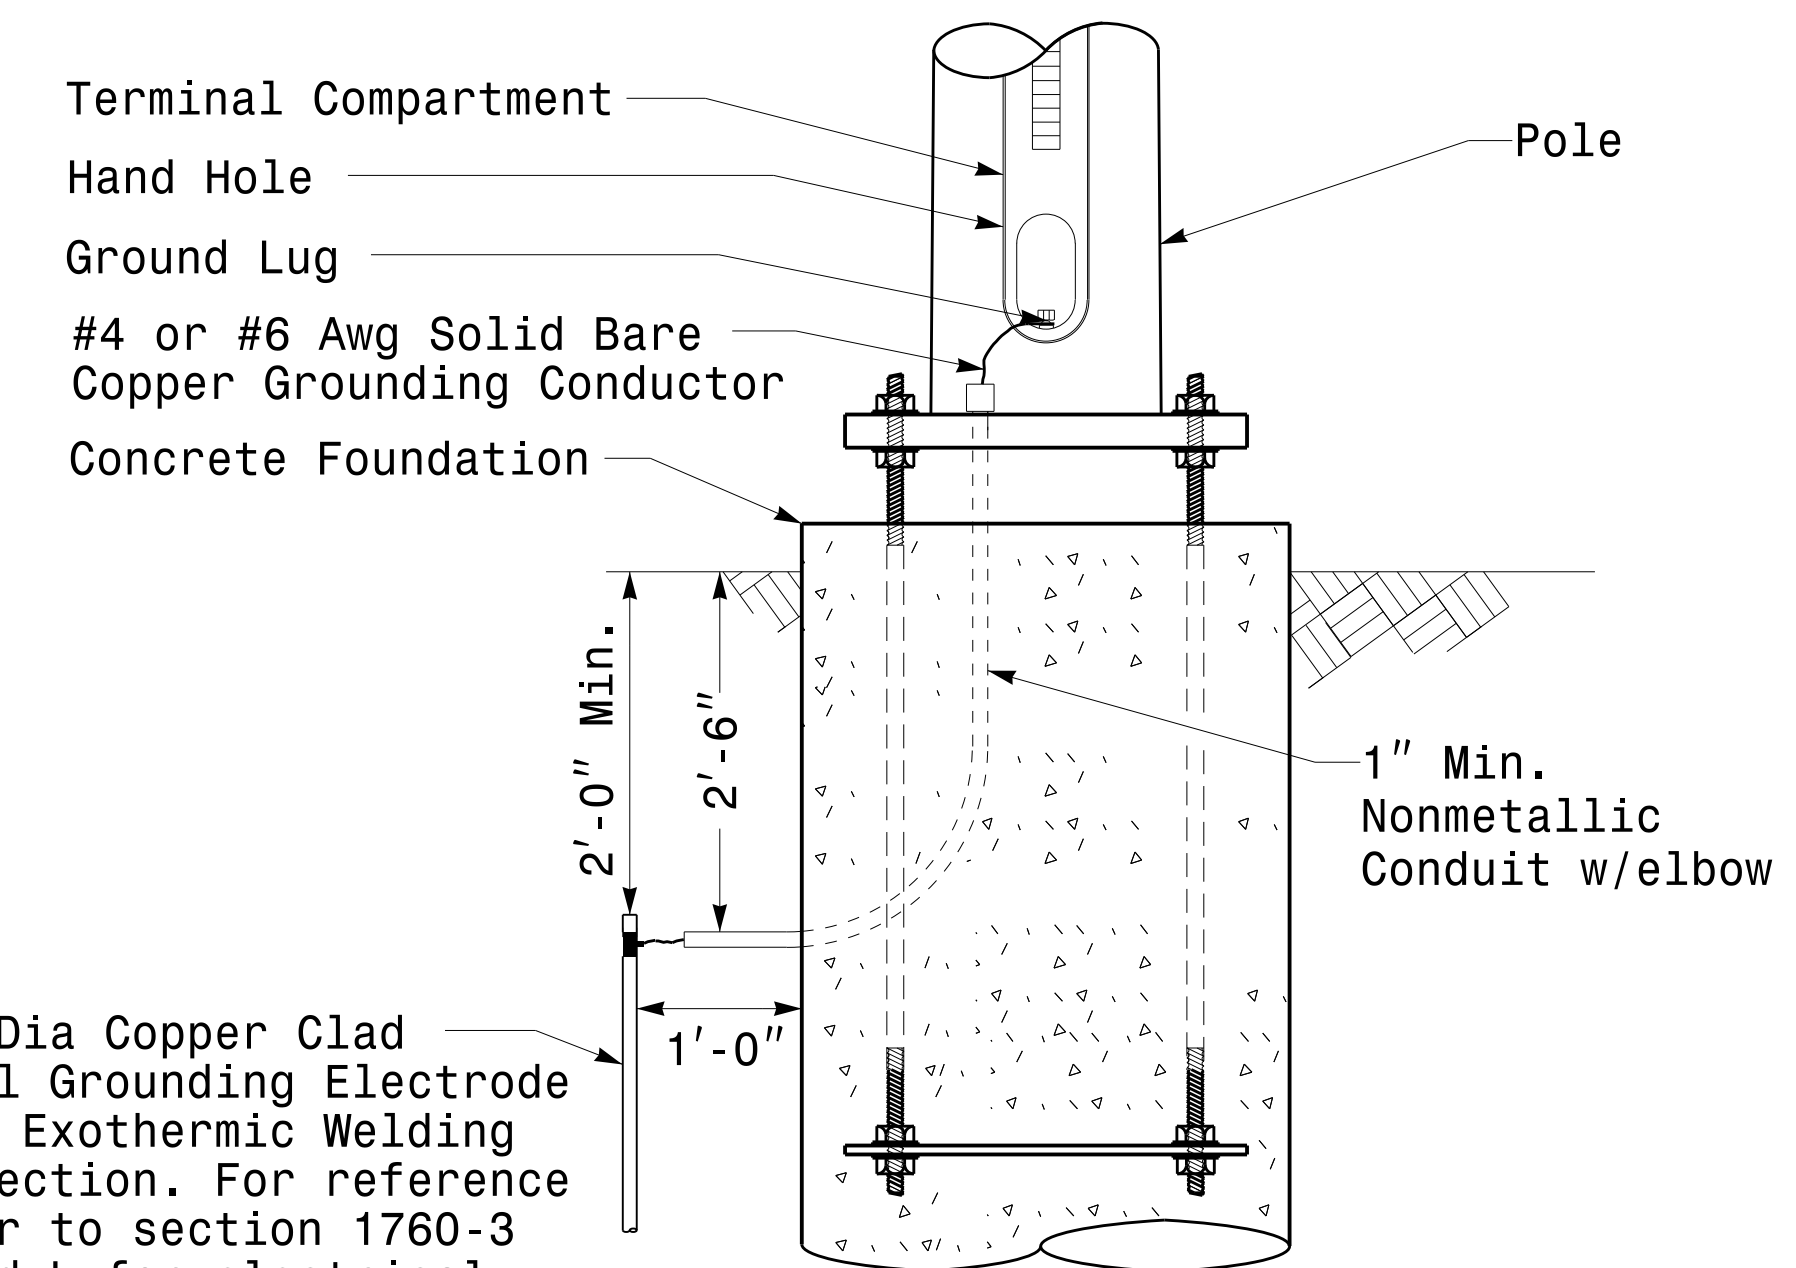

Metal Pole Grounding Detail For Strain Pole and Mast Arm

Prepared in the Offices of:

750 N. Greenfield Pkwy, Garner, NC 27529

SCALE: 0 NA NONE

Typical Fabrication Details For Strain Pole Attachments			
PLAN DATE:	FEBRUARY 2016	DESIGNED BY:	C.F. ANDREWS
PREPARED BY:	N. BITTING	REVIEWED BY:	D.C. SARKAR
REVISIONS	INIT.	DATE	

SEAL

DocuSigned By: Debesh C. Sarkar

44E8E32E147E4C4...

2/17/2016

DATE

17-FEB-2016 16:09
I:\SCD\115 Signal\sig Design Section\Eastern Region\Sheet\2016\2014_Sig_M6_Std_Fabrication_Details-Strain_Poles.dgn
D:\CADD