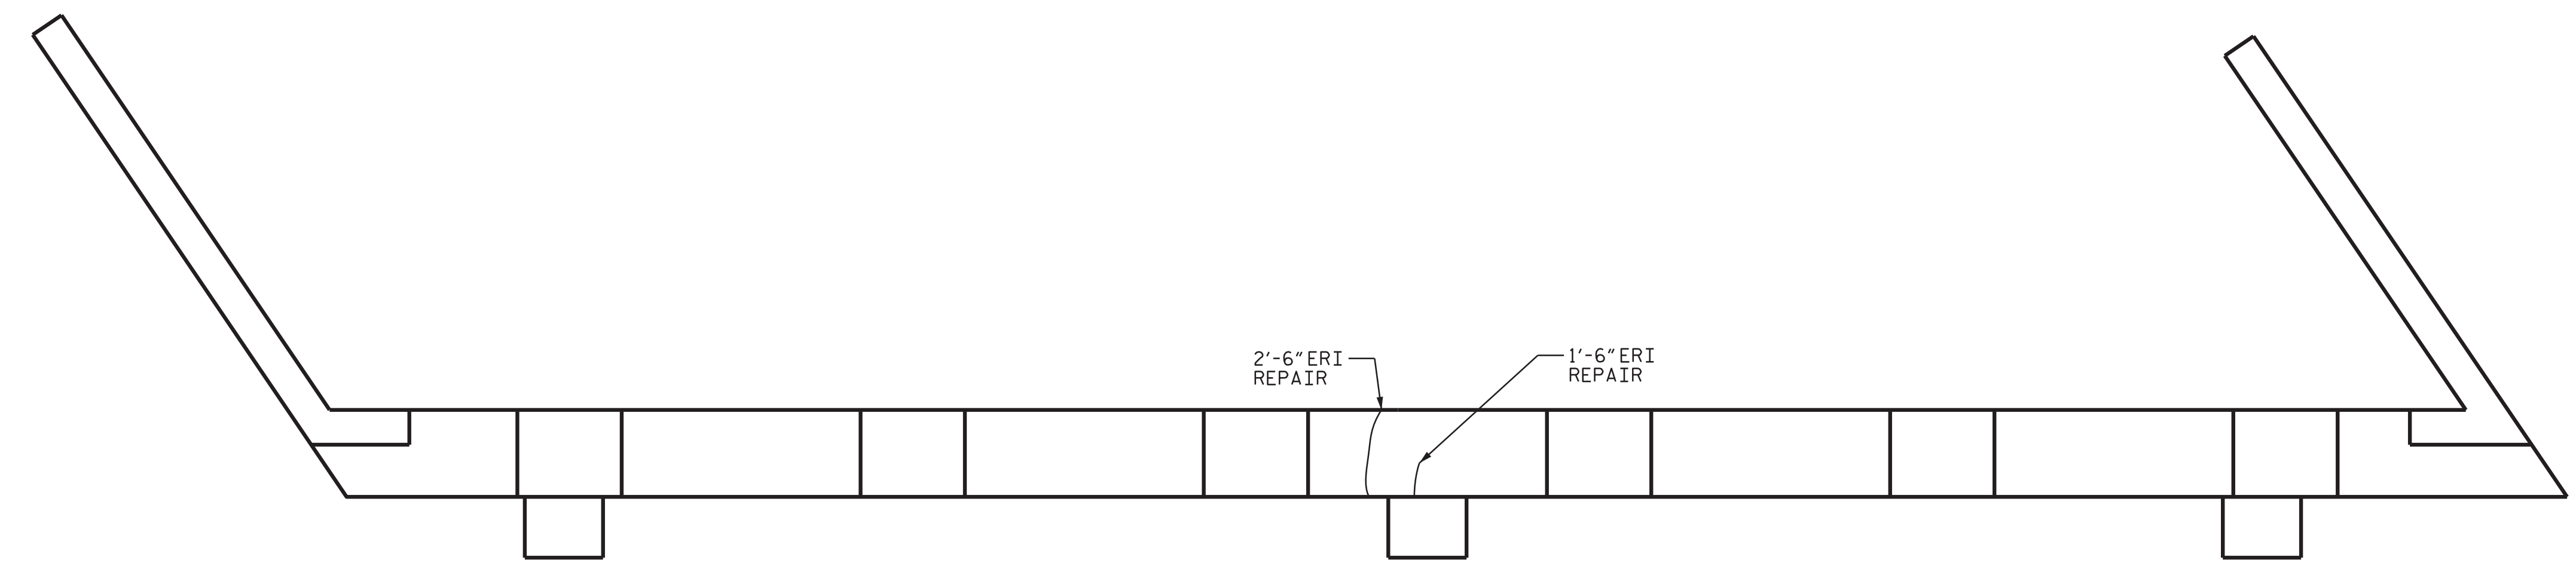

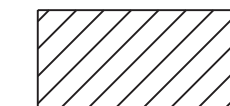



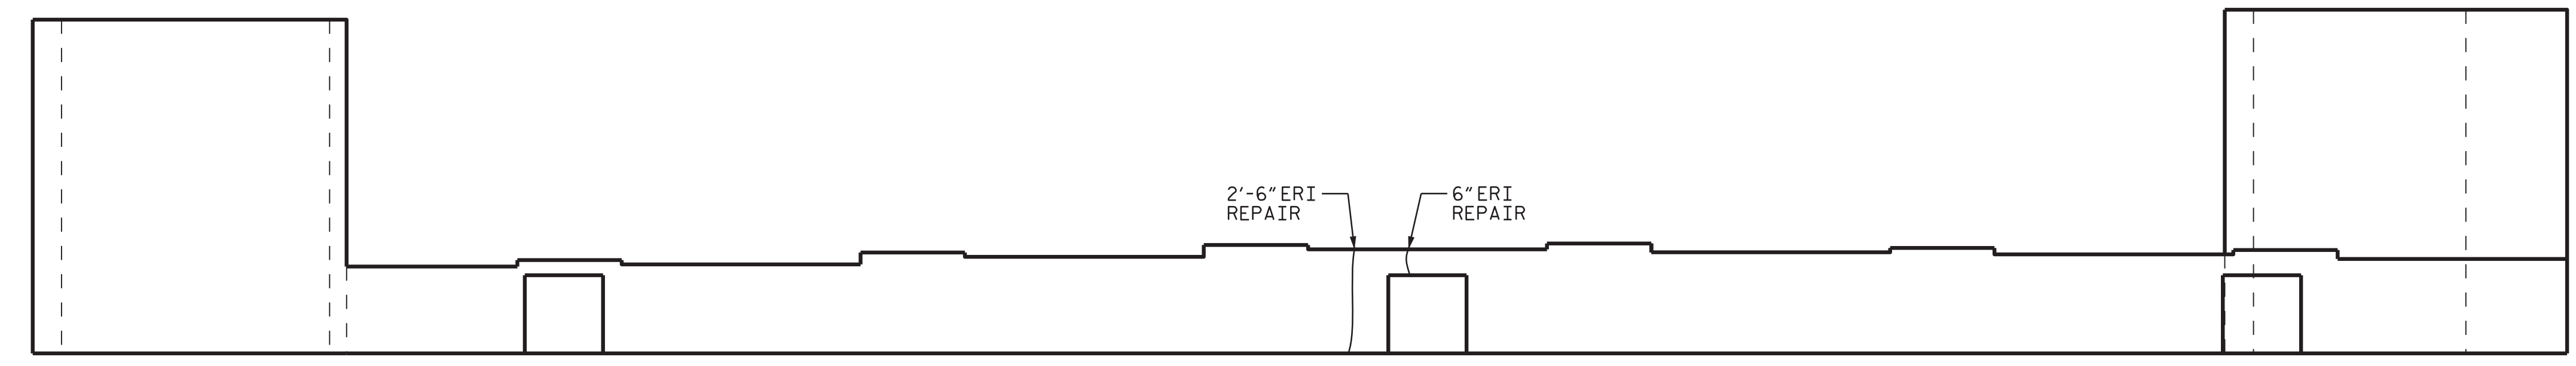
| AS-BUILT REPAIR QUANTITY TABLE | | | | |
|--------------------------------|------------|-----------|---------|-----------|
| REPAIRS | QUANTITIES | | | |
| | ESTIMATE | | ACTUAL | |
| END BENT 2 | | | | |
| SHOTCRETE REPAIRS | AREA SF | VOLUME CF | AREA SF | VOLUME CF |
| CAP | 0.0 | 0.0 | | |
| CONCRETE REPAIRS | AREA SF | VOLUME CF | AREA SF | VOLUME CF |
| CAP | 0.0 | 0.0 | | |
| EPOXY RESIN INJECTION | | LN. FT. | | LN. FT. |
| CAP | | 7.0 | | |

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1" BEHIND REBAR AND 2" MIN. CLEAR TO SAWCUT.



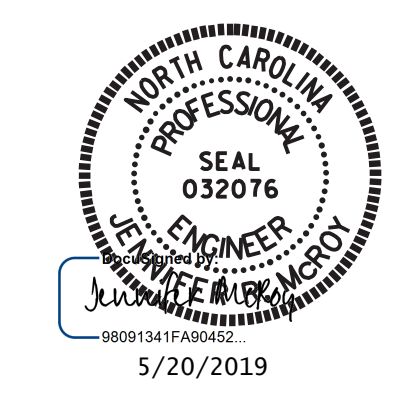
TOP OF CAP @ END BENT 2

 SHOTCRETE REPAIR
 CONCRETE REPAIR
 EPOXY RESIN INJECTION (ERI)



ELEVATION @ END BENT 2 (SPAN B)

PROJECT NO. 15BPR.45
PENDER COUNTY
 BRIDGE NO. 700219



STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH

 END BENT 2

VOLKERT
 5540 Centerview Drive, Suite 305
 Raleigh, NC 27606
 Tel. 919-854-0344 Fax. 919-854-0355
 NC License No. F-0765

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

| REVISIONS | | | | | | SHEET NO. |
|-----------|-----|-------|-----|-----|-------|--------------|
| NO. | BY: | DATE: | NO. | BY: | DATE: | S2-12 |
| 1 | | | 3 | | | TOTAL SHEETS |
| 2 | | | 4 | | | 31 |

DRAWN BY : R. G. BEAUCHAMP DATE : 3/19
 CHECKED BY : J. R. MCROY DATE : 3/19