

AS-BUILT REPAIR QUANTITY TABLE

TOP OF DECK REPAIRS

	ESTIMATE	ACTUAL
SCARIFYING BRIDGE DECK	848 SQ. YDS.	
CLASS II SURFACE PREPARATION	15.1 SQ. YDS.	
CONCRETE DECK REPAIR FOR PC OVERLAY	15.1 SQ. YDS.	
SHOTBLASTING BRIDGE DECK	848 SQ. YDS.	
PC MATERIALS	41.2 CU. YDS.	
PLACING AND FINISHING PC OVERLAY	848 SQ. YDS.	
GROOVING BRIDGE FLOORS	7160 SQ. FT.	

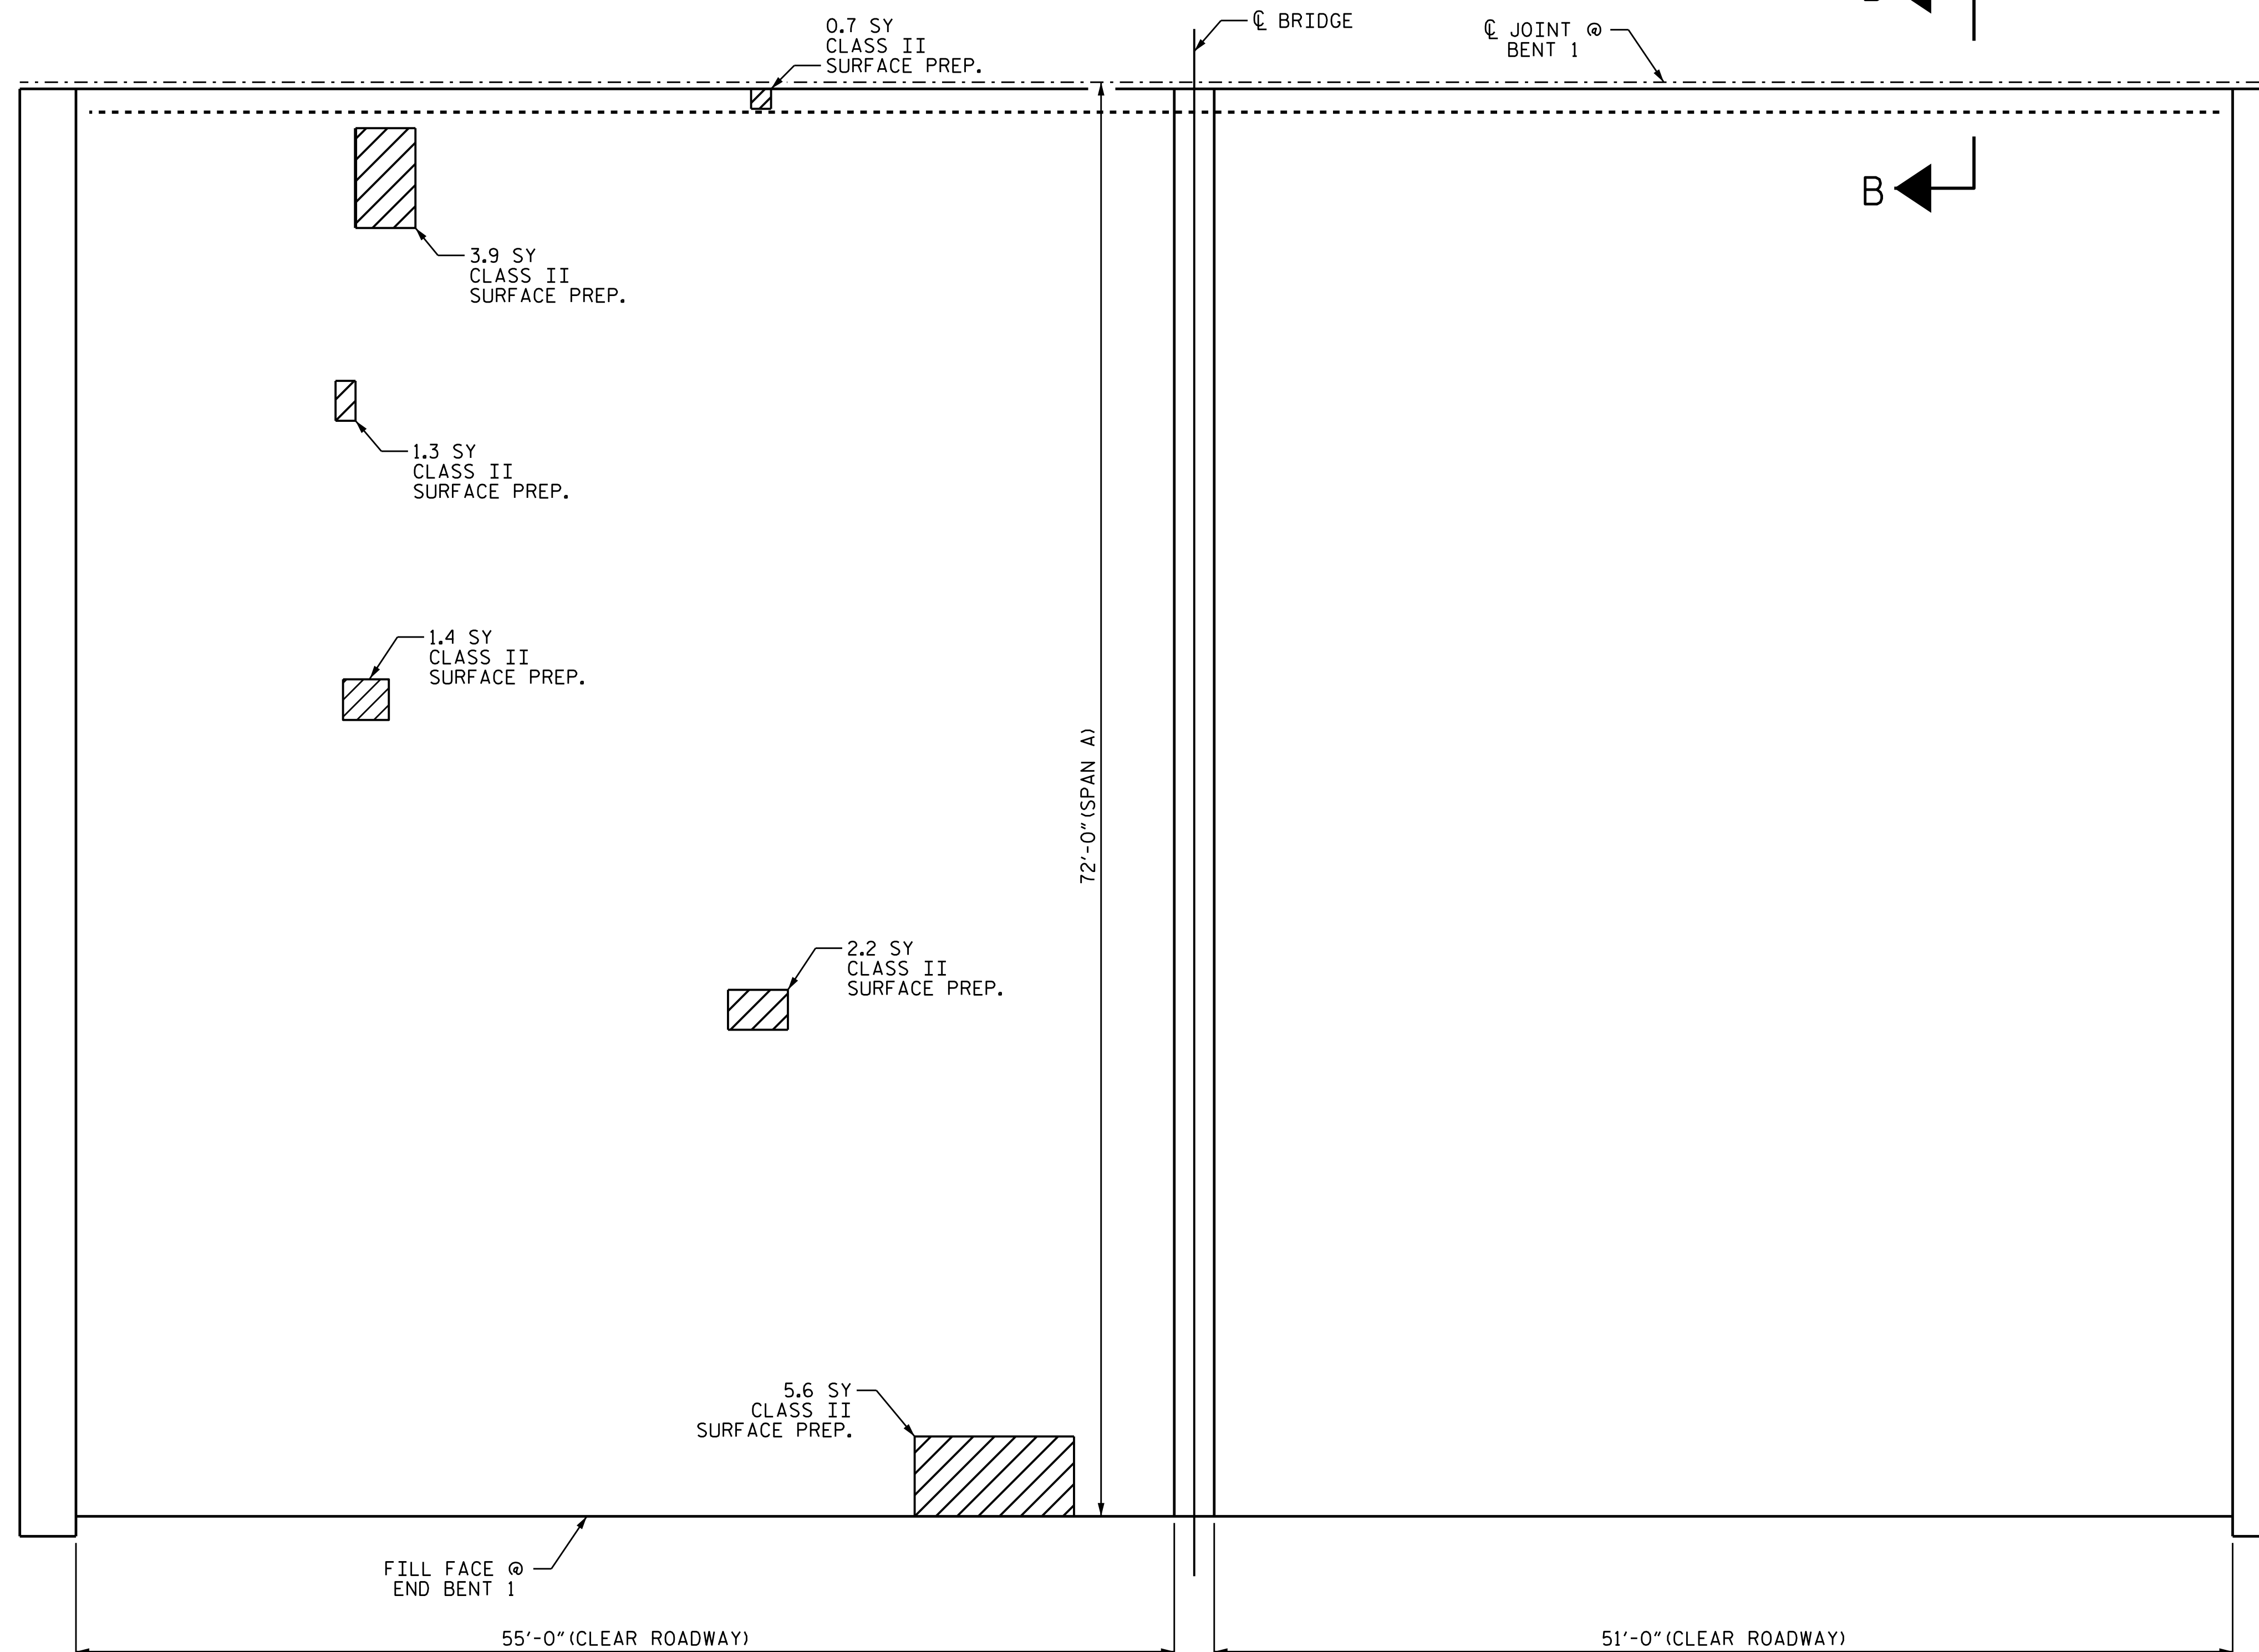
TOP OF DECK REPAIR QUANTITIES REPRESENT ESTIMATED VALUES OF CLASS II SURFACE PREPARATION AND CONCRETE DECK REPAIR FOR PPC OVERLAY AFTER REMOVAL OF UNSOUND CONCRETE. (MIN. 2" CLEAR TO SAWCUT). SEE OVERLAY SURFACE PREPARATION FOR POLYESTER POLYMER CONCRETE SPECIAL PROVISION.

NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

FOR SECTION B-B, SEE "JOINT DETAILS" SHEET.


 APPROX. CLASS II SURFACE PREPARATION

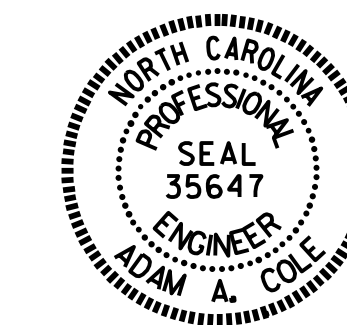


PLAN

PROJ. NO. I-5746C
MECKLENBURG COUNTY
 BRIDGE NO. 590322

SHEET 1 OF 3

DocuSigned by:

 02E803FAB074C0...



8/23/2021

STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH
 DECK SURFACE REPAIR
 SPAN A

DRAWN BY : REZA KOUCHEKI DATE : .07/2021
 CHECKED BY : H.A. LOCKLEAR DATE : .07/2021

DOCUMENT NOT CONSIDERED
 FINAL UNLESS ALL
 SIGNATURES COMPLETED

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	TOTAL SHEETS
1			3			55-4
2			4			274