

# AS-BUILT REPAIR QUANTITY TABLE

## TOP OF DECK REPAIRS


	ESTIMATE	ACTUAL
SCARIFYING BRIDGE DECK	789 SQ. YDS.	
CLASS II SURFACE PREPARATION	5.9 SQ. YDS.	
CONCRETE DECK REPAIR FOR PC OVERLAY	5.9 SQ. YDS.	
SHOTBLASTING BRIDGE DECK	789 SQ. YDS.	
PC MATERIALS	38.4 CU. YDS.	
PLACING AND FINISHING PC OVERLAY	789 SQ. YDS.	
GROOVING BRIDGE FLOORS	6654 SQ. FT.	

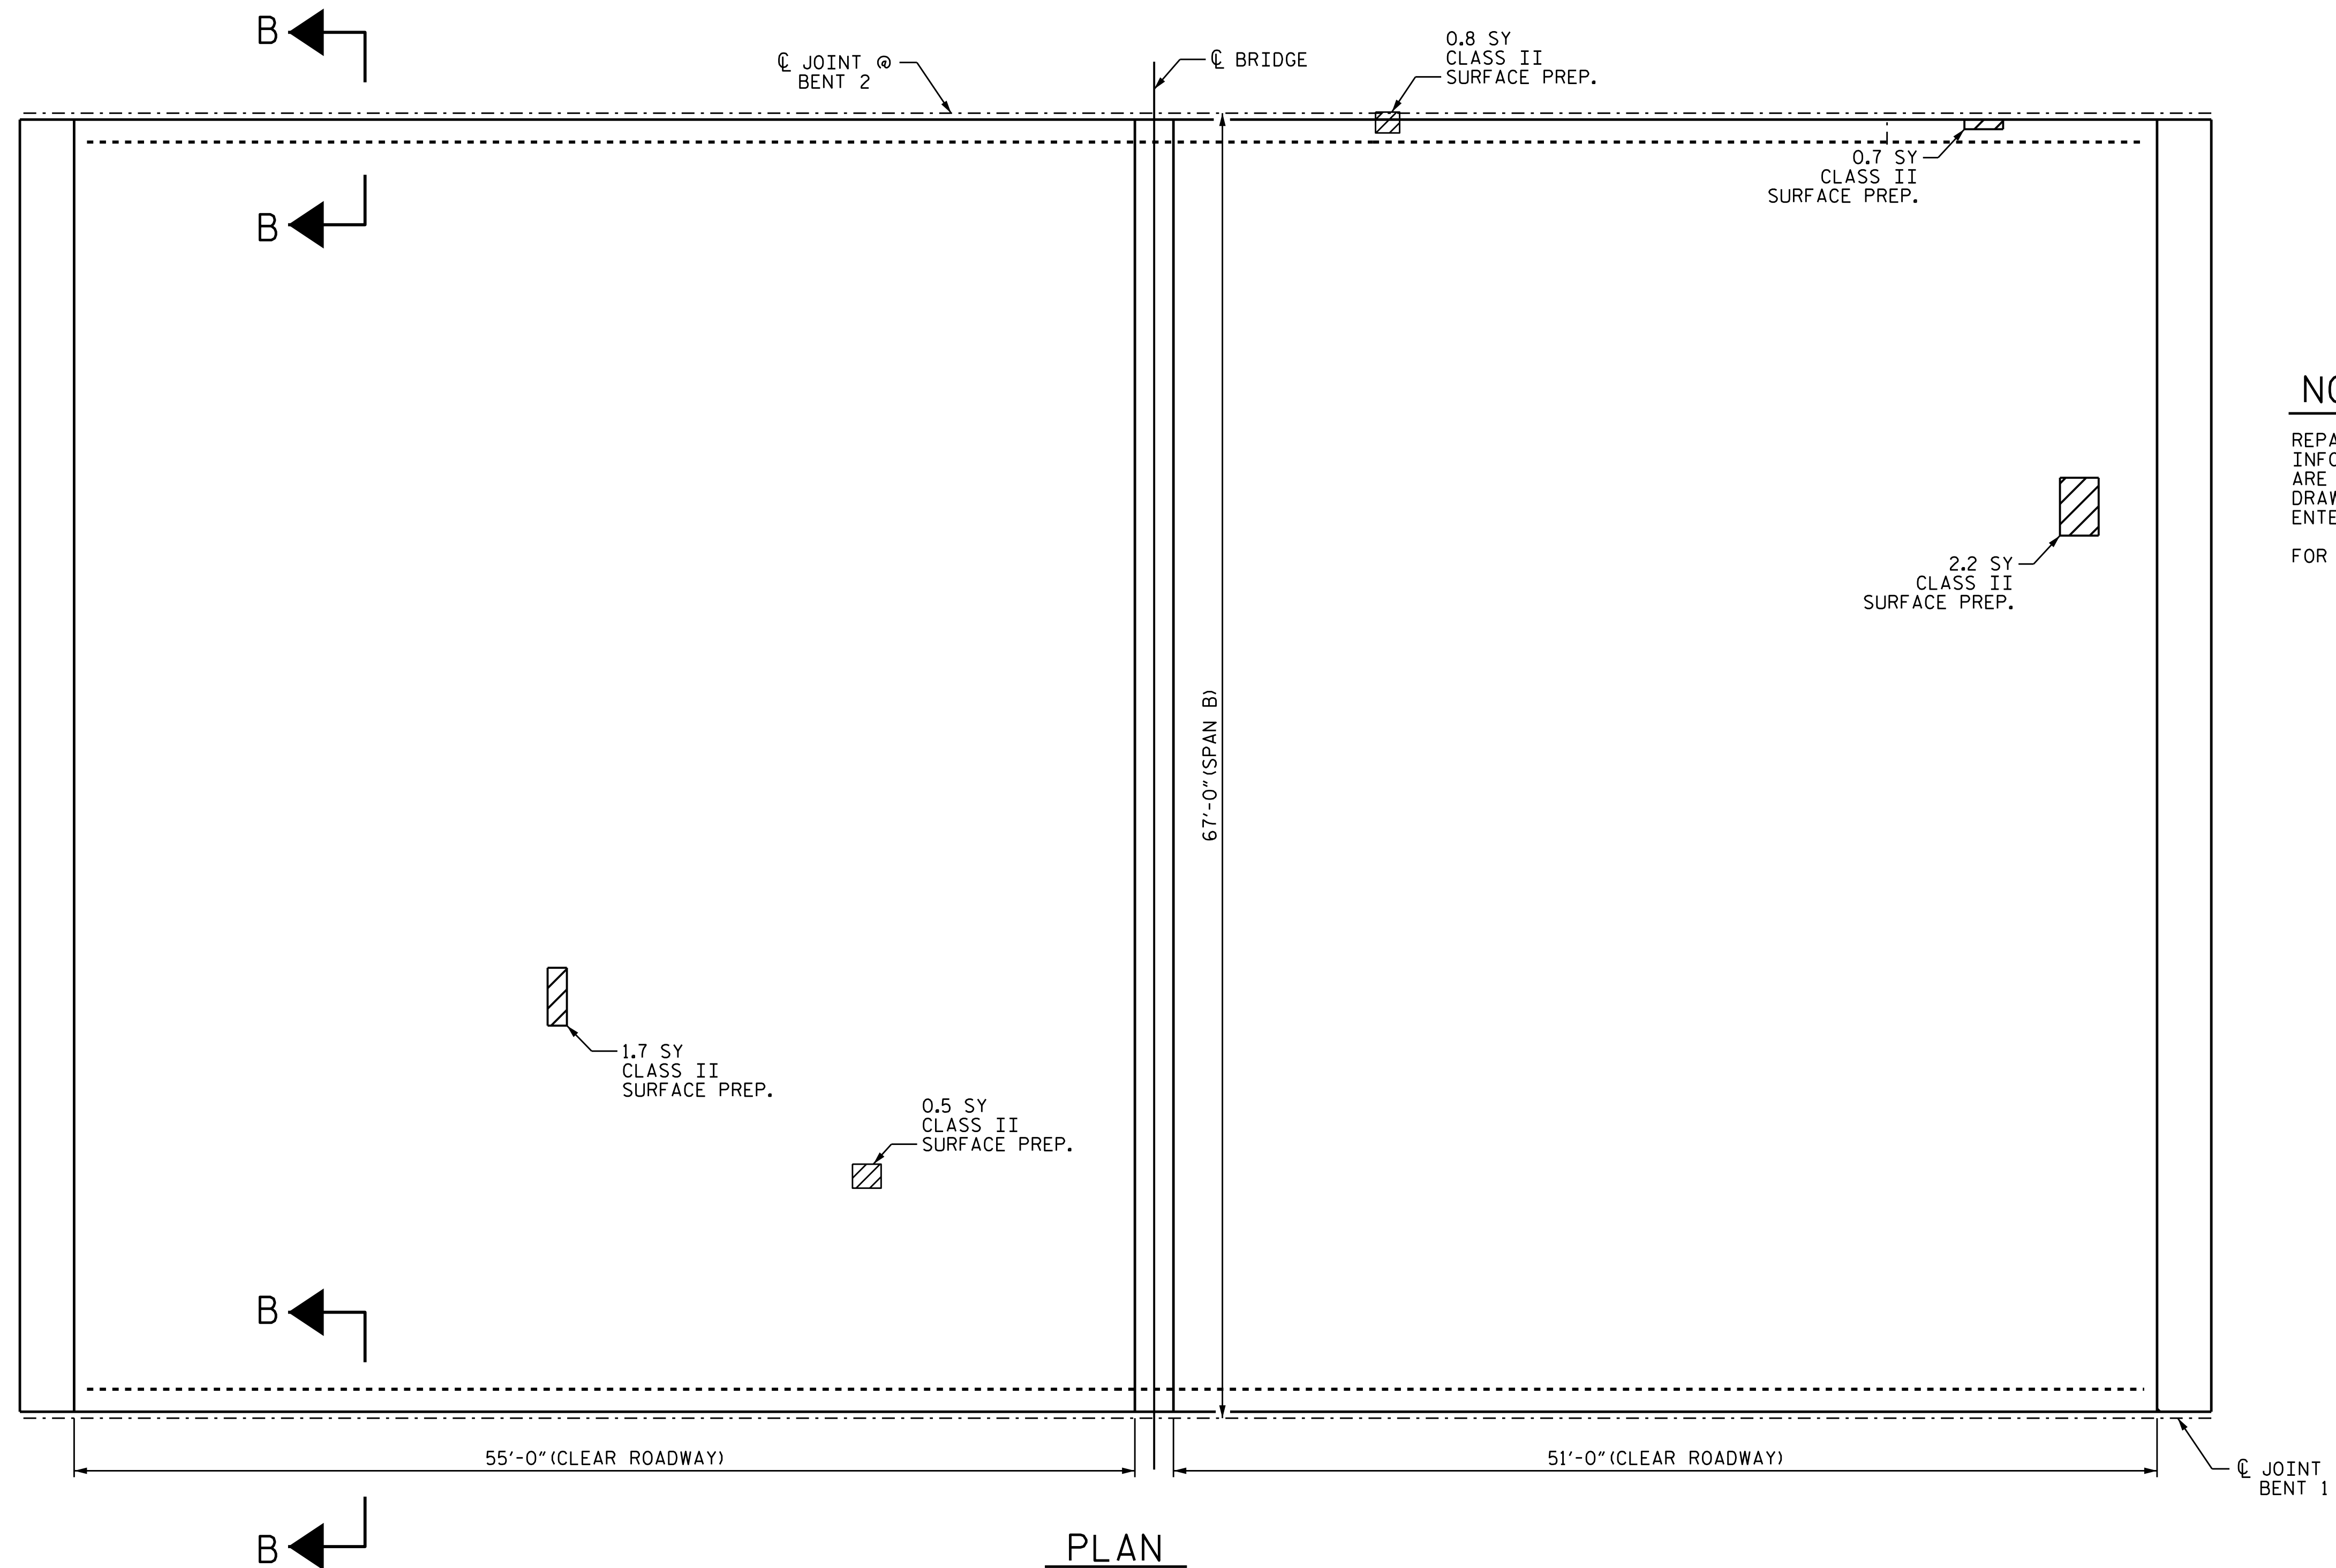
TOP OF DECK REPAIR QUANTITIES REPRESENT ESTIMATED VALUES OF CLASS II SURFACE PREPARATION AND CONCRETE DECK REPAIR FOR PPC OVERLAY AFTER REMOVAL OF UNSOUND CONCRETE. (MIN. 2" CLEAR TO SAWCUT). SEE OVERLAY SURFACE PREPARATION FOR POLYESTER POLYMER CONCRETE SPECIAL PROVISION.

### NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.


FOR SECTION B-B, SEE "JOINT DETAILS" SHEET.

 APPROX. CLASS II SURFACE PREPARATION



PROJ. NO. I-5746C  
MECKLENBURG COUNTY  
 BRIDGE NO. 590322

SHEET 2 OF 3

DocuSigned by:  
  
 02E839F4B014C5...



8/23/2021

STATE OF NORTH CAROLINA  
 DEPARTMENT OF TRANSPORTATION  
 RALEIGH

DECK SURFACE REPAIR  
 SPAN B

DRAWN BY : REZA KOUCHEKI DATE : .07/2021  
 CHECKED BY : H.A. LOCKLEAR DATE : .07/2021

DOCUMENT NOT CONSIDERED  
 FINAL UNLESS ALL  
 SIGNATURES COMPLETED

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	TOTAL SHEETS
1			3			274
2			4			