

**AS-BUILT REPAIR QUANTITY TABLE**  
DECK SURFACE REPAIR SPAN C

	ESTIMATE	ACTUAL
CONCRETE DECK REPAIR FOR SILANE DECK TREATMENT	0.0 SQ. FT.	
SHOTBLASTING BRIDGE DECK	694.0 SQ. YDS.	
SILANE DECK TREATMENT	694.0 SQ. YDS.	
<b>OTHER REPAIRS</b>		
	ESTIMATE	ACTUAL
	AREA SQ. FT.	VOLUME CU. FT.
CONCRETE REPAIRS	22.5	7.5




**NOTES:**


TOP OF DECK REPAIR QUANTITIES REPRESENT ESTIMATED VALUES OF CLASS II SURFACE PREPARATION AND CONCRETE DECK REPAIR AFTER REMOVAL OF UNSOUND CONCRETE. (MIN. 2" CLEAR TO SAWCUT). SEE CONCRETE FOR DECK REPAIR SPECIAL PROVISION.

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

FOR "CONCRETE DECK REPAIR FOR SILANE DECK TREATMENT", SEE SPECIAL PROVISIONS.

FOR SECTION B-B, SEE "JOINT DETAILS" SHEET.

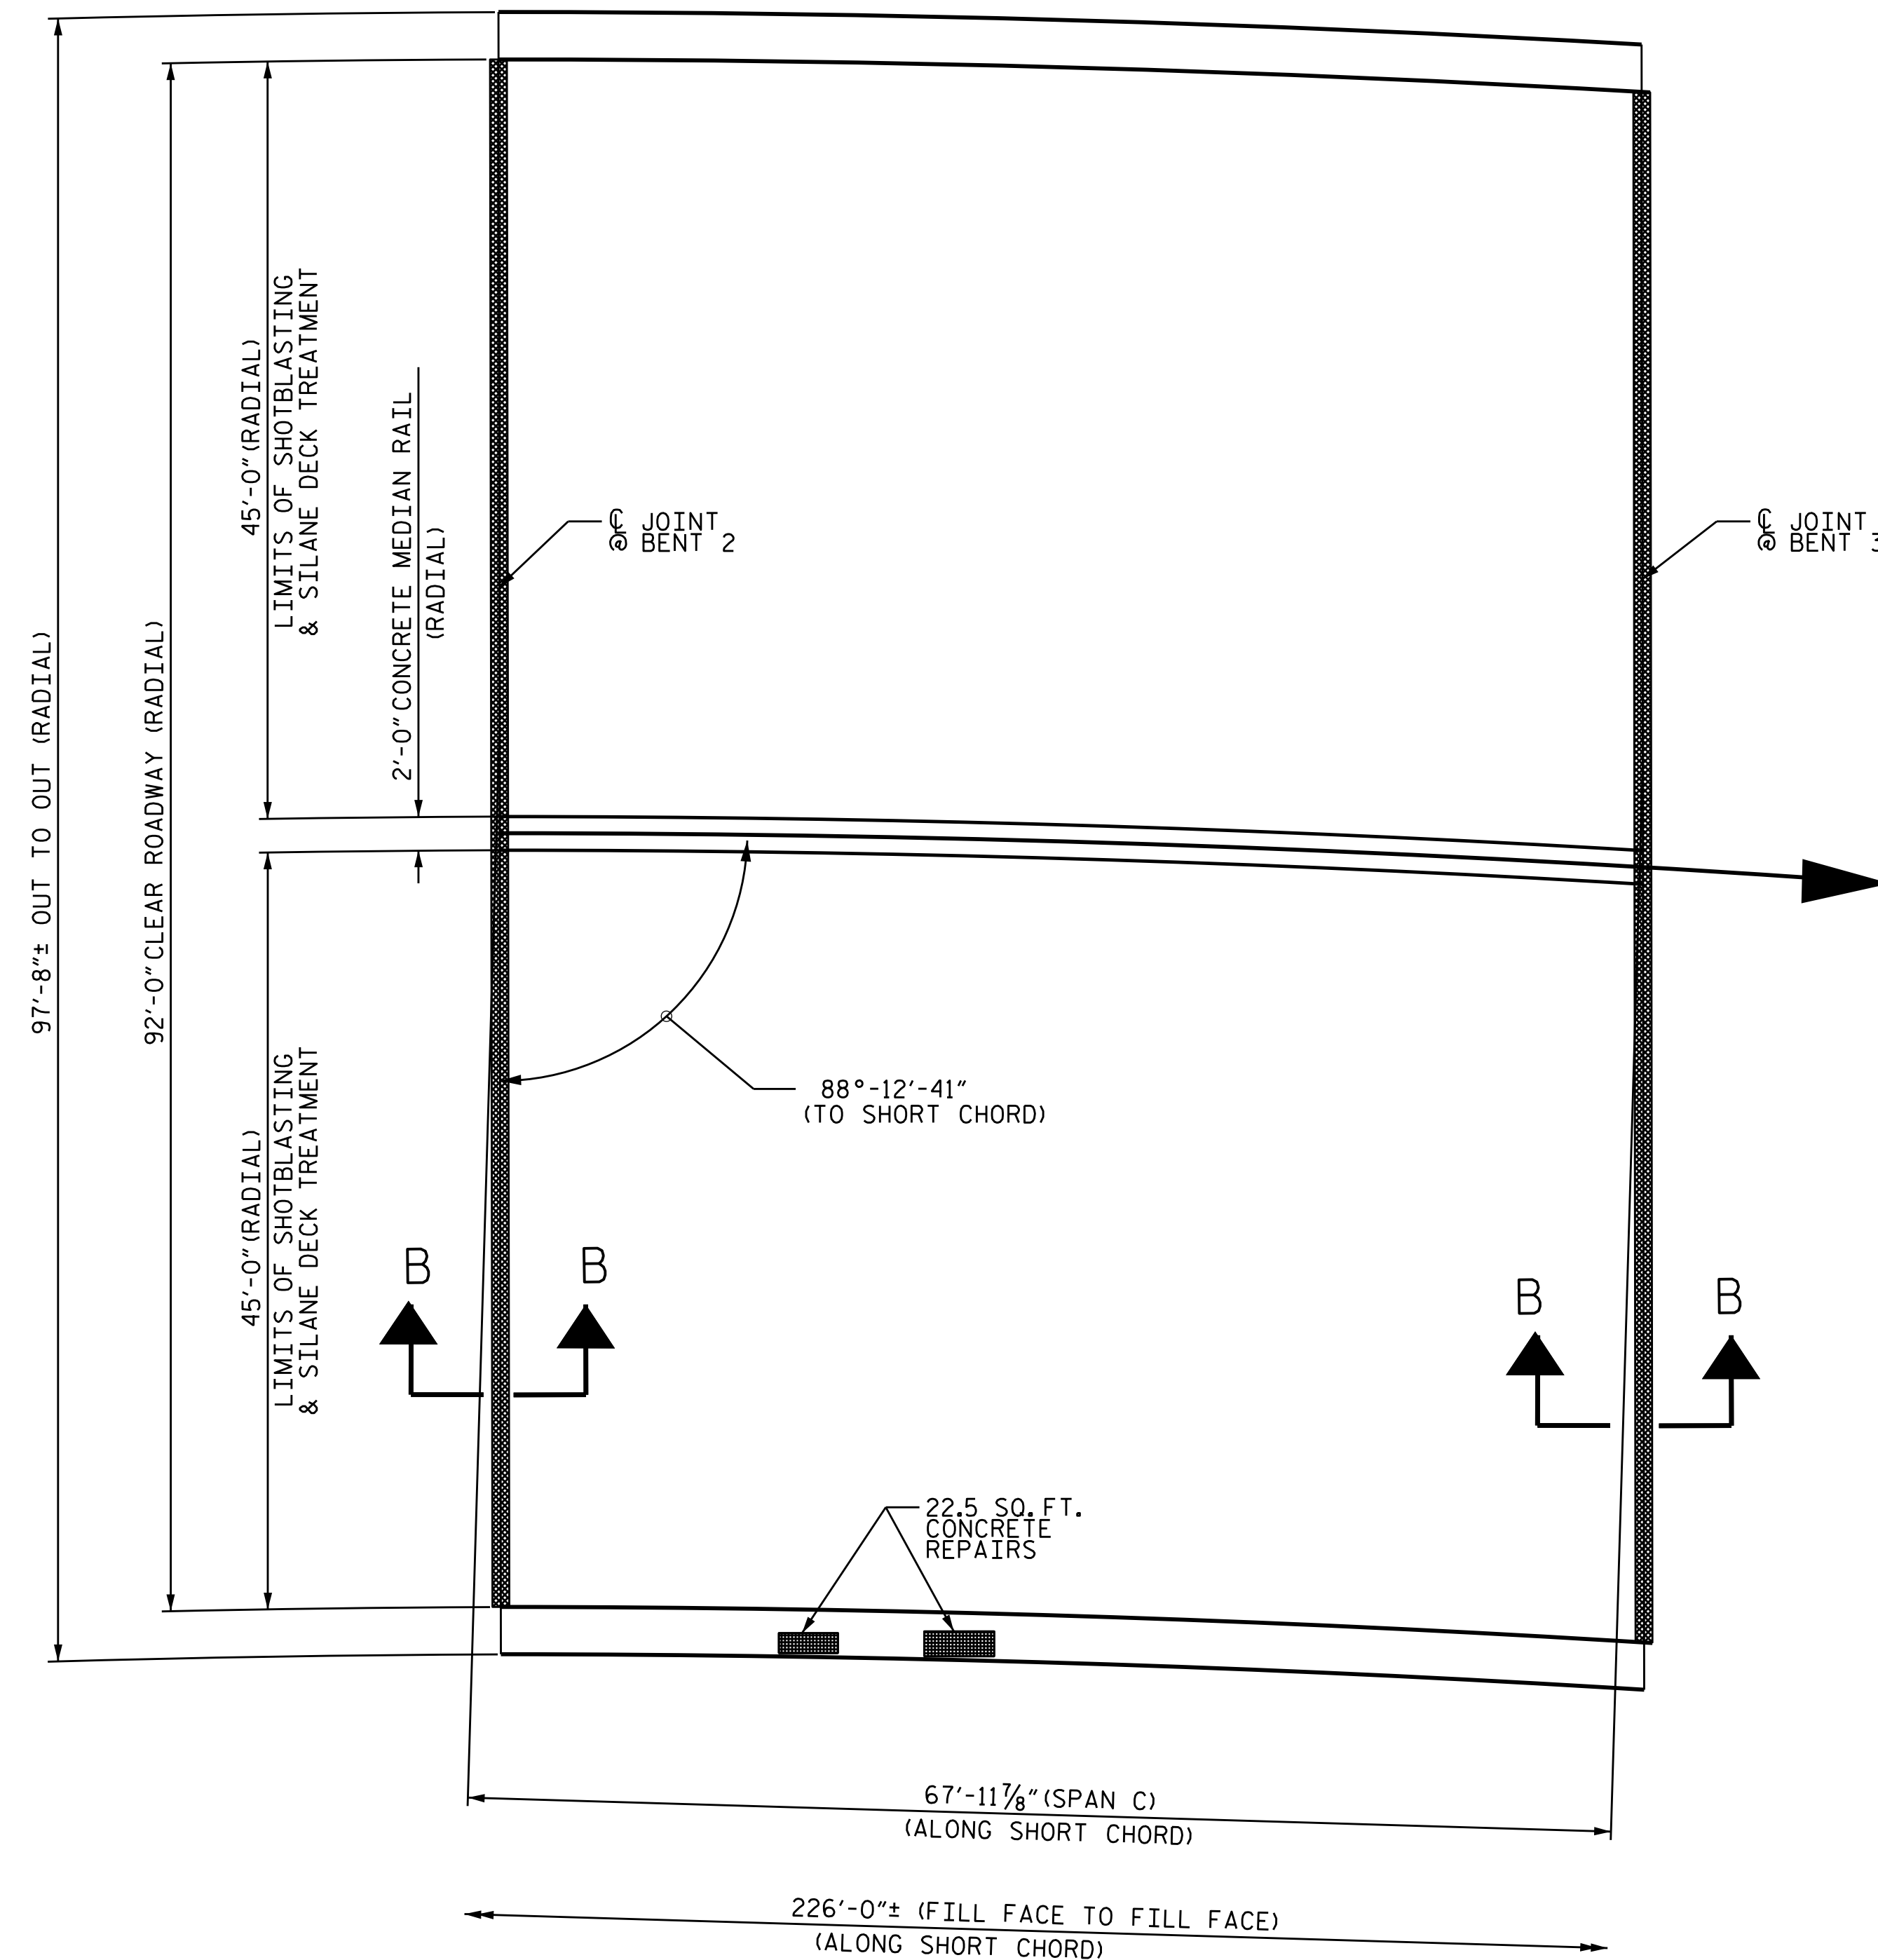
-  CONCRETE DECK REPAIR FOR SILANE DECK TREATMENT
-  CONCRETE REPAIRS
-  BRIDGE JOINT DEMOLITION



SPAN C

PROJECT NO. 15BPR.55  
FORSYTH COUNTY  
BRIDGE NO. 330078

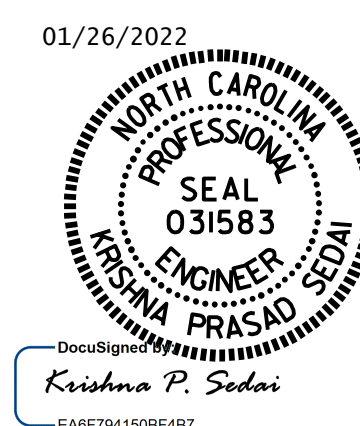SHEET 3 OF 4



STATE OF NORTH CAROLINA  
DEPARTMENT OF TRANSPORTATION  
RALEIGH  
**DECK SURFACE REPAIR**  
**SPAN C**

DRAWN BY : E. BAYISSA DATE : 12/2019  
CHECKED BY : A. SORSENGINH DATE : 07/2021

DOCUMENT NOT CONSIDERED  
FINAL UNLESS ALL  
SIGNATURES COMPLETED

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	S1-06
1			3			TOTAL SHEETS
2			4			79