


EDI MODEL 2018ECL-NC CONFLICT MONITOR PROGRAMMING DETAIL

(remove jumpers and set switches as shown)


REMOVE DIODE JUMPERS 2-5, 2-6, 2-11, 2-12, 4-12, 5-11, 5-12, 6-11 and 11-12.

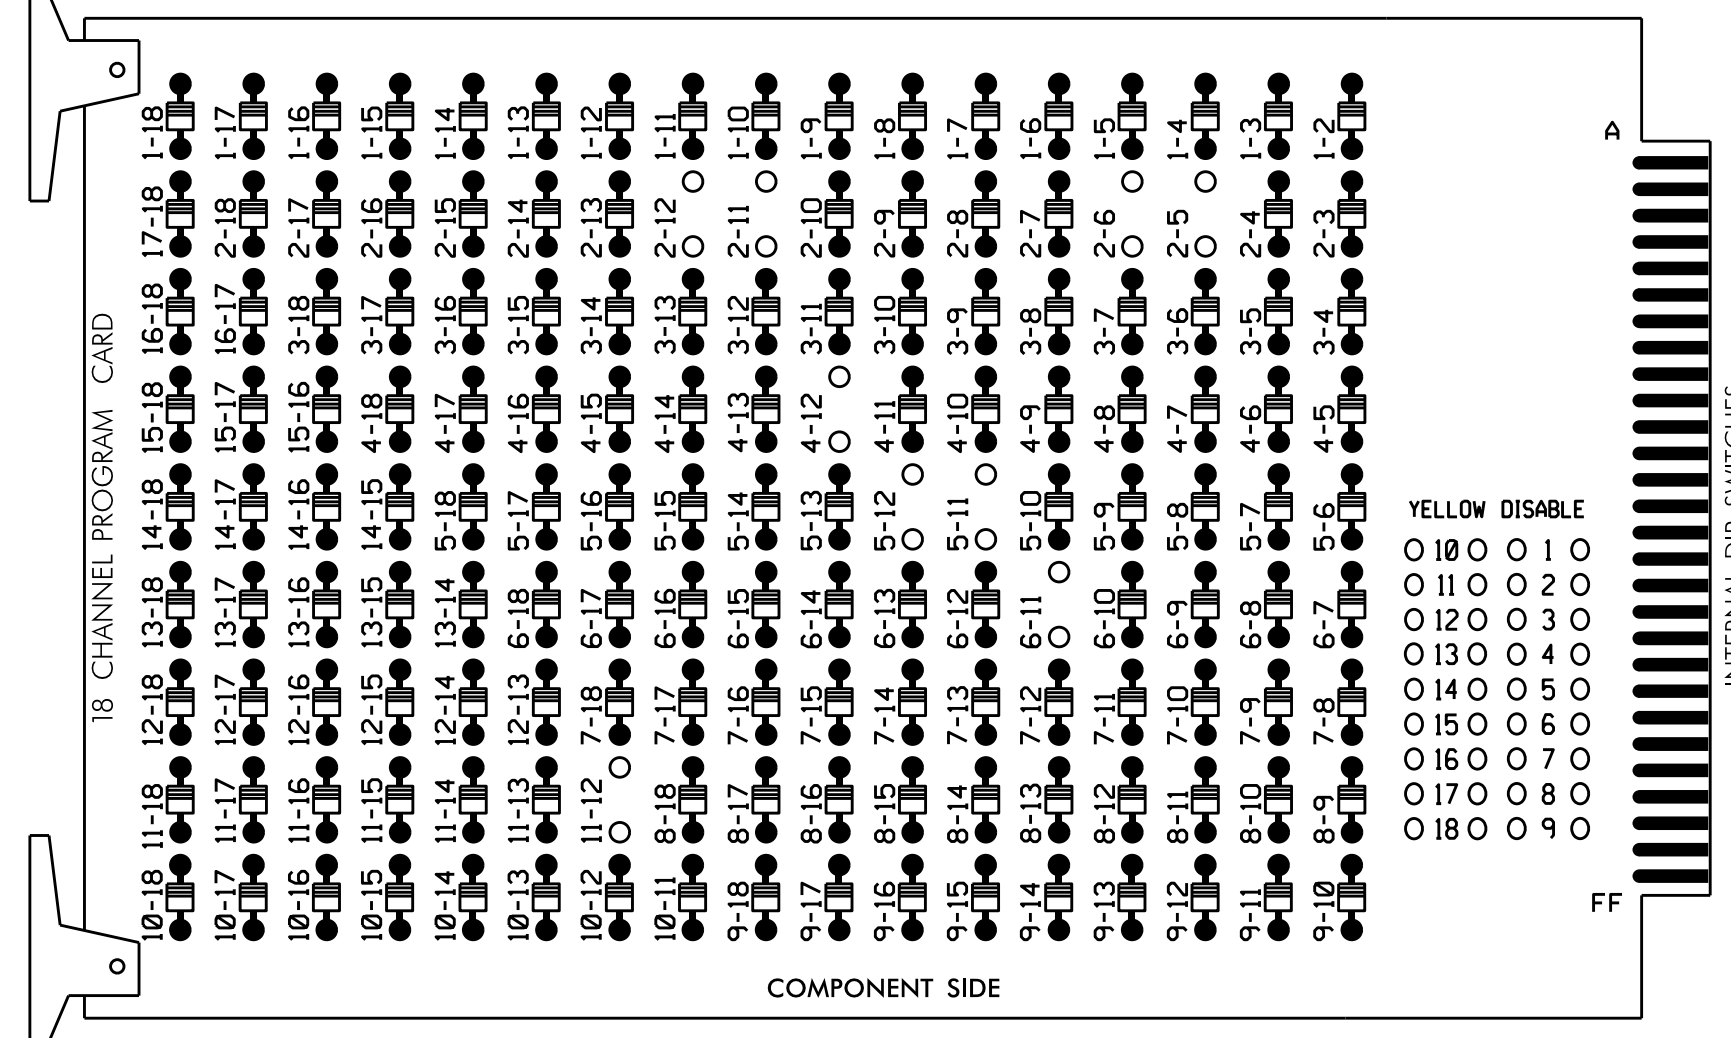

REMOVE JUMPERS AS SHOWN

NOTES:

1. Card is provided with all diode jumpers in place. Removal of any jumper allows its channels to run concurrently.
2. Ensure jumpers SEL2-SEL5 and SEL9 are present on the monitor board.
3. Ensure that Red Enable is active at all times during normal operation.
4. Connect serial cable from conflict monitor to comm. port 1 of 2070 controller. Ensure conflict monitor communicates with 2070.

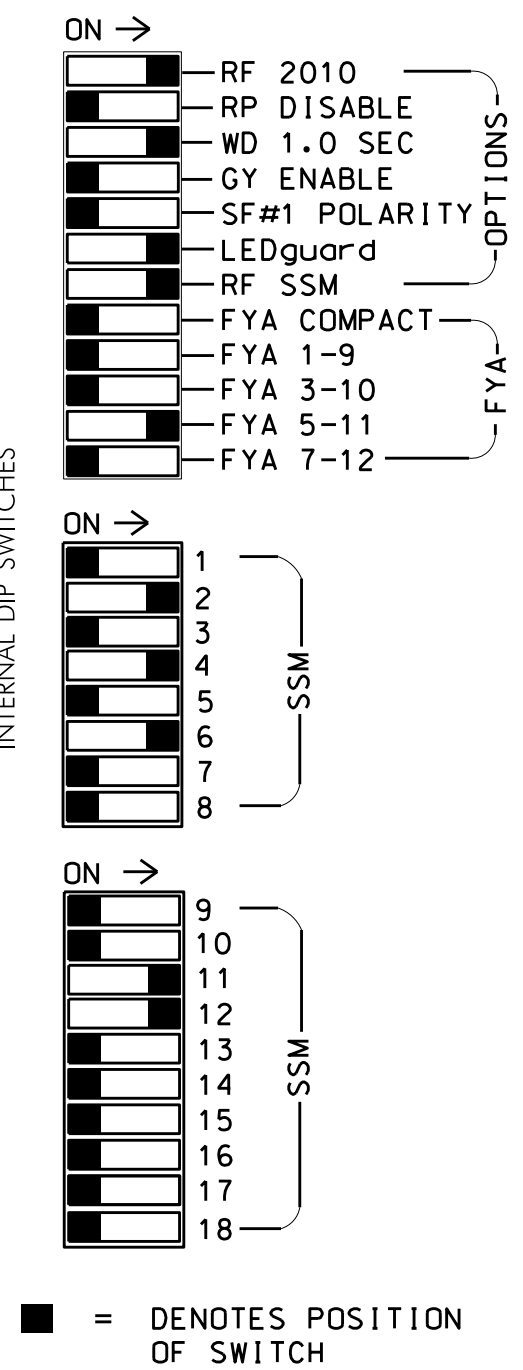

NOTES

1. To prevent "flash-conflict" problems, insert red flash program blocks for all unused vehicle load switches in the output file. The installer shall verify that signal heads flash in accordance with the Signal Plans.
2. Enable Simultaneous Gap-Out for all Phases.
3. Program phases 2 and 6 for Variable Initial and Gap Reduction.
4. Program phases 2 and 6 for Startup In Green.
5. Program phases 2 and 6 for Yellow Flash.
6. If this signal will be managed by an ATMS software, enable controller and detector logging for all detectors used at this location.

EQUIPMENT INFORMATION

CONTROLLER.....2070
 CABINET.....332 W/ AUX
 SOFTWARE.....ECONOLITE OASIS
 CABINET MOUNT.....BASE
 OUTPUT FILE POSITIONS...18 WITH AUX. OUTPUT FILE
 LOAD SWITCHES USED.....S2,S5,S7,S8,AUX S4,AUX S5
 PHASES USED.....2,4,5,6
 OVERLAP "A".....NOT USED
 OVERLAP "B".....NOT USED
 OVERLAP "C".....5+6
 OVERLAP "D".....4+5

SIGNAL HEAD HOOK-UP CHART


LOAD SWITCH NO.	S1	S2	S3	S4	S5	S6	S7	S8	S9	S10	S11	S12	AUX S1	AUX S2	AUX S3	AUX S4	AUX S5	AUX S6
CMU CHANNEL NO.	1	2	13	3	4	14	5	6	15	7	8	16	9	10	17	11	12	18
PHASE	1	2	2 PED	3	4	4 PED	5	6	6 PED	7	8	8 PED	OLA	OLB	SPARE	OLC	OLD	SPARE
SIGNAL HEAD NO.	NU	21,22	NU	NU	41,42	62	NU	51	61,62	NU	NU	NU	NU	NU	NU	51	43	NU
RED		128								134								A101
YELLOW		129						*	135									
GREEN		130							136									
RED ARROW					101													A114
YELLOW ARROW					102	102												A115 A102
FLASHING YELLOW ARROW																		A116
GREEN ARROW					103	103	133											A103

NU = Not Used

* Denotes install load resistor. See load resistor installation detail this sheet.
 ★ See pictorial of head wiring in detail this sheet.

INPUT FILE POSITION LAYOUT

(front view)

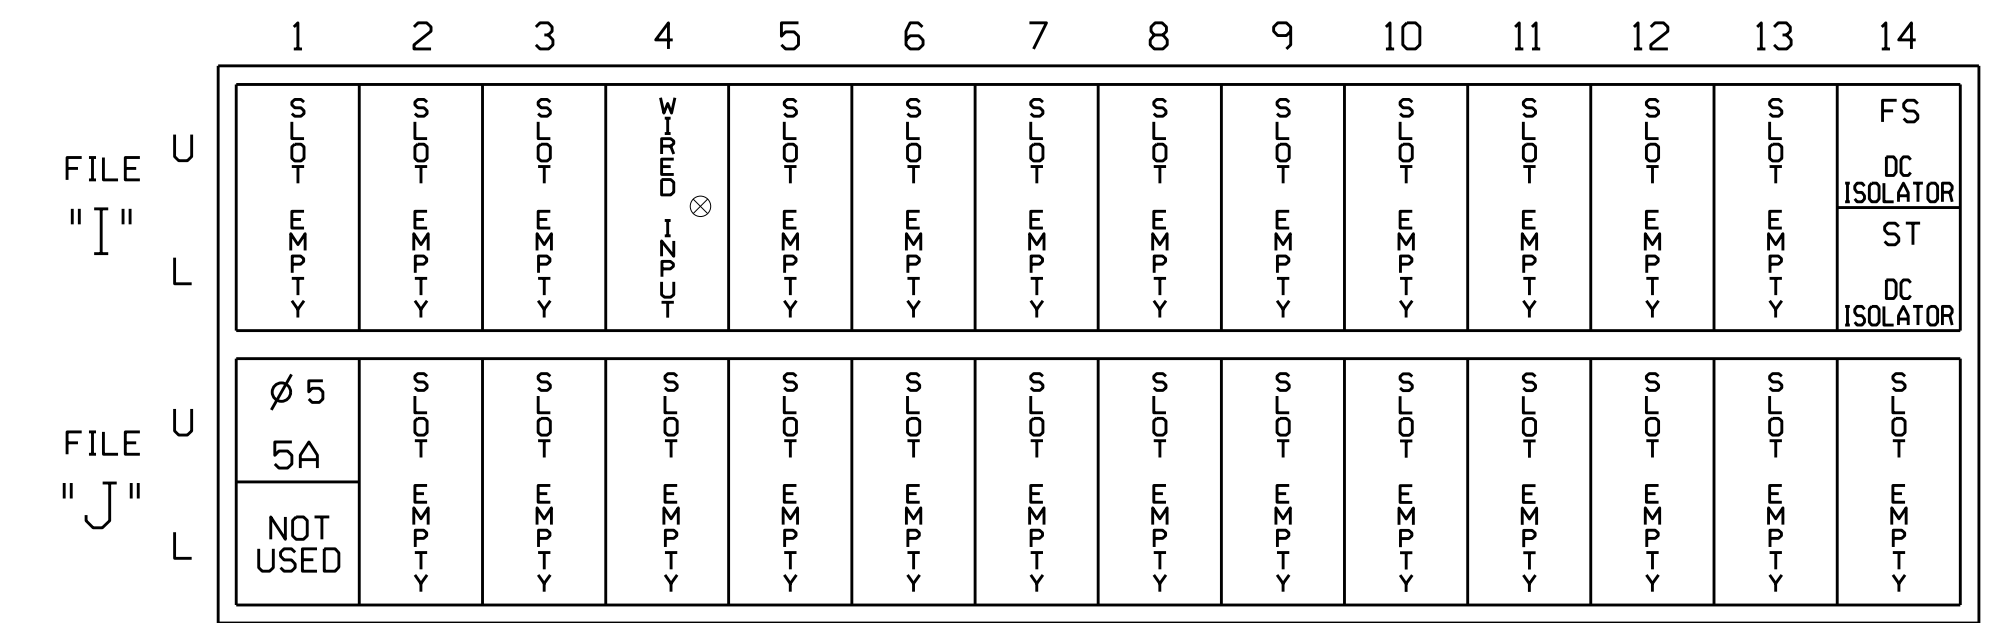

EX.: 1A, 2A, ETC. = LOOP NO.'S

FS = FLASH SENSE
 ST = STOP TIME

⊗ Wired Input - Do not populate slot with detector card


INPUT FILE CONNECTION & PROGRAMMING CHART

LOOP NO.	LOOP TERMINAL	INPUT FILE POS.	PIN NO.	INPUT ASSIGNMENT NO.	DETECTOR NO.	NEMA PHASE	CALL	EXTEND	FULL TIME DELAY	STRETCH TIME	DELAY TIME
5A ¹	TB3-1,2	J1U	55	17	5	5	Y	Y			15
	-	14U	47	9 ★	22	2	Y	Y			3
	-	J1U	55	17 ★	55	5	Y	Y			

¹Add jumper from J1-W to I4-W, on rear of input file.


★ See Input Page Assignment programming details on sheet 3.

INPUT FILE POSITION LEGEND: J2L

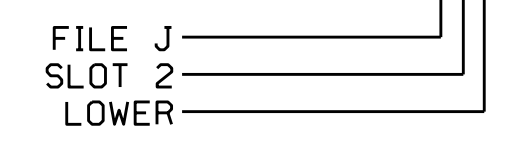

FYA SIGNAL WIRING DETAIL

(wire signal head as shown)

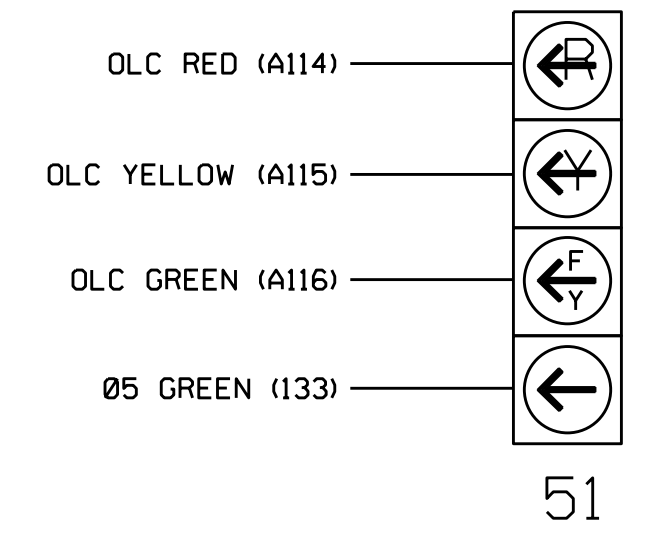


NOTE

The sequence display for signal head 51 requires special logic programming. See sheet 2 for programming instructions.

LOAD RESISTOR INSTALLATION DETAIL

(install resistor as shown below)

VALUE (ohms)	WATTAGE
1.5K - 1.9K	25W (min)
2.0K - 3.0K	10W (min)

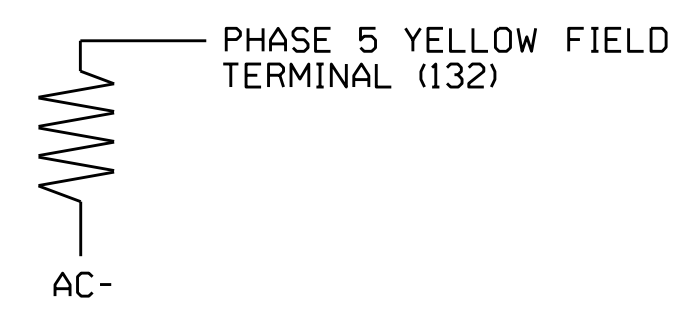

DETECTOR NOTES

1. For all loops install a video detection system for vehicle detection. Perform installation according to manufacturer's directions and NCDOT engineer-approved mounting locations to accomplish the detection schemes shown on the Signal Design Plans.
2. For loop 5A, detector card placement and slot reserved for wired input are typical for a NCDOT installation. Input associated with this slot are compatible with time of day instructions located on sheet 3 of this electrical detail.

Temporary Design 2
 Electrical Detail - Sheet 1 of 4

ELECTRICAL AND PROGRAMMING DETAILS FOR:
 Prepared for the Offices of:

 750 N. Greenfield Pkwy, Garner, NC 27529

NC 42 (Broadway Road) at US 421/NC 87 Southbound Ramps
 Division 8 Lee County Sanford
 PLAN DATE: April 2022 REVIEWED BY:
 PREPARED BY: Zarrar Zafar REVIEWED BY:
 REVISIONS INIT. DATE

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED
 SEAL

 D. Todd Joyce 04/22/2022
 SIG. INVENTORY NO. 08-1064T2

02-APR-2022 09:45
 S:\MTS\504\15\SIGNAL\work\hous\51g_MarkZafar\plans\081064_Temp and final\081064_sm_elec_2022mde-12.dgn
 ZZZZ