


PLAN OF SPAN 134

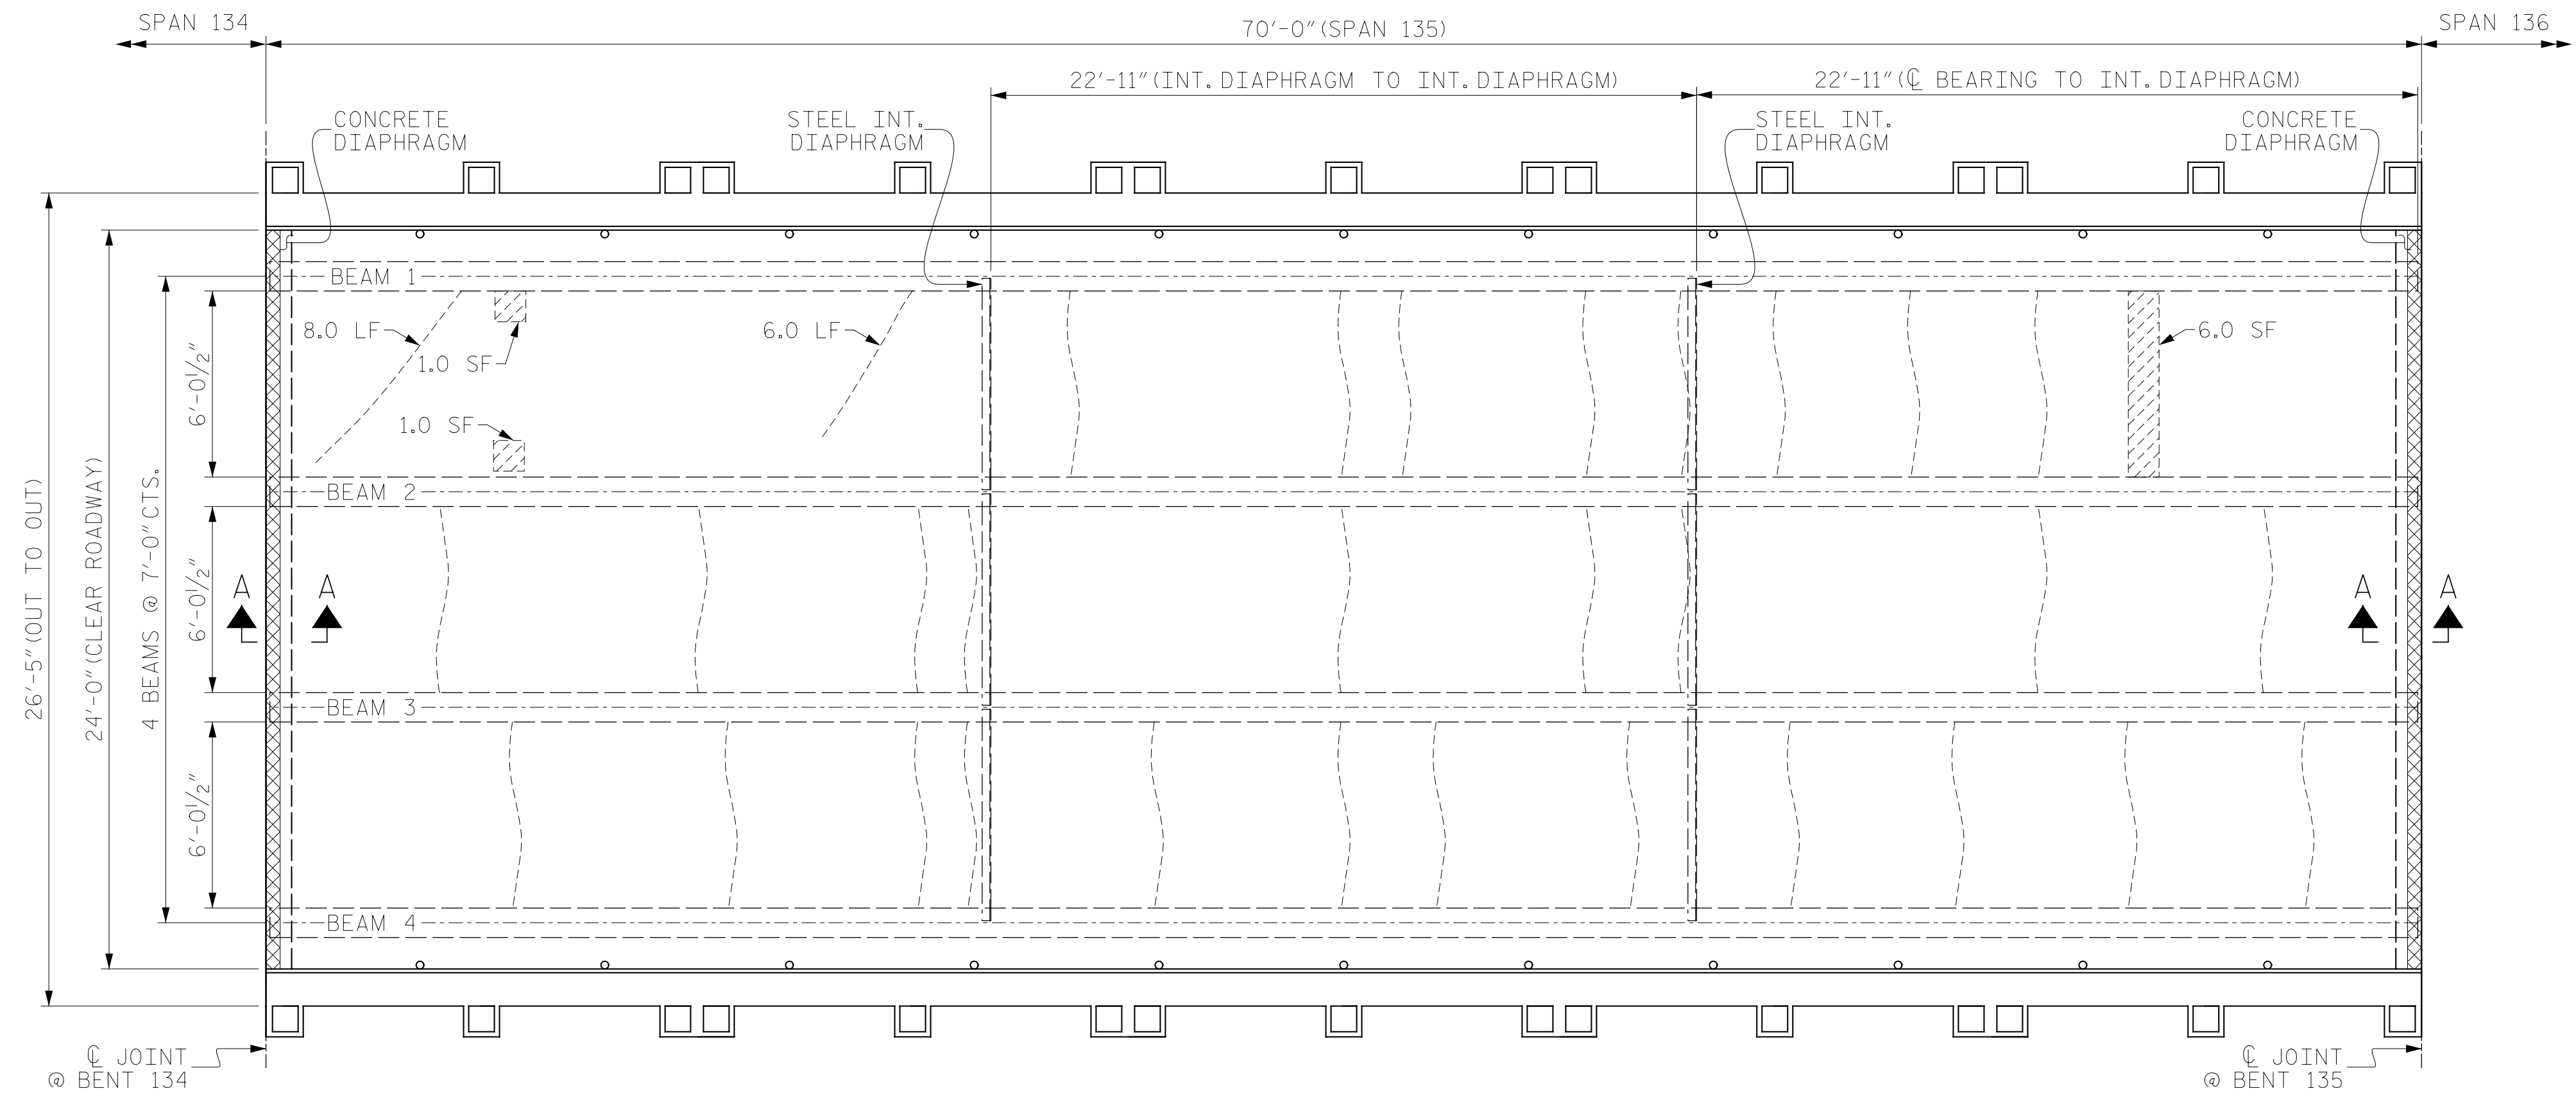

PLAN OF SPAN 135

SUMMARY OF QUANTITIES FOR SPAN 134		
	ESTIMATE	ACTUAL
SHOTCRETE REPAIRS (UNDERDECK)	0.4 CF	
BRIDGE JOINT DEMOLITION	22.0 SF	
CLASS II SURFACE PREPARATION	-	
CLASS III SURFACE PREPARATION	-	
CONCRETE DECK REPAIR FOR MMA OVERLAY	-	
CRACK PRETREATMENT	175.2 LF	
CONCRETE BRIDGE DECK CRACK SEALING	184.3 SY	
MMA OVERLAY SYSTEM	1658.0 SF	

SUMMARY OF QUANTITIES FOR SPAN 135		
	ESTIMATE	ACTUAL
SHOTCRETE REPAIRS (UNDERDECK)	2.7 CF	
BRIDGE JOINT DEMOLITION	22.0 SF	
CLASS II SURFACE PREPARATION	-	
CLASS III SURFACE PREPARATION	-	
CONCRETE DECK REPAIR FOR MMA OVERLAY	-	
CRACK PRETREATMENT	189.2 LF	
CONCRETE BRIDGE DECK CRACK SEALING	184.3 SY	
MMA OVERLAY SYSTEM	1658.0 SF	

- SHOTCRETE REPAIRS (UNDERDECK)
- BRIDGE JOINT DEMOLITION
- CLASS II DECK REPAIR
- CLASS III DECK REPAIR
- MMA OVERLAY SYSTEM
- CRACK PRETREATMENT

PROJECT NO. HB-0017
DARE COUNTY
 BRIDGE NO. 270009



STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH
 SURFACE PREPARATION
 & UNDERDECK REPAIRS
 SPANS 134 THRU 135

NOTE:
 REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE AS-BUILT REPAIR QUANTITY TABLE.

DRAWN BY : M. SPENCER DATE : 12/2018
 CHECKED BY : J. FARNHAM DATE : 03/2019



DOCUMENT NOT CONSIDERED
 FINAL UNLESS ALL
 SIGNATURES COMPLETED

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	TOTAL SHEETS
1			3			55
2			4			355