
## REPAIR KEY - SHOTBLASTING AND SILANE DECK TREATMENT - CONCRETE DECK REPAIR FOR SILANE DECK TREATMENT - BRIDGE JOINT DEMOLITION

## **NOTES**

- REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN IN DRAWINGS ARE DEEMED NECESSARY BY ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITES ENTERED INTO THE SUMMARY OF QUANTITIES TABLE.
- FINAL JOINT SEALS SHALL NOT BE INSTALLED UNTIL THE SILANE DECK TREATMENT IS COMPLETE.
- FOR ELASTOMERIC CONCRETE FOR PRESERVATION, SEE SPECIAL PROVISIONS.
- FOR BRIDGE JOINT DEMOLITION, SEE SPECIAL PROVISIONS.
- FOR SECTION A-A, SEE JOINT REPAIR DETAILS SHEET S2-4.

## SUMMARY OF QUANTITIES FOR DECK AND APPROACH SLABS

J		
	ESTIMATE	ACTUAL
SHOTBLASTING BRIDGE DECK	1,052.7 SY	
SILANE DECK TREATMENT	1,052.7 SY	
CONCRETE DECK REPAIR FOR SILANE DECK TREATMENT	0 SF	
BRIDGE JOINT DEMOLITION	83.1 SF	

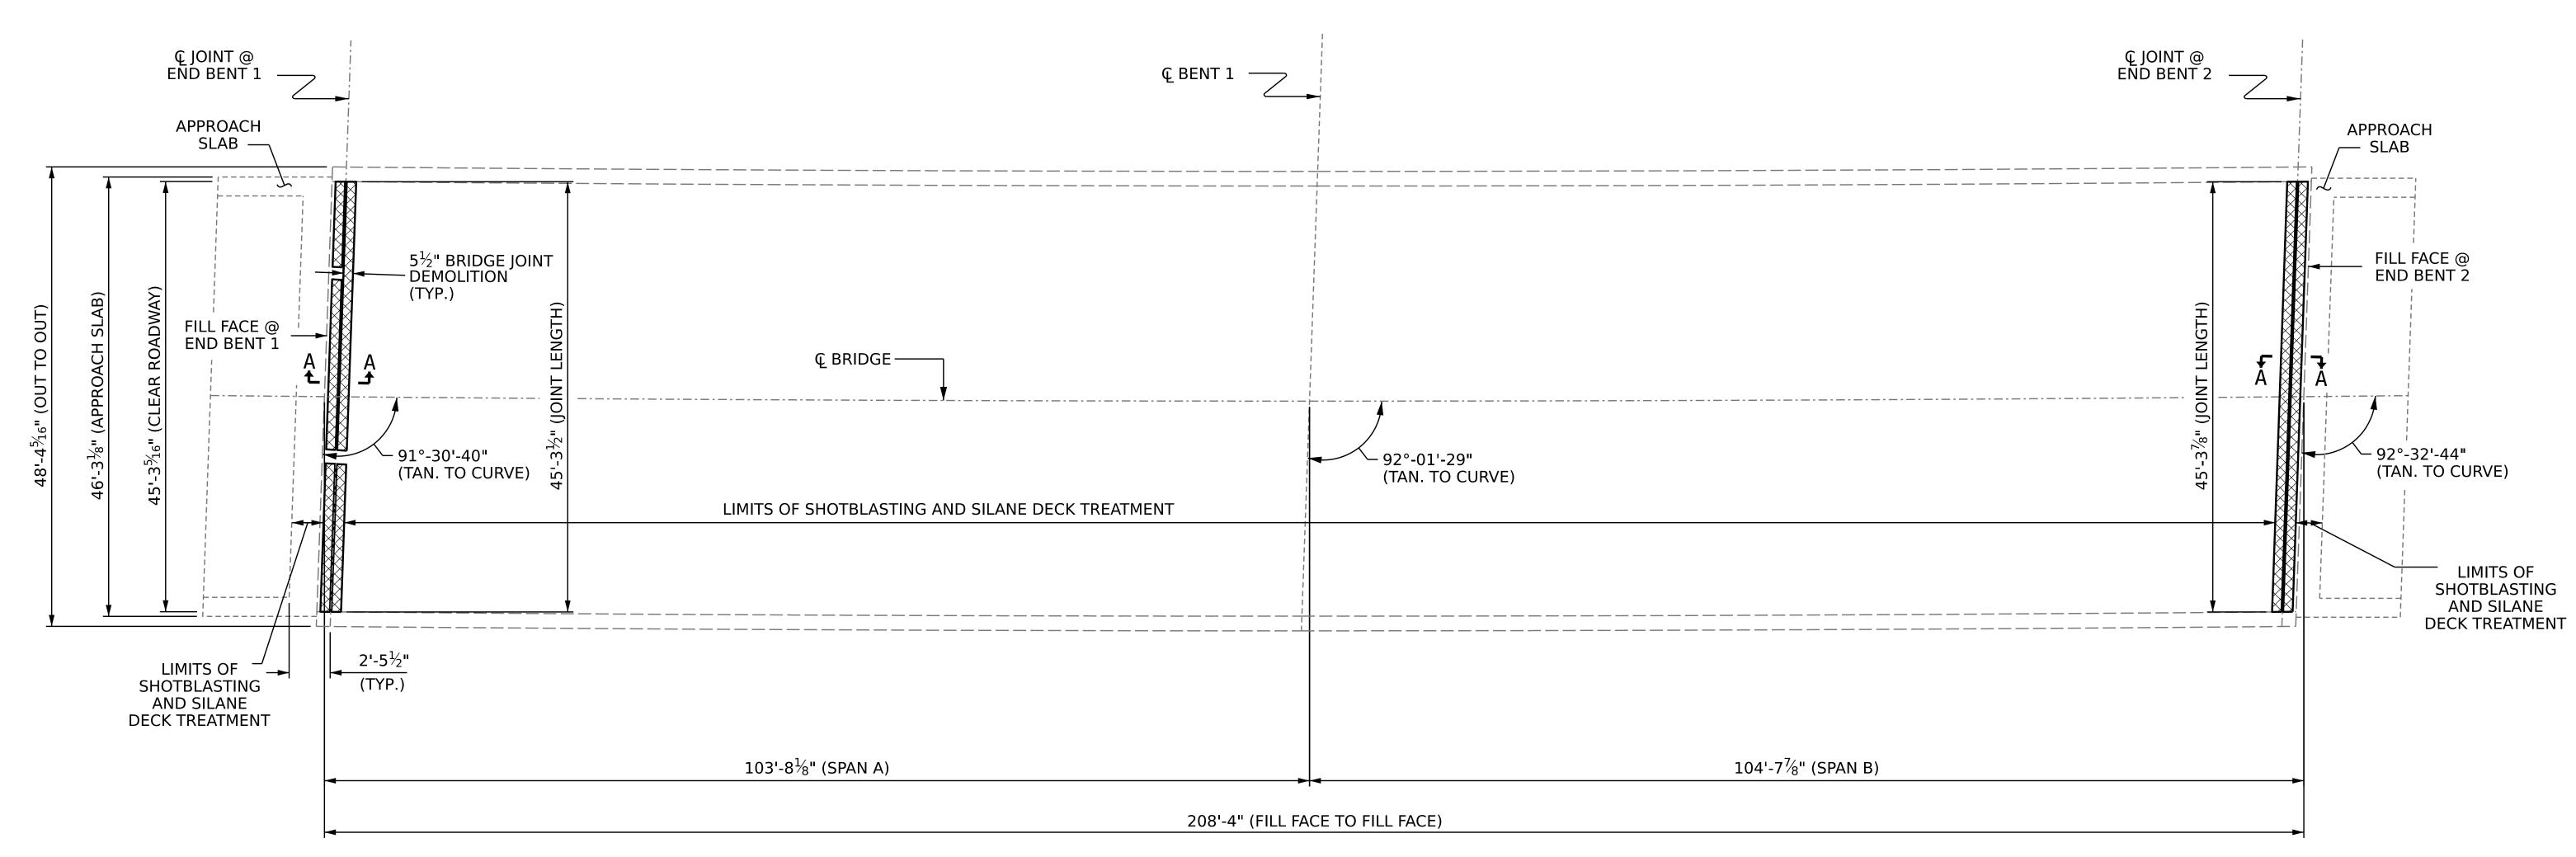

PLAN OF SPANS

PROJECT NO. HI-0006
WILSON COUNTY

BRIDGE NO. 970247



STATE OF NORTH CAROLINA

DEPARTMENT OF TRANSPORTATION

RALEIGH

SILANE DECK TREATMENT

SHEET NO.

S2-3

REVISIONS

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED 2 REVISIONS

REVISIONS

DATE: NO. BY: DATE: NO. BY: DATE:

DRAWN BY: G. AYES DATE: 5/2022
CHECKED BY: A. G. ABRAHA DATE: 5/2022

DESIGN ENGINEER OF RECORD:

7/11/2022 S:\DPG1\Division4\HI-0006\Plans\970247\402\_005\_HI-0006\_SMU\_S\*\_S2-3\_970247.dgn aabraha