## AS-BUILT REPAIR QUANTITY TABLE


## CUDEDCEDUCTUDE DEDATOC

|  |        |          | SUPE | RSTRUC | TURE F | REPAIRS  |      |        |        |          |      |        |      |          |      |        |  |
|--|--------|----------|------|--------|--------|----------|------|--------|--------|----------|------|--------|------|----------|------|--------|--|
|  |        | SPAN 1   |      |        |        | SPAN 2   |      |        | SPAN 3 |          |      | SPAN 4 |      |          |      |        |  |
|  | ESTI   | ESTIMATE |      | ACTUAL |        | ESTIMATE |      | ACTUAL |        | ESTIMATE |      | ACTUAL |      | ESTIMATE |      | ACTUAL |  |
|  | AREA   | VOLUME   | AREA | VOLUME | AREA   | VOLUME   | AREA | VOLUME | AREA   | VOLUME   | AREA | VOLUME | AREA | VOLUME   | AREA | VOLUME |  |
| CONCRETE REPAIR AREA (CR)                        | 3.4 SF | 1.2 CF   |      |        | 2.9 SF | 1.0 CF   |      |        | SF     | CF       |      |        | SF   | CF       |      |        |  |
|  | ESTI   | ESTIMATE |      | ACTUAL |        | ESTIMATE |      | ACTUAL |        | ESTIMATE |      | ACTUAL |      | ESTIMATE |      | UAL    |  |
| CLEANING & PAINTING EXISTING BEARINGS WITH HRSCA | 4      | 4 EA     |      |        |        | 8 EA     |      |        |        | 8 EA     |      |        |      | 4 EA     |      |        |  |

QUANTITIES FOR REMOVAL OF DIAPHRAGMS AT OVERHANGS (RD) ARE NOT INCLUDEDED AND SHALL BE INCIDENTAL TO THE PAY ITEM FOR "CONCRETE REAPIRS".

LEGEND:

- CLEAN AND PAINT GIRDER ENDS (5 LF)
- CLEAN AND PAINT BEARING
- REMOVE END DIAPHRAGM AT OVERHANG (SEE DETAIL "RD")
- CR CONCRETE REPAIR AREA
- EF EAST FACE
- WF WEST FACE

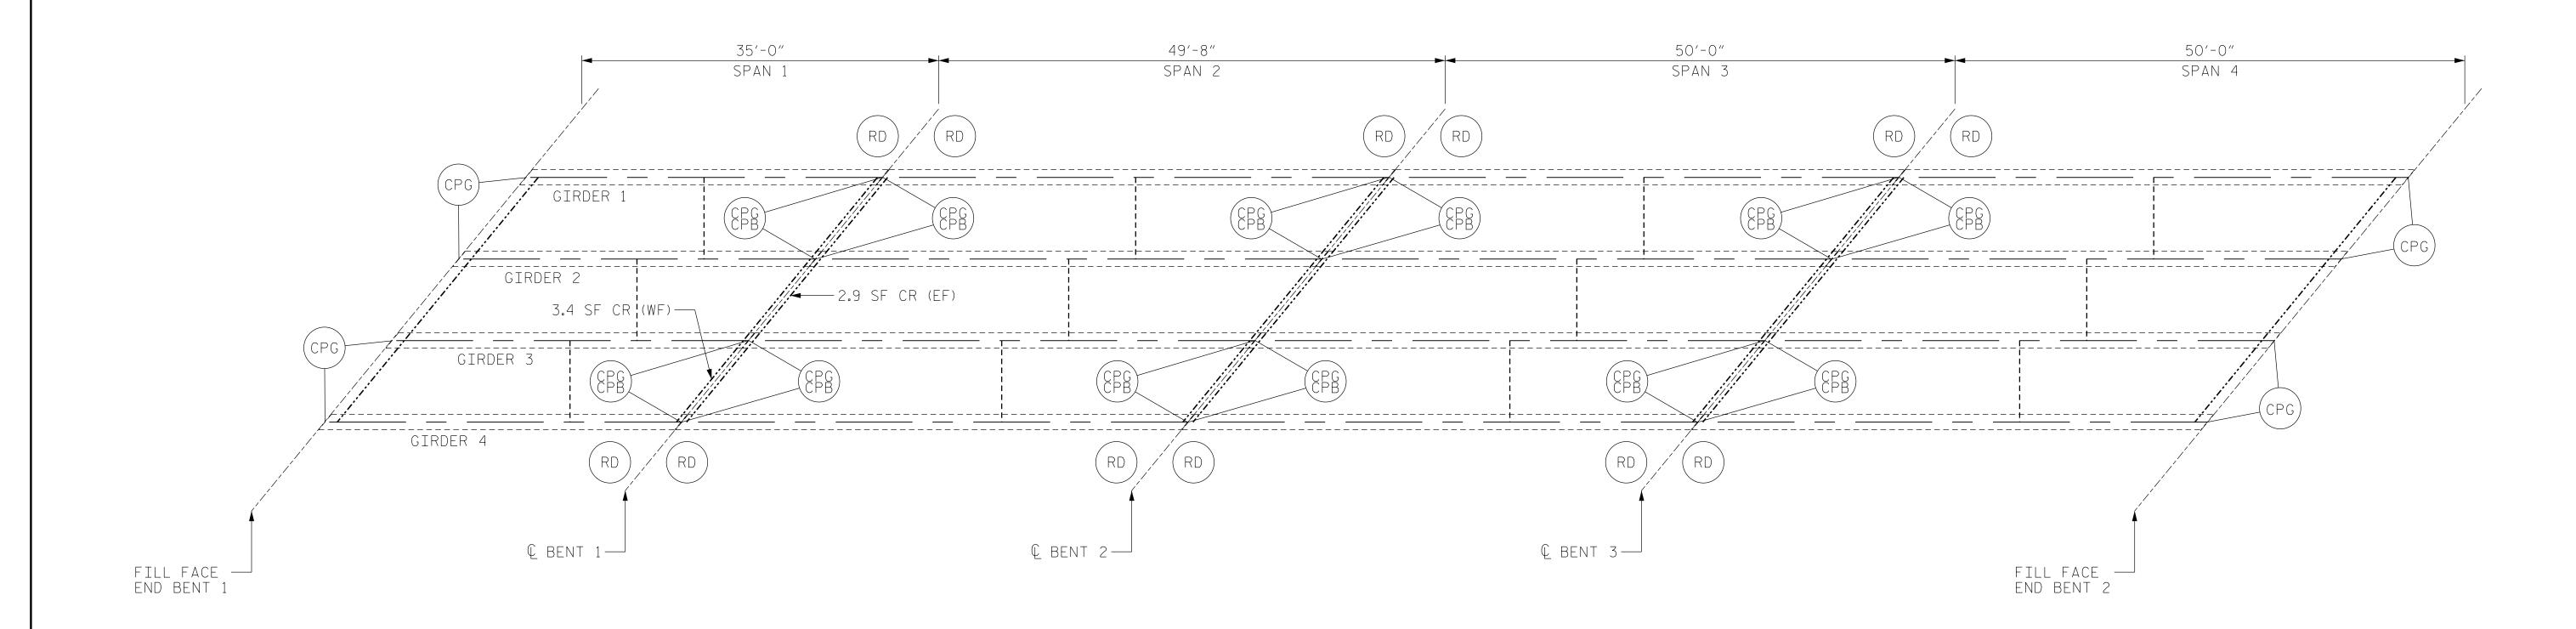

## NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE TABLE ABOVE.

FOR CONCRETE AND SHOTCRETE REPAIRS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

PRIOR TO CLEANING AND PAINTING STEEL ELEMENTS, REMOVE EXTERIOR DIAPHRAGMS AND A PORTION OF THE INTERIOR DIAPHRAGMS SO AS TO ALLOW FOR CLEANING OF EXISTING STEEL ELEMENTS PRIOR TO PAINTING. SEE DETAILS "RD" AND "RRD".

AFTER THE REMOVAL OF EXTERIOR END DIAPHRAGMS, CUT ANY EXPOSED REBAR FLUSH WITH THE DECK. COAT THE REMAINING EXPOSED REBAR WITH EPOXY. EPOXY WILL BE INCIDENTAL TO THE PAY ITEM FOR "CONCRETE REPAIRS".

FOR DETAILS OF CLEANING AND PAINTING GIRDER ENDS (CPG), REMOVE END DIAPHRAGMS AT OVERHANG (RD), AND REMOVE AND REPAIR DIAPHRAGM ENDS (RRD), SEE "MISCELLANEOUS REPAIRS" SHEET.

FOR CLEANING & PAINTING EXISTING BEARINGS WITH HRSCA, SEE SPECIAL PROVISIONS.

FOR ZONE PAINTING OF EXISTING STRUCTURE, SEE SPECIAL PROVISIONS.

| DRAWN BY :      | ALLEN J.MCSWAIN                  | DATE : <u>01/2022</u>  |
|-----------------|----------------------------------|------------------------|
| CHECKED BY :    | JACOB H.DUKE                     | DATE : <u>01/2022</u>  |
| DESIGN ENGINEER | OF RECORD: <u>DIEGO A.AGUIRR</u> | E_DATE: <u>01/2022</u> |

PLAN

PROJECT NO. I-5915B IREDELL COUNTY

480065 BRIDGE NO. \_



STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH

SUPERSTRUCTURE REPAIRS

|   | <b>KISINGER CAMPO</b>            |                         |
|---|----------------------------------|-------------------------|
| N | & ASSOCIATES                     |                         |
| Ľ | 301 FAYETTEVILLE ST., SUITE 1500 | DOCUMENT NOT CONSIDERED |
| ٦ | RALEIGH, NC 27601 (919) 882-7839 | FINAL UNLESS ALL        |
| G | NC FIRM LICENSE: C-1506          | STGNATURES COMPLETED    |
| 4 | 1 10 1 11011 21021 321 6 1300    | SIGNATURES COMILETED    |

| GER CAMPO  |     | SHEET NO. |       |     |     |       |                 |
|--|-----|-----------|-------|-----|-----|-------|-----------------|
| SOCIATES   | NO. | BY:       | DATE: | NO. | BY: | DATE: | S9-7            |
| TEVILLE ST., SUITE 1500<br>NC 27601 (919) 882-7839 | 1   |           |       | 3   |     |       | TOTAL<br>SHEETS |
| ICENSE: C-1506                                     | 2   |           |       | 4   |     |       | 12              |