MANAGEMENT STRATEGIES

- I-40 EB/WB, ONE DIRECTION AT A TIME, FOR TWO (2) CLOSURES IN EACH DIRECTION, TO BE CLOSED AND DETOURED OFF-SITE FOR WEEKEND CLOSURES
- MAINTAIN I-40 TRAFFIC THROUGH LANE CLOSURES FOR FINAL RESURFACING(OPEN GRADE FRICTION COURSE)
- ASPHALT BRIDGES ALONG I-40 MUST BE COMPLETED UNDER WEEKEND CLOSURES
- RAMPS AND LOOPS MAY BE CLOSED AND TRAFFIC DETOURED OFF-SITE
- PROVIDE THIRTY (30) CALENDAR DAYS NOTICE TO THE ENGINEER, GUILFORD COUNTY EMERGENCY SERVICES, AND GUILFORD COUNTY SCHOOL OFFICIALS PRIOR TO ROAD CLOSURE

PROJ. REFERENCE NO.	SHEET NO.
I - 5955	TMP-1C

PHASING

AREA 1, 2, AND 3 MAY BE COMPLETED IN ANY ORDER, BUT SHALL NEVER BE WORKED ON CONCURRENTLY.

AREA 1

STEP 1: USING RSD 1101.01 SHEET 1 OF 3, INTERSTATE RESURFACING SPECIAL PROVISION, AND TMP-4, PLACE ADVANCE WARNING SIGNS ALONG I-40 EB AND I-85B NB AND RAMPS WHERE NECESSARY.

WORK IN A CONTINUOUS MANNER TO COMPLETE THE WORK OF AREA 1 STEP 2 AND STEP 3 FROM FRIDAY AT 9:00 P.M. TO THE FOLLOWING MONDAY AT 6:00 A.M. (57 HOURS). SEE INTERMEDIATE CONTRACT TIME AND LIQUIDATED DAMAGES.

- STEP 2: PLACE DEVICES AS SHOWN ON THE INTERSTATE RESURFACING SPECIAL PROVISION AND TMP-5-22 TO CLOSE I-40 EB. ONCE ALL DEVICES ARE IN PLACE, BEGIN ALL PAVEMENT CONSTRUCTION ASSOCIATED WITH I-40 EB. COMPLETE ASPHALT BRIDGES ALONG I-40 EB.
- STEP 3: REMOVE ALL WORKZONE DEVICES ASSOCIATED WITH I-40 EB PAVEMENT CONSTRUCTION AND REOPEN I-40 EB TO TRAFFIC.

AREA 2

STEP 1: USING RSD 1101.01 SHEET 1 OF 3, INTERSTATE RESURFACING SPECIAL PROVISION, AND TMP-23, PLACE ADVANCE WARNING SIGNS ALONG I-40 WB AND I-85B AND RAMPS WHERE NECESSARY.

WORK IN A CONTINUOUS MANNER TO COMPLETE THE WORK OF AREA 2 STEP 2 AND STEP 3 FROM FRIDAY AT 9:00 P.M. TO THE FOLLOWING MONDAY AT 6:00 A.M. (57 HOURS). SEE INTERMEDIATE CONTRACT TIME AND LIQUIDATED DAMAGES.

- STEP 2: PLACE DEVICES AS SHOWN ON THE INTERSTATE RESURFACING SPECIAL PROVISION AND TMP-24-35 TO CLOSE I-40 WB. ONCE ALL DEVICES ARE IN PLACE, BEGIN ALL PAVEMENT CONSTRUCTION ASSOCIATED WITH I-40 WB. COMPLETE ASPHALT BRIDGES ALONG I-40 WB.
- STEP 3: REMOVE ALL WORKZONE DEVICES ASSOCIATED WITH I-40 WB PAVEMENT CONSTRUCTION AND REOPEN I-40 WB TO TRAFFIC.


AREA 3


STEP 1: USING RSD. 1101.02 SHEETS 4, 8, 9, AND 10 OF 14, INTERSTATE RESURFACING SPECIAL PROVISION, TMP-2 AND TMP-2A COMPLETE ALL REMAINING PAVEMENT CONSTRUCTION AND PLACE THE FINAL LAYER OF SURFACE COURSE AND FINAL PAVEMENT MARKINGS.

NOTE: USE OFF-SITE DETOURS AS SHOWN ON TMP-36-38 TO CONSTRUCT MAP AREAS IF WORK WAS NOT COMPLETED UNDER PREVIOUS CLOSURES.

STEP 2: ONCE ALL CONSTRUCTION IS COMPLETED, REMOVE ALL WORK ZONE TRAFFIC CONTROL DEVICES AND REOPEN TO TRAFFIC.



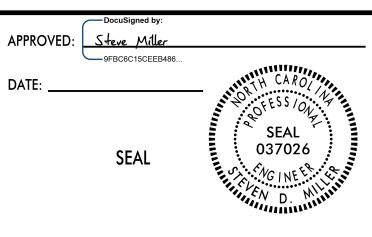

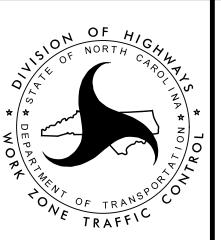

TRANSPORTATION OPERATIONS PLAN