QUANTITIES IN TABLE REPRESENT ESTIMATED VALUES OF CLASS II SURFACE PREPARATION AND CONCRETE DECK REPAIR FOR POLYMER OVERLAY AFTER REMOVAL OF UNSOUND CONCRETE (MIN. 2" CLEAR TO SAW CUT). SEE OVERLAY SURFACE PREPARATION FOR POLYMER CONCRETE SPECIAL PROVISION.




CLASS II SURFACE PREPARATION

UNDERSIDE REPAIR

## AS-BUILT REPAIR QUANTITY TABLE TOP OF DECK REPAIRS UNDERSIDE OF DECK REPAIRS

TOP OF DECK REPAIRS		UNDERSIDE OF DECK REPAIRS												
	SPAN B-D		SPAN B				SPAN C				SPAN D			
	ESTIMATE ACTUAL		EST	IMATE ACTUAL		ESTIMATE		ACTUAL		ESTIMATE		ACTUAL		
SCARIFYING BRIDGE DECK	824.0 SY	SHOTCRETE REPAIRS	AREA	VOLUME	AREA	VOLUME	AREA	VOLUME	AREA	VOLUME	AREA	VOLUME	AREA	VOLUME
SHOTBLASTING OF BRIDGE DECK	824.0 SY		SF	CF	SF	CF	SF	CF	SF	CF	SF	CF	SF	CF
CLASS II SURFACE PREPARATION	4.9 SY	UNDERSIDE OF DECK	0.0	0.0			0.0	0.0			0.0	0.0		
EPOXY RESIN INJECTION	0.0 LF	OVERHANG DIAPHRAGMS	0.0	0.0			0.0	0.0			0.0	0.0		
GROOVING BRIDGE FLOORS	6819.2 SF	UNDERSIDE OF OVERHANG	0.0	0.0			0.0	0.0			0.0	0.0		
CONCRETE DECK REPAIR FOR PC OVERLAY	4.9 SY	INTERIOR DIAPHRAGMS	0.0	0.0			0.0	0.0			0.0	0.0		
POLYMER CONCRETE MATERIALS	22.9 CY	1												
PLACING AND FINISHING POLYMER CONCRETE OVERLAY	824.0 SY	]	EST	TIMATE   ACTUAL			ESTIMATE		AC <sup>-</sup>	TUAL	ESTIMATE		ACTUAL	
		UNDERSIDE EPOXY RESIN INJECTION	0.0	0.0 LF			0.0	LF			0.0 LF			
SURFACE PREPARATION FOR SILANE BARRIER RAIL TREATMENT	1366.2 SF													
SILANE BARRIER RAIL TREATMENT	1366.2 SF	]												

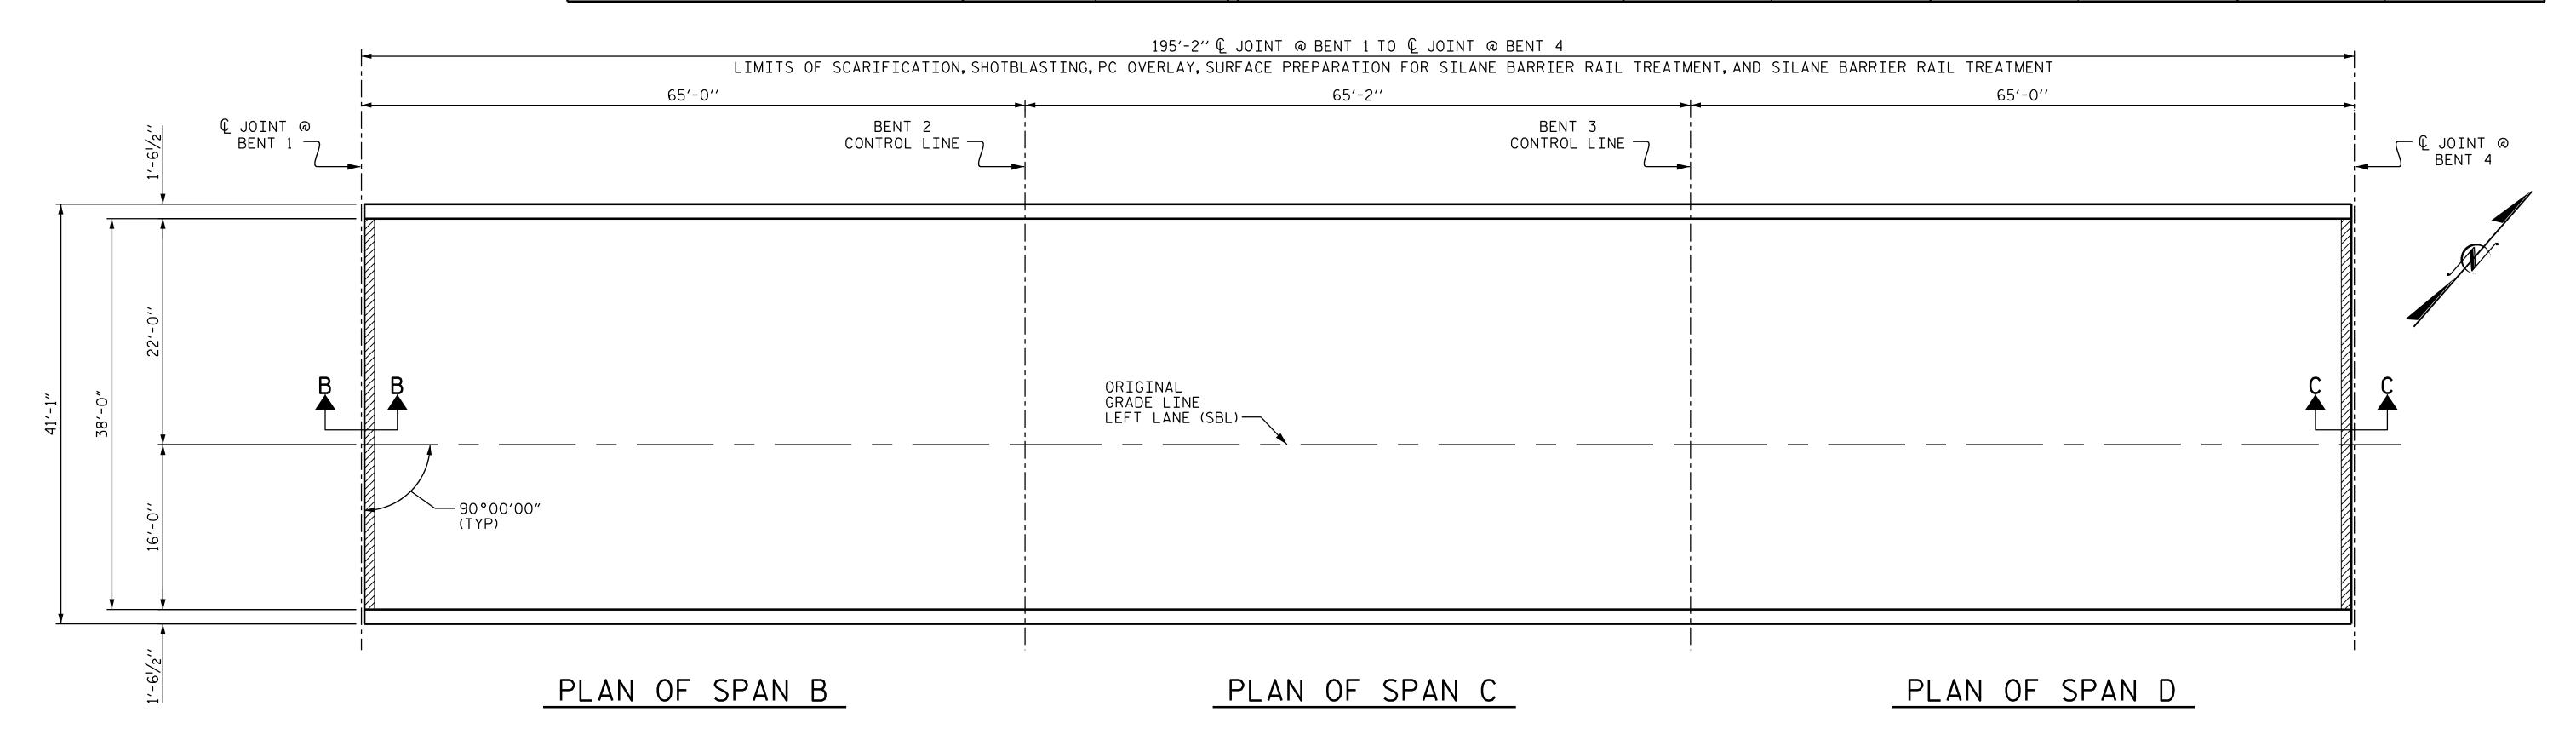

NOTES

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE AS-BUILT REPAIR QUANTITY TABLE.

FOR SECTIONS B-B AND C-C, SEE "JOINT REPAIR DETAILS" SHEET.

PROJECT NO. 15BPR.130

CHATHAM COUNTY

BRIDGE NO. 180007

SHEET 2 OF 6

DEPARTMENT OF TRANSPORTATION

SUPERSTRUCTURE PLAN OF SPAN B, SPAN C AND SPAN D

LEFT LANE (SBL)

5430 Wade Park Blvd., Suite 410
Raleigh, NC 27607
Tel. 919-854-0344 Fax. 919-854-0355
NC License No. F-0765

DOCUMENT NOT CONSIDERED 10 SIGNATURES COMPLETED 2

REVISIONS

BY: DATE: NO. BY: DATE: S-8

TOTAL SHEETS

156

DRAWN BY: T.MAZARURA DATE: 1/2023
CHECKED BY: D.GLADDEN DATE: 2/2023