
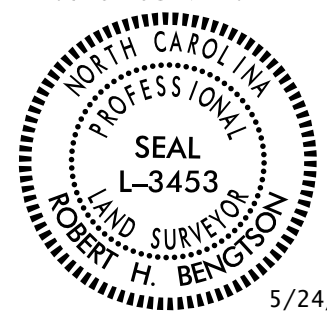


RIGHT OF WAY CONTROL SHEET


PROJECT REFERENCE NO. BR-0097	SHEET NO. RW03E-1
Location and Surveys	
 <small>Dewberry Engineers Inc. 551 PINEY FOREST ROAD DANVILLE, VA 24040 PHONE: 434.797.4497 FAX: 434.797.4341 NCBELS #F-0929</small>	
PROJECT SURVEYOR  <small>5/24/2023</small>	
DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED	

ROW MARKER IRON PIN AND CAP-E

ALIGN	STATION	OFFSET	NORTH	EAST
L	20+45.00	-30.04	981147.7572	1831711.1493
L	20+61.59	-30.00	981146.4247	1831728.3797
L	27+15.23	-30.00	981053.7120	1832378.4311
L	28+51.38	-30.00	981027.0567	1832511.9393
L	32+55.70	-50.00	980967.5078	1832912.3527
L	37+08.12	-30.00	980859.3164	1833352.1000
L	42+96.32	-30.00	980758.5863	1833930.0570
L	42+96.34	-28.50	980757.0953	1833929.8599

NOT SET, HITS IN TREE

I, Robert H. Bengtson, certify that the right of way and permanent easement monumentation for this project shown herein was completed under my direct and responsible charge from an actual survey made under my supervision; that all horizontal closures had a minimum ratio of precision of 1:10,000 (Class A). Field work was performed from 4/25/23 to 5/11/23, and all coordinates are based on NAD83/2011; That this survey was performed to meet the requirements of 21NCAC 56.1600 as applicable.

This 24th day of May, 2023.
 Designed by:

EAT9ETCA3388F1
 Professional Land Surveyor L-3453

ROW MARKER PERMANENT EASEMENT-E

ALIGN	STATION	OFFSET	NORTH	EAST
L	21+65.00	-30.00	981136.5618	1831831.8448
L	21+65.00	-44.00	981150.4865	1831833.2954
L	21+88.00	-44.00	981148.0406	1831856.3374
L	21+88.00	-30.00	981134.1217	1831854.8326
L	33+23.36	-61.86	980965.8893	1832981.0242
L	33+34.40	-78.66	980980.2087	1832995.1410
L	33+54.73	-45.62	980943.8252	1833008.6114
L	33+57.92	-66.49	980963.6679	1833015.8223
L	33+72.99	-71.88	980966.0041	1833031.6598
L	33+82.83	-44.38	980937.1058	1833035.9227
L	34+06.23	74.97	980815.4885	1833035.4999
L	34+11.75	88.15	980801.4772	1833038.3390
L	34+28.18	107.92	980778.8773	1833050.5741
L	34+38.36	72.88	980811.2434	1833067.4184
L	34+45.72	98.32	980784.8562	1833069.6594
L	35+25.00	75.00	980792.2009	1833151.9688
L	35+25.00	67.25	980799.8001	1833153.4860
L	35+55.00	65.30	980795.8375	1833183.2870
L	35+55.00	75.00	980786.3272	1833181.3882
L	36+96.77	-35.52	980866.9477	1833342.0506
L	36+97.10	-30.49	980861.9518	1833341.3884
L	36+99.87	-64.66	980894.9171	1833350.8019
L	37+19.90	-65.96	980892.2890	1833370.6285
L	37+26.76	-37.46	980863.0054	1833371.7905
L	37+27.24	-30.00	980855.5967	1833370.8084

NOT SET, HITS IN TREE

NOTES:

1. IF FURTHER INFORMATION REGARDING PROJECT CONTROL IS NEEDED PLEASE CONTACT THE LOCATION AND SURVEYS UNIT.
2. PROJECT CONTROL WAS ESTABLISHED USING GNSS, THE GLOBAL NAVIGATION SATELLITE SYSTEM.
3. RIGHT OF WAY MONUMENTATION ESTABLISHED 4/25/23 TO 5/11/23 .

REVISIONS