


BM 5
 CHISELED SQUARE ON NORTH EAST
 CORNER OF CONCRETE WELL HOUSE
 IN BLUE BAY RESTAURANT PARKING LOT
 -L2- STA 170+82.30, 219.84 LT. =
 BL STA 167+80.80, 169.23 LT. =
 EL. 742.68

PI = 174+50.00
 EL = 747.65

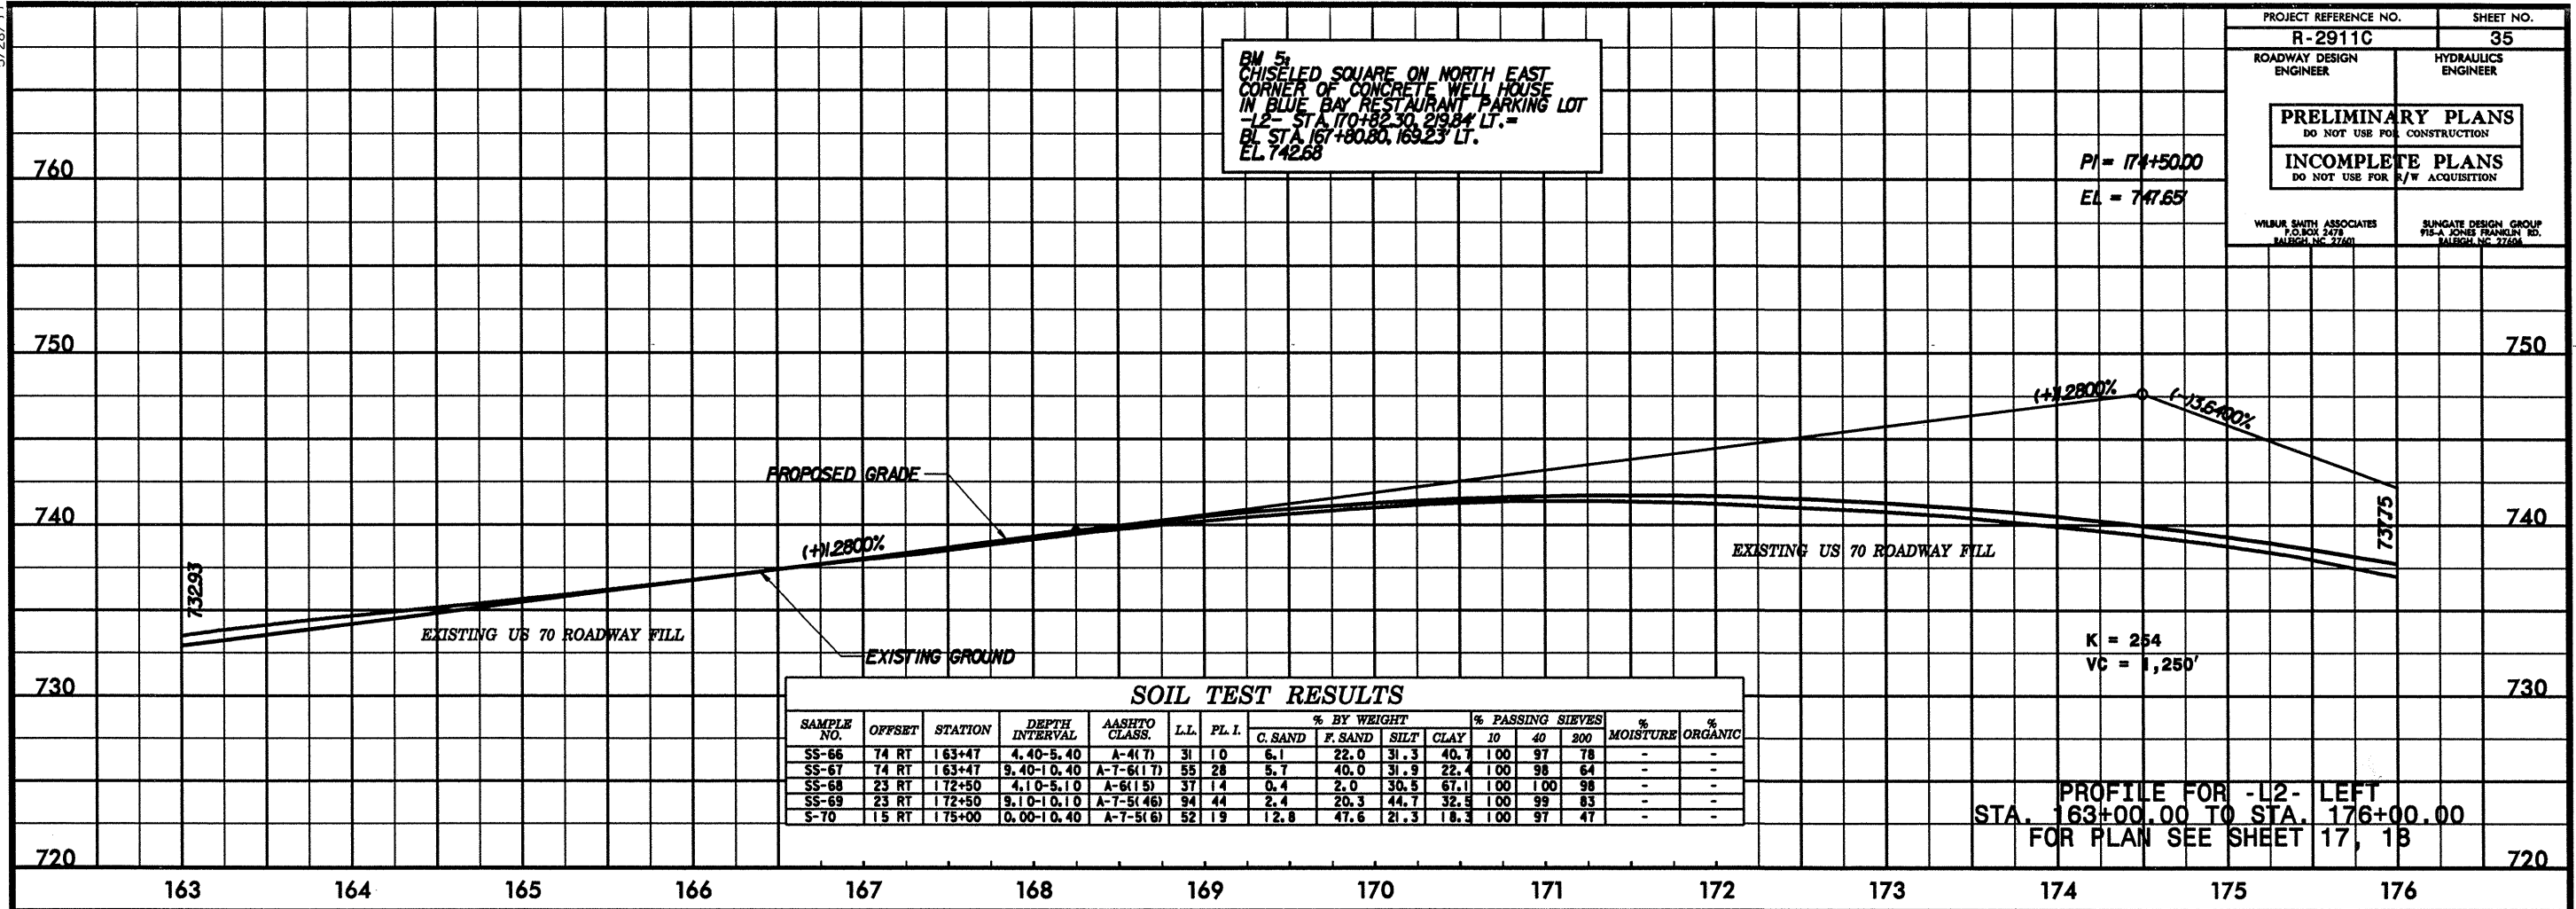


SOIL TEST RESULTS

SAMPLE NO.	OFFSET	STATION	DEPTH INTERVAL	AASHTO CLASS.	L.L.	P.L.I.	% BY WEIGHT				% PASSING SIEVES			% MOISTURE	% ORGANIC
							G. SAND	F. SAND	SILT	CLAY	10	40	200		
SS-66	74 RT	163+47	4.40-5.40	A-4(17)	31	10	6.1	22.0	31.3	40.7	100	97	78	-	-
SS-67	74 RT	163+47	9.40-10.40	A-7(617)	55	28	5.7	40.0	31.9	22.4	100	98	64	-	-
SS-68	23 RT	172+50	4.10-5.10	A-6(15)	37	14	0.4	2.0	30.5	67.1	100	100	98	-	-
SS-69	23 RT	172+50	9.10-10.10	A-7(546)	94	44	2.4	20.3	44.7	32.5	100	99	83	-	-
S-70	15 RT	175+00	0.00-10.40	A-7(516)	52	19	12.8	47.6	21.3	18.3	100	97	47	-	-

PROFILE FOR -L2- LEFT
 STA. 163+00.00 TO STA. 176+00.00
 FOR PLAN SEE SHEET 17, 18

PI = 174+50.00
 EL = 747.66

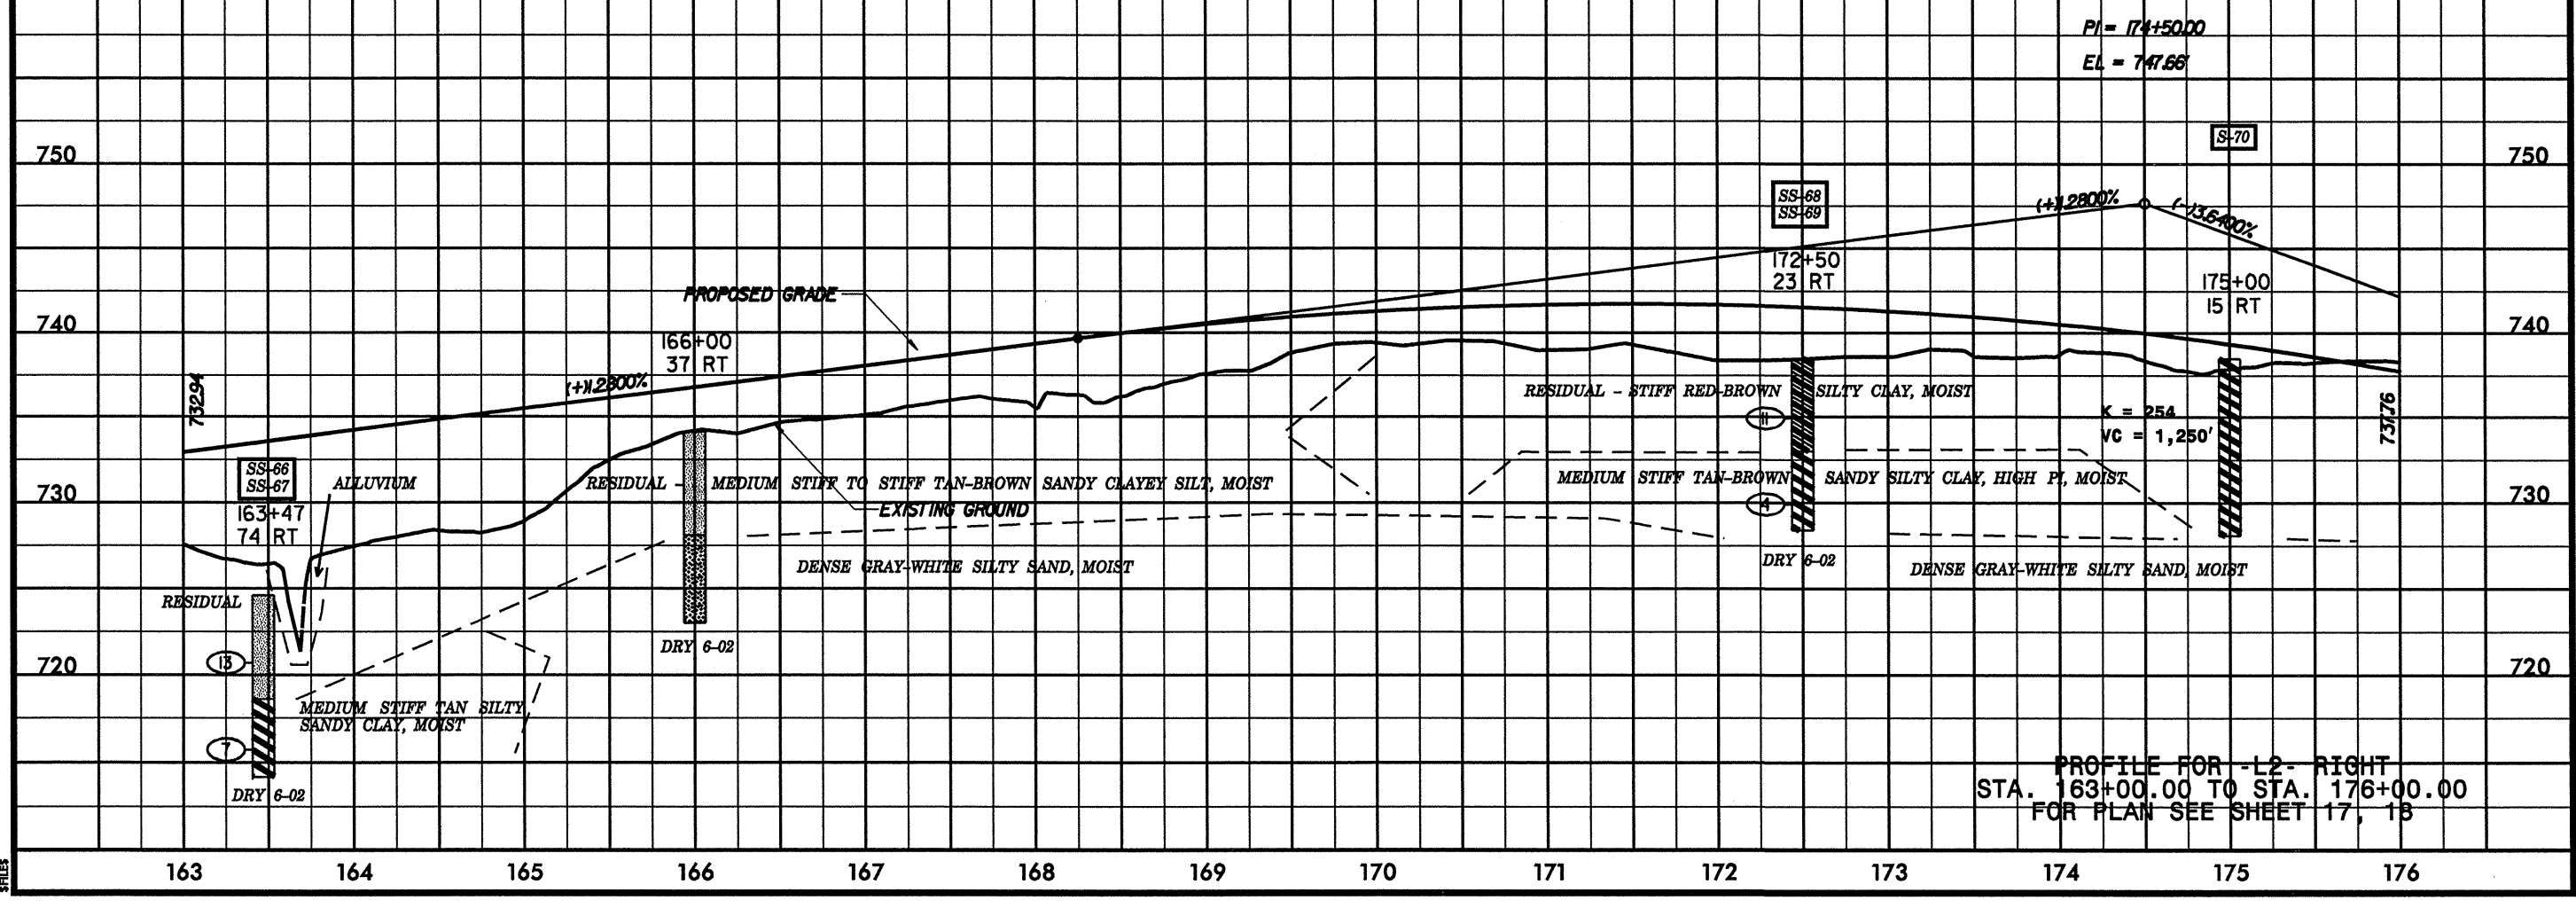

PROFILE FOR -L2- RIGHT
 STA. 163+00.00 TO STA. 176+00.00
 FOR PLAN SEE SHEET 17, 18

5/28/99 DATE STAKES SET