



DATE: 8/28/2018 TIME: 2:47:25 PM
USER: N:\SFAL3\p00\ncasomel.com\dwg\Proj\beirs\60336253\900_Work\910_CAD\70_NC00T_T\TIF\Structures\04_Drawings\401_259_B4974_SML\CR624.dgn
DGN:

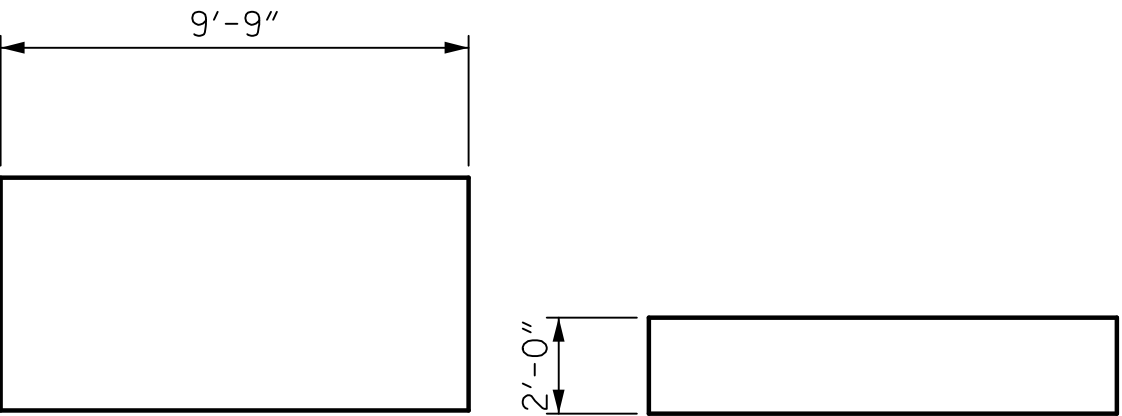


WEST FACE TOP
9'-9"




SOFFIT EAST FACE

BENT 7 STRUT

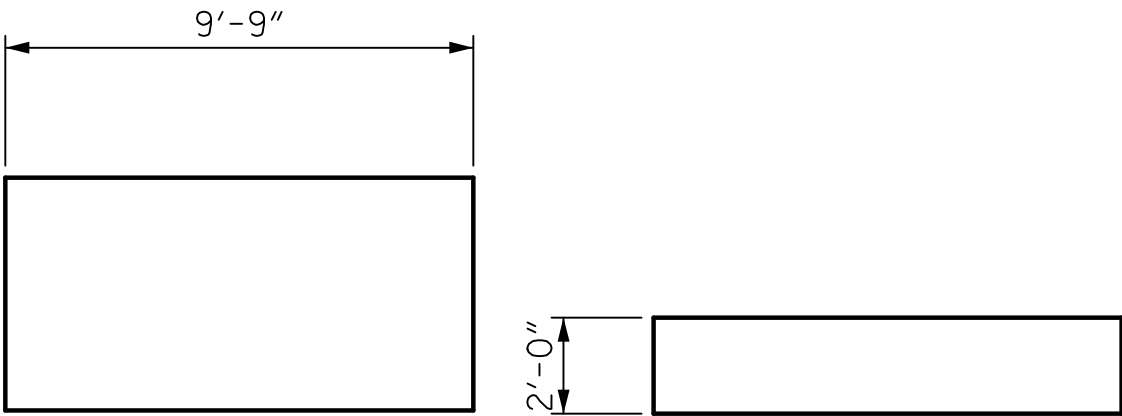


WEST FACE TOP
9'-9"




SOFFIT EAST FACE

BENT 8 STRUT

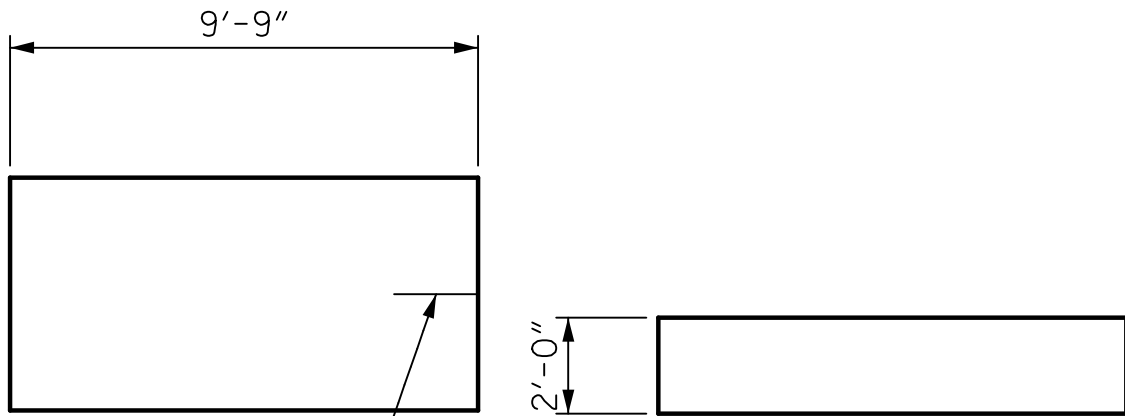


WEST FACE TOP
9'-9"




SOFFIT EAST FACE

BENT 9 STRUT

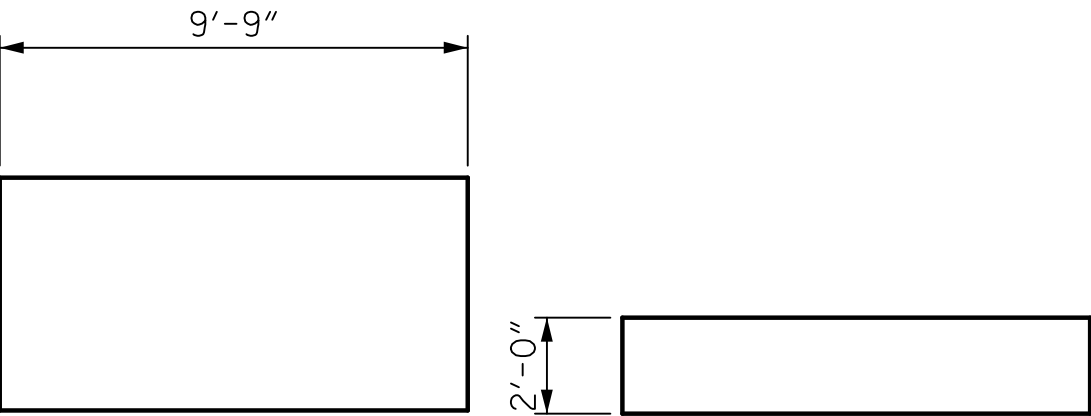

WEST FACE TOP
9'-9"




SOFFIT EAST FACE


BENT 10 STRUT

ARCH SPAN F ARCH RIB STRUT DEFECT CATALOG

LOCATION	FACE	DEFECT TYPE	NO. OF DEFECTS	LENGTH	WIDTH	DEPTH	PROPOSED REPAIR
SPANDREL BENT 4	EAST FACE	DELAMINATION	-	28"	31"	-	CONCRETE REPAIR
SPANDREL BENT 4	EAST FACE	DELAMINATION	-	15"	9"	-	CONCRETE REPAIR
SPANDREL BENT 5	WEST FACE	CRACK	-	16"	1/8"	-	NONE
SPANDREL BENT 8	EAST FACE	CRACK	-	21"	1/16"	-	NONE
SPANDREL BENT 9	WEST FACE	CRACK	-	21"	1/16"	-	NONE

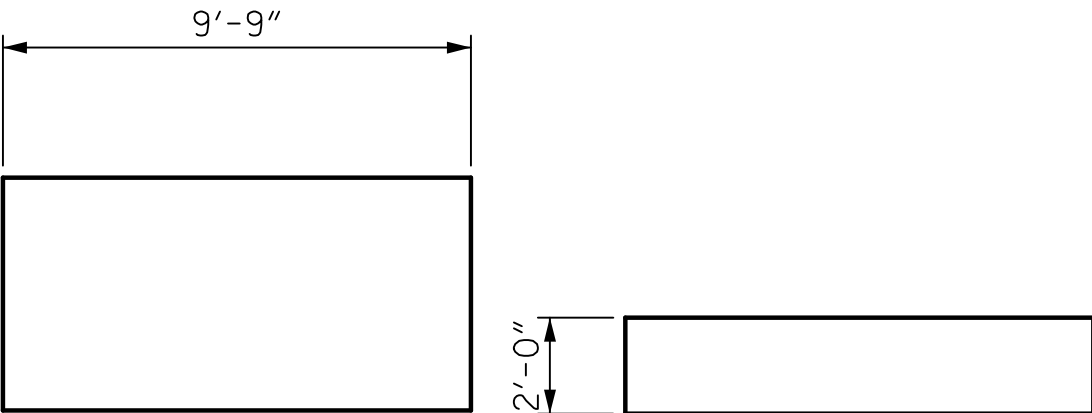

WEST FACE TOP
9'-9"



SOFFIT EAST FACE

BENT 11 STRUT

DRAWN BY : T. STUMP	DATE : 2/2018
CHECKED BY : J. SLOAN	DATE : 3/2018
DESIGNED BY : T. STUMP	DATE : 2/2018
DESIGN CHECKED BY : J. SLOAN	DATE : 3/2018

DOCUMENT NOT CONSIDERED
FINAL UNLESS ALL
SIGNATURES COMPLETED

AECOM
AECOM TECHNICAL SERVICES, INC.
701 CORPORATE CENTER DRIVE, SUITE 475
RALEIGH, NC 27607
(919) 854-6200 www.aecom.com
AECOM License No. F-0342

PROJECT NO. B-4974
STANLY/MONTGOMERY COUNTY
STATION: 339+86.39 -L-

SHEET 6 OF 6

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION
RALEIGH
REHABILITATION
ARCH SPAN F DEFECTS
ARCH RIB STRUTS (2)

REVISIONS						SHEET NO. S-129
NO.	BY:	DATE:	NO.	BY:	DATE:	
1			3			TOTAL SHEETS 148
2			4			