

REFERENCE: BR-0096

PROJECT: 67096.1.1

CONTENTS

SHEET NO.	DESCRIPTION
1	TITLE SHEET
2	LEGEND (SOIL & ROCK)
3	SITE PLAN
4-5	CROSS SECTION(S)
6-7	BORE LOG(S)
8	SOIL TEST RESULT(S)
9	SITE PHOTOGRAPH(S)

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION
DIVISION OF HIGHWAYS
GEOTECHNICAL ENGINEERING UNIT

STRUCTURE
SUBSURFACE INVESTIGATION

COUNTY ROCKINGHAM
SITE DESCRIPTION REPLACE BRIDGE 780176 ON
SR 1700 (FISHER HILL RD.) OVER NC14/NC87

STATE	STATE PROJECT REFERENCE NO.	SHEET NO.	TOTAL SHEETS
N.C.	BR-0096	1	

CAUTION NOTICE

THE SUBSURFACE INFORMATION AND THE SUBSURFACE INVESTIGATION ON WHICH IT IS BASED WERE MADE FOR THE PURPOSE OF STUDY, PLANNING AND DESIGN, AND NOT FOR CONSTRUCTION OR PAY PURPOSES. THE VARIOUS FIELD BORING LOGS, ROCK CORES AND SOIL TEST DATA AVAILABLE MAY BE REVIEWED OR INSPECTED IN RALEIGH BY CONTACTING THE N. C. DEPARTMENT OF TRANSPORTATION, GEOTECHNICAL ENGINEERING UNIT AT (919) 707-6850. THE SUBSURFACE PLANS AND REPORTS, FIELD BORING LOGS, ROCK CORES AND SOIL TEST DATA ARE NOT PART OF THE CONTRACT.

GENERAL SOIL AND ROCK STRATA DESCRIPTIONS AND INDICATED BOUNDARIES ARE BASED ON A GEOTECHNICAL INTERPRETATION OF ALL AVAILABLE SUBSURFACE DATA AND MAY NOT NECESSARILY REFLECT THE ACTUAL SUBSURFACE CONDITIONS BETWEEN BORINGS OR BETWEEN SAMPLED STRATA WITHIN THE BOREHOLE. THE LABORATORY SAMPLE DATA AND THE IN SITU (IN-PLACE) TEST DATA CAN BE RELIED ON ONLY TO THE DEGREE OF RELIABILITY INHERENT IN THE STANDARD TEST METHOD. THE OBSERVED WATER LEVELS OR SOIL MOISTURE CONDITIONS INDICATED IN THE SUBSURFACE INVESTIGATIONS ARE AS RECORDED AT THE TIME OF THE INVESTIGATION. THESE WATER LEVELS OR SOIL MOISTURE CONDITIONS MAY VARY CONSIDERABLY WITH TIME ACCORDING TO CLIMATIC CONDITIONS INCLUDING TEMPERATURES, PRECIPITATION AND WIND, AS WELL AS OTHER NON-CLIMATIC FACTORS.

THE BIDDER OR CONTRACTOR IS CAUTIONED THAT DETAILS SHOWN ON THE SUBSURFACE PLANS ARE PRELIMINARY ONLY AND IN MANY CASES THE FINAL DESIGN DETAILS ARE DIFFERENT. FOR BIDDING AND CONSTRUCTION PURPOSES, REFER TO THE CONSTRUCTION PLANS AND DOCUMENTS FOR FINAL DESIGN INFORMATION ON THIS PROJECT. THE DEPARTMENT DOES NOT WARRANT OR GUARANTEE THE SUFFICIENCY OR ACCURACY OF THE INVESTIGATION MADE, NOR THE INTERPRETATIONS MADE, OR OPINION OF THE DEPARTMENT AS TO THE TYPE OF MATERIALS AND CONDITIONS TO BE ENCOUNTERED. THE BIDDER OR CONTRACTOR IS CAUTIONED TO PERFORM INDEPENDENT SUBSURFACE INVESTIGATIONS AND MAKE INTERPRETATIONS AS NECESSARY TO CONFIRM CONDITIONS ENCOUNTERED ON THE PROJECT. THE CONTRACTOR SHALL HAVE NO CLAIM FOR ADDITIONAL COMPENSATION OR FOR AN EXTENSION OF TIME FOR ANY REASON RESULTING FROM THE ACTUAL CONDITIONS ENCOUNTERED AT THE SITE DIFFERING FROM THOSE INDICATED IN THE SUBSURFACE INFORMATION.

- NOTES:
- THE INFORMATION CONTAINED HEREIN IS NOT IMPLIED OR GUARANTEED BY THE N. C. DEPARTMENT OF TRANSPORTATION AS ACCURATE NOR IS IT CONSIDERED PART OF THE PLANS, SPECIFICATIONS OR CONTRACT FOR THE PROJECT.
 - BY HAVING REQUESTED THIS INFORMATION, THE CONTRACTOR SPECIFICALLY WAIVES ANY CLAIMS FOR INCREASED COMPENSATION OR EXTENSION OF TIME BASED ON DIFFERENCES BETWEEN THE CONDITIONS INDICATED HEREIN AND THE ACTUAL CONDITIONS AT THE PROJECT SITE.

PERSONNEL

C. Ranieri, GIT

W. Shenberger

G. Mahon

INVESTIGATED BY F&R, Inc.

DRAWN BY T.T. Walker

CHECKED BY P. Alton, P.E.

SUBMITTED BY C. Wang, P.E.

DATE May 2023

SINCE




1881®

Prepared in the Office of:

FROEHLING & ROBERTSON, INC.

Engineering Stability Since 1881

310 Hubert Street
Raleigh, North Carolina 27603-2302 | USA
T 919.828.3441 | F 919.828.5751
www.fandr.com

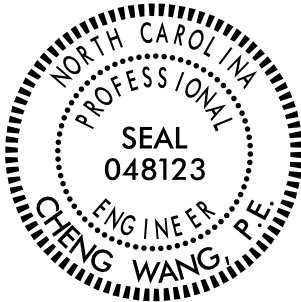


DocuSigned by:
Cheng Wang 05/16/2023
1711224585839493
SIGNATURE DATE


DOCUMENT NOT CONSIDERED FINAL
UNLESS ALL SIGNATURES COMPLETED

NORTH CAROLINA DEPARTMENT OF TRANSPORTATION
DIVISION OF HIGHWAYS
GEOTECHNICAL ENGINEERING UNIT
SUBSURFACE INVESTIGATION
SOIL AND ROCK LEGEND, TERMS, SYMBOLS, AND ABBREVIATIONS


[illegible]

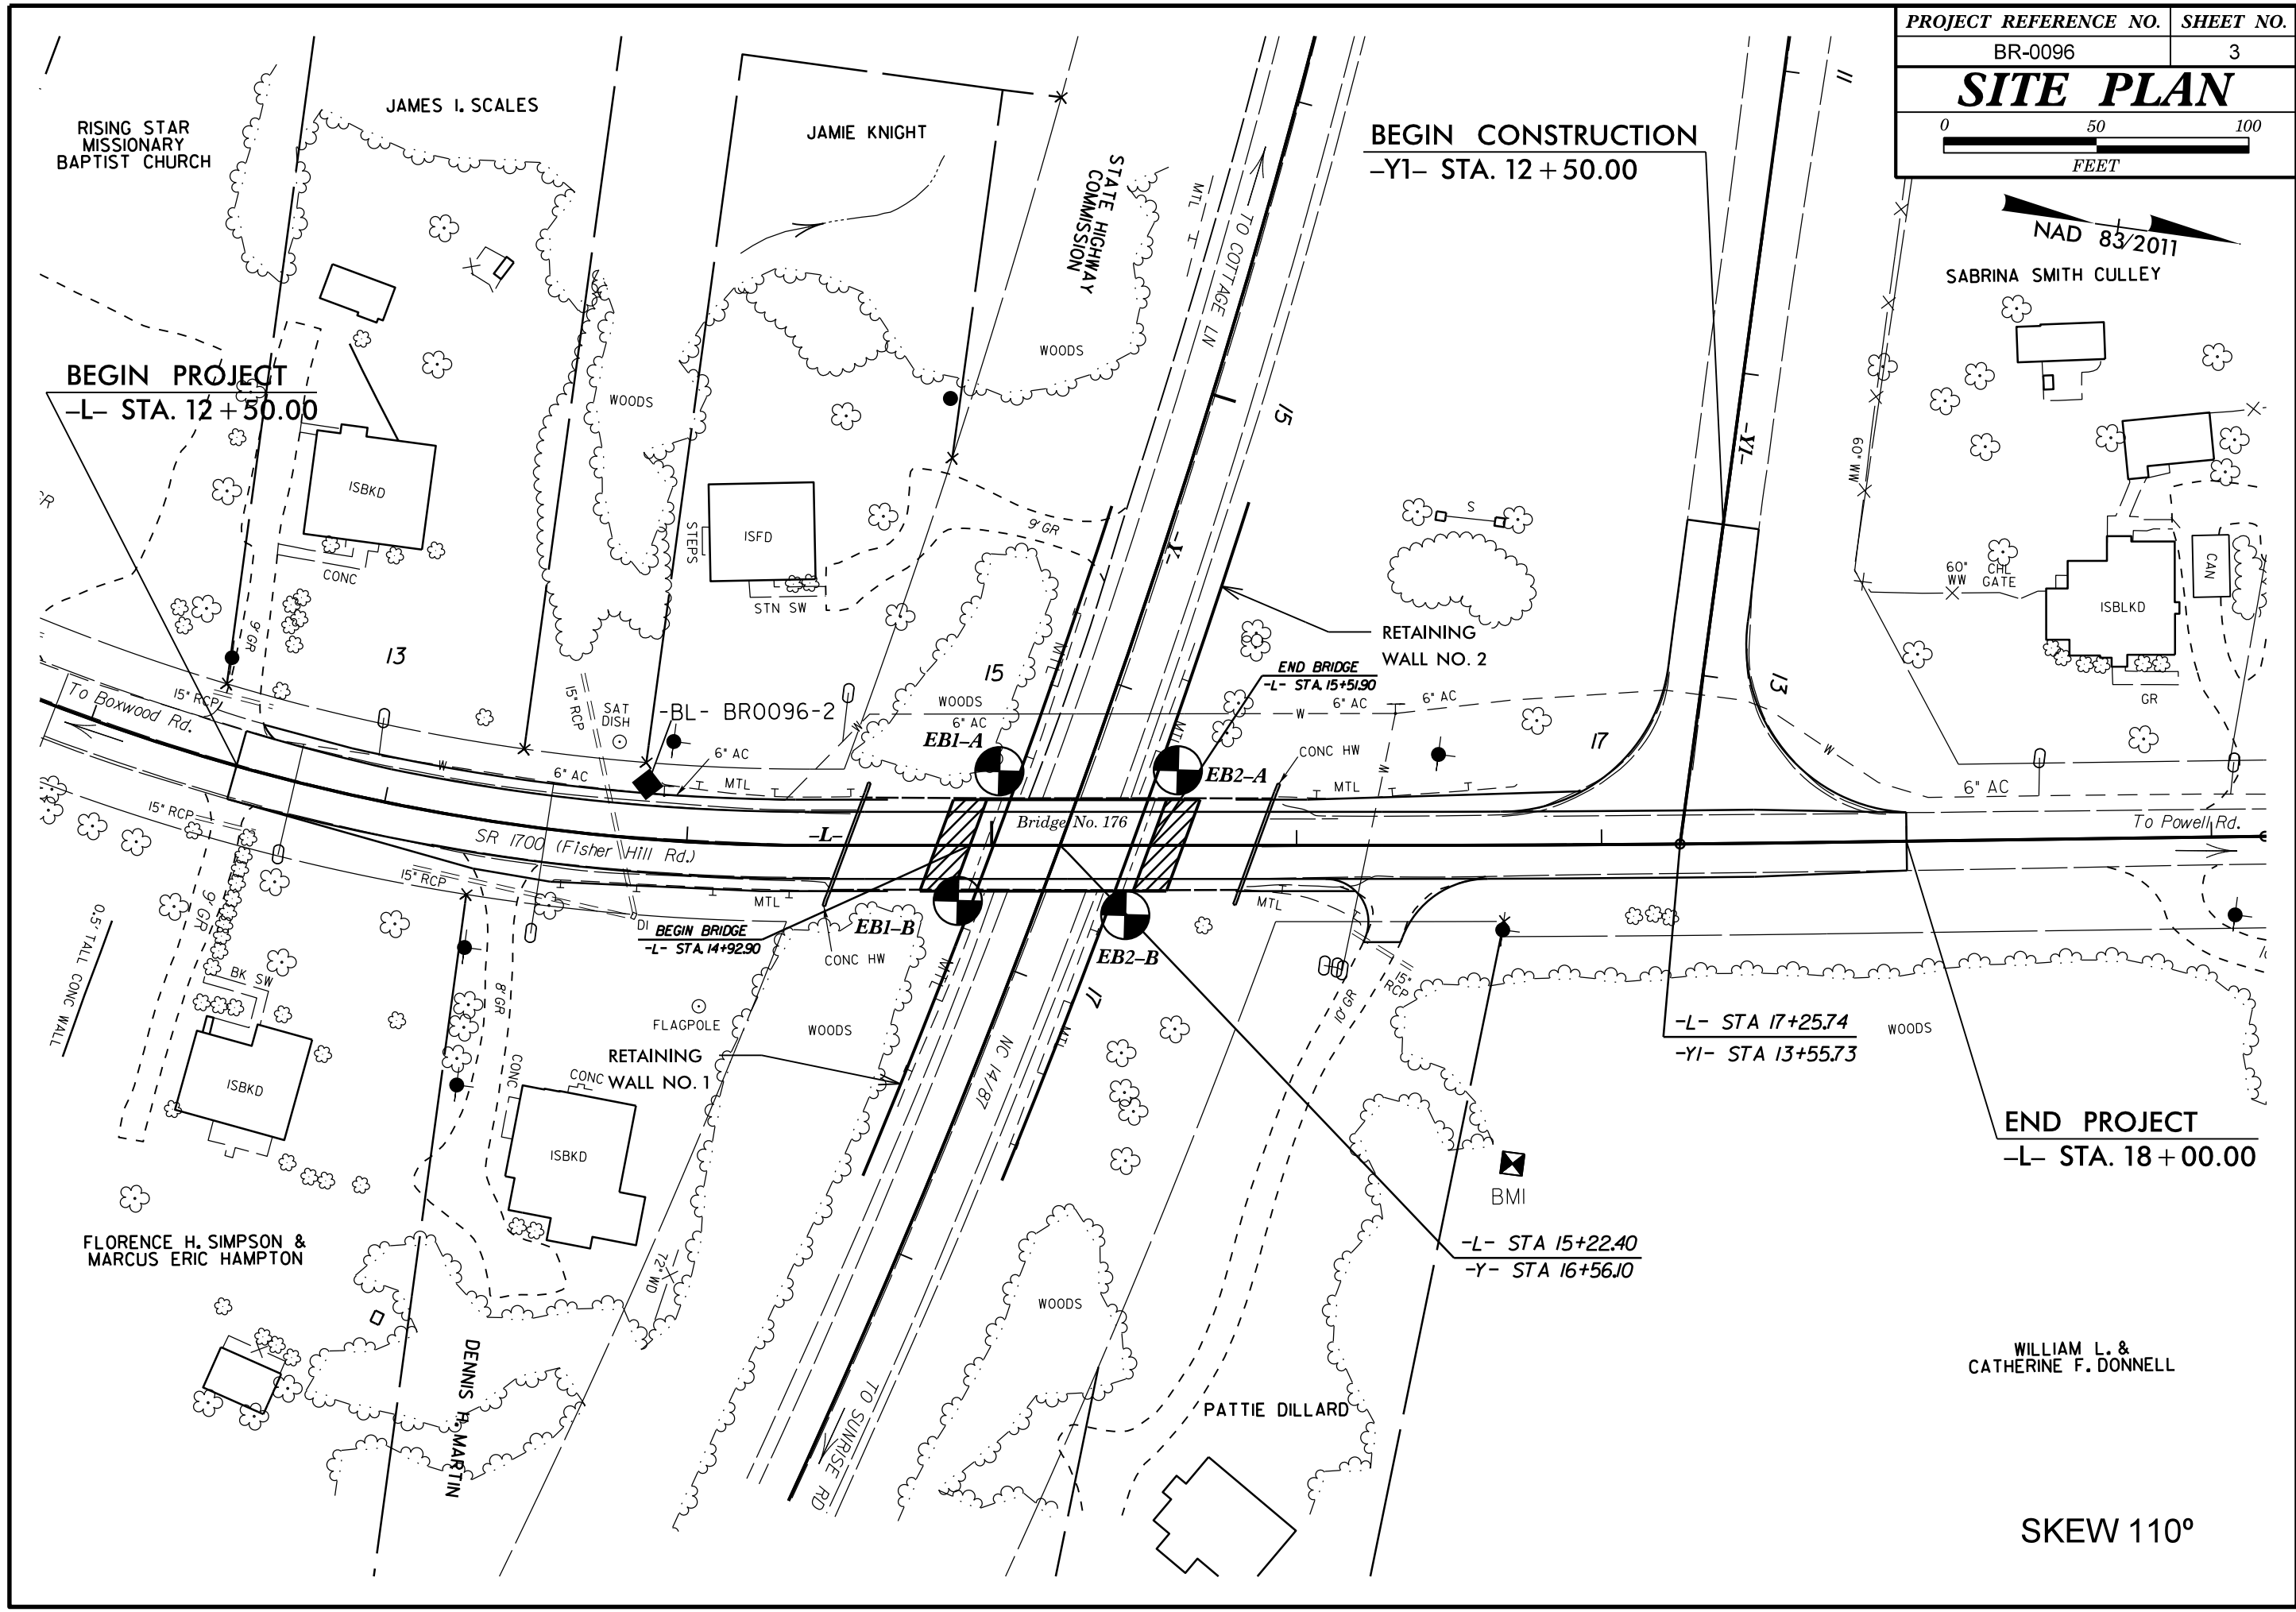

WILLIAM L. &
CATHERINE F. DONNELL

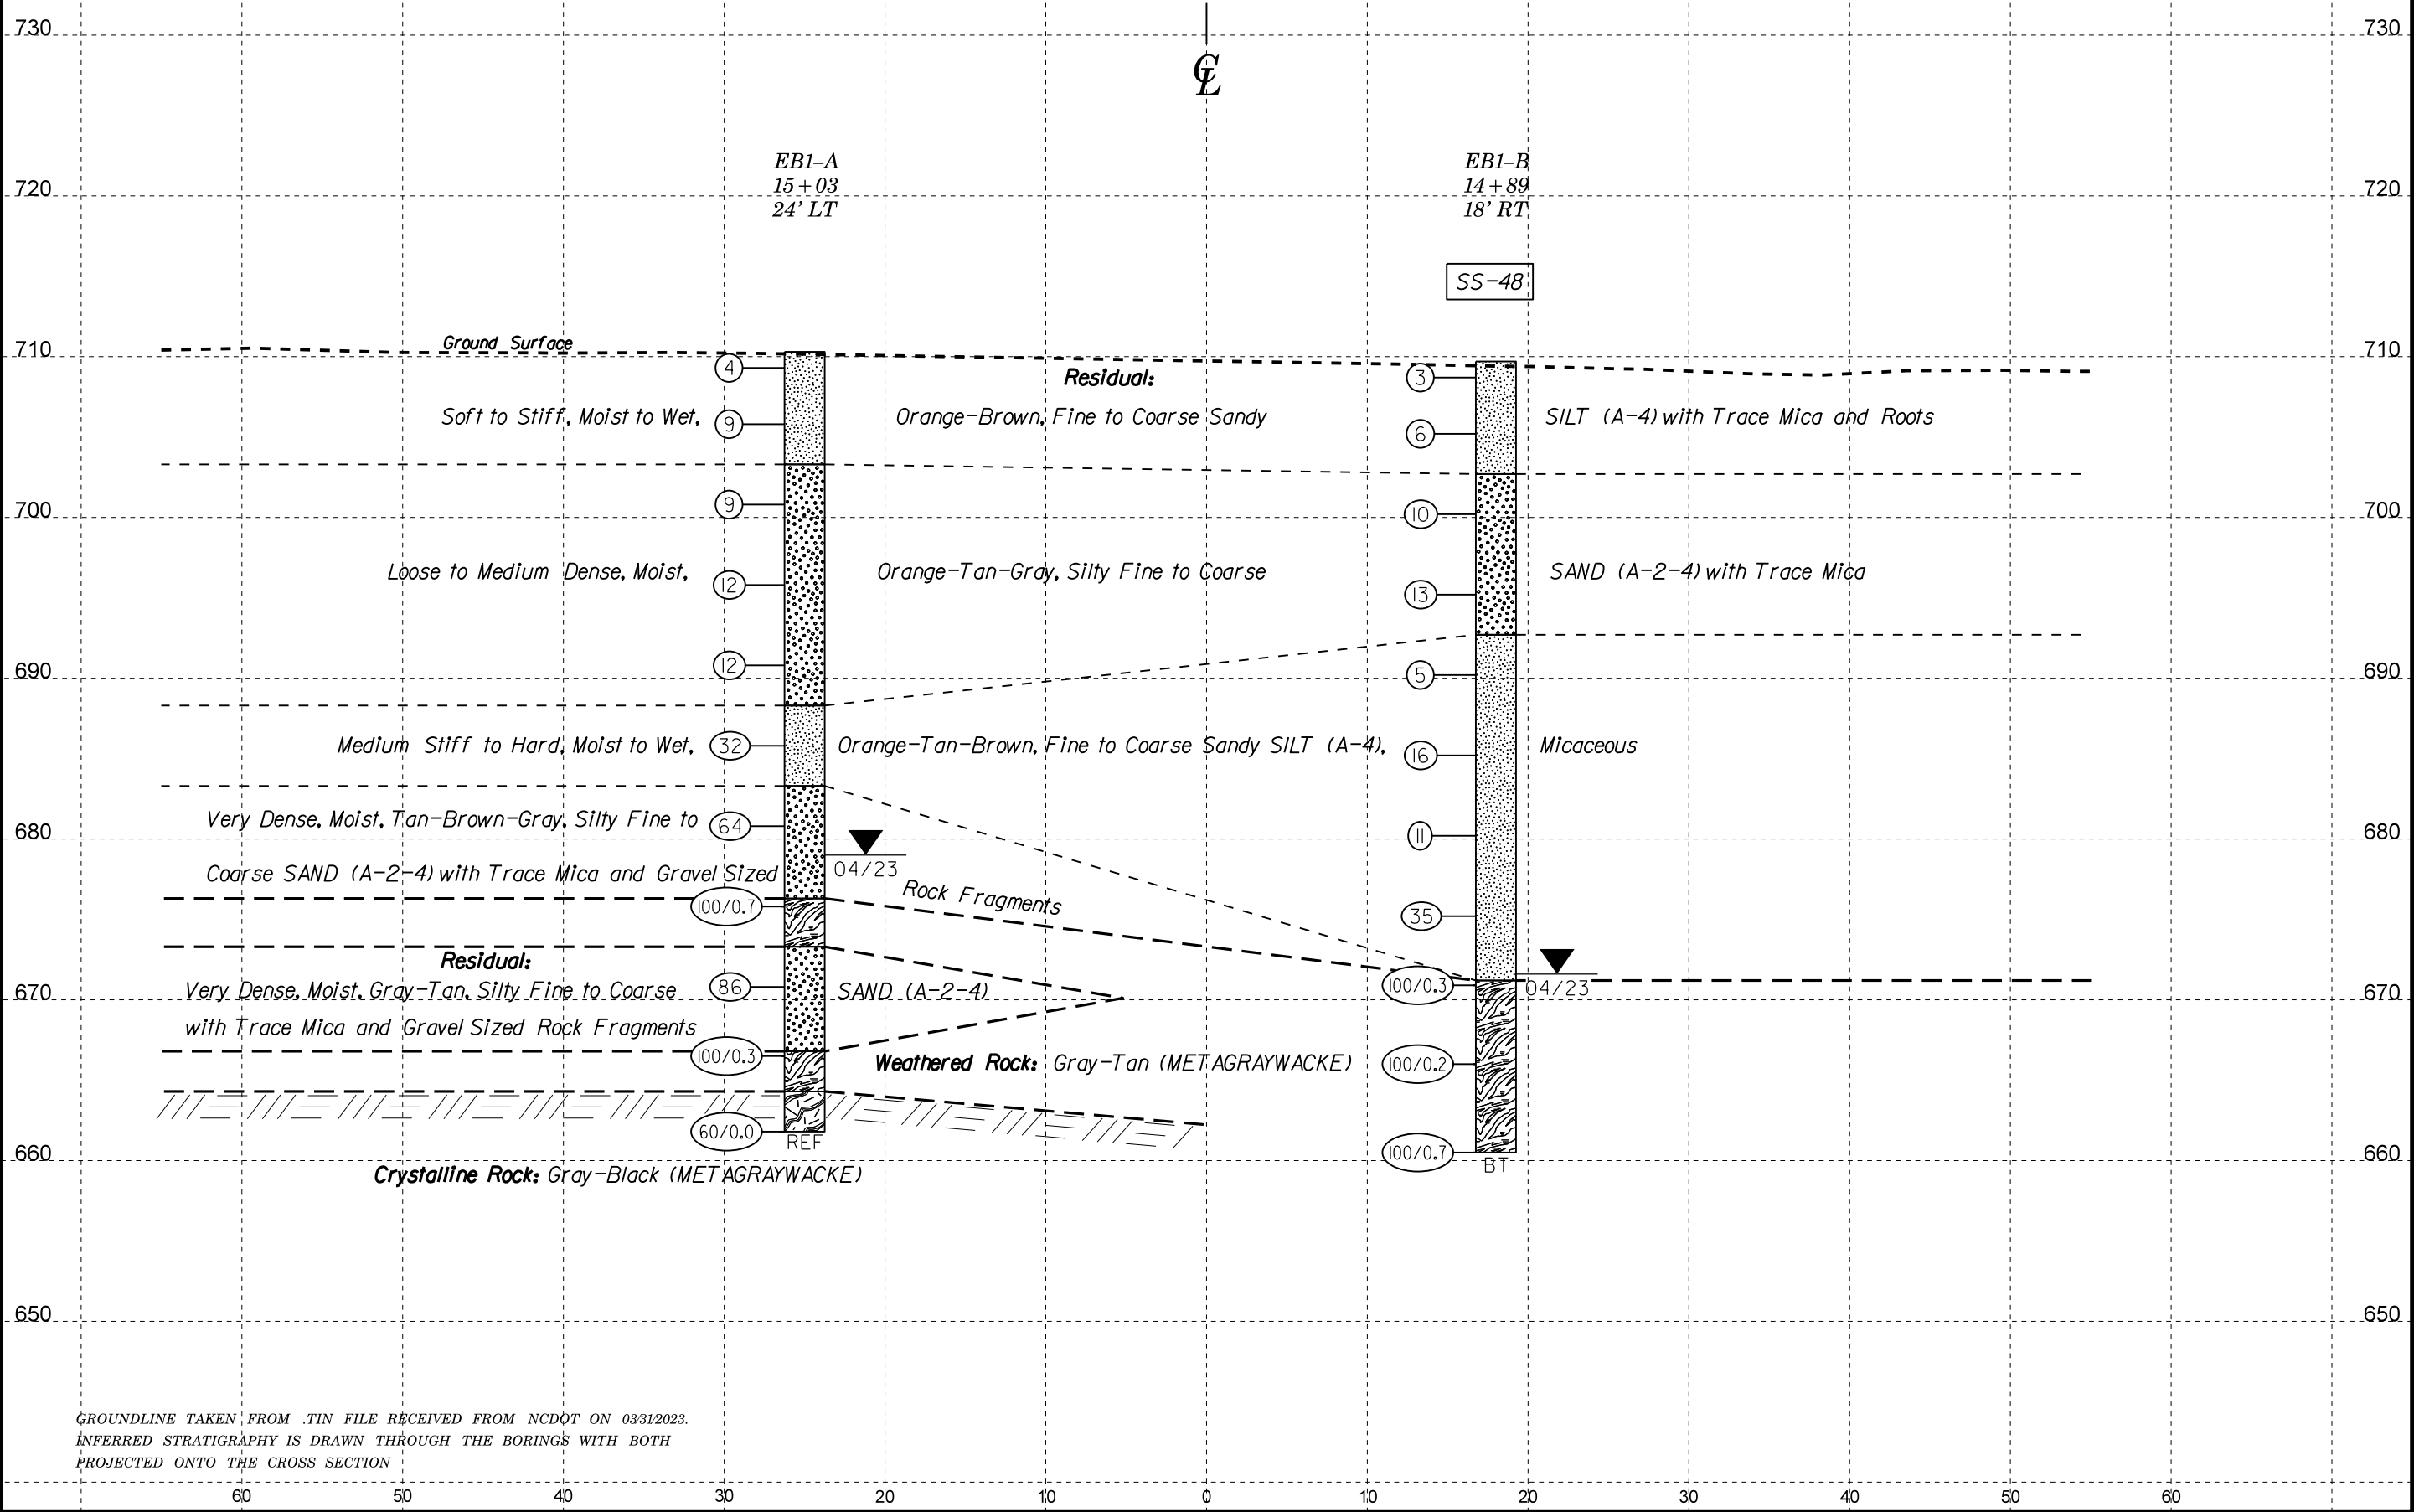

GROUNDLINE TAKEN FROM .TIN FILE RECEIVED FROM NCDOT ON 03/31/2023.
INFERRED STRATIGRAPHY IS DRAWN THROUGH THE BORINGS WITH BOTH
PROJECTED ONTO THE CROSS SECTION

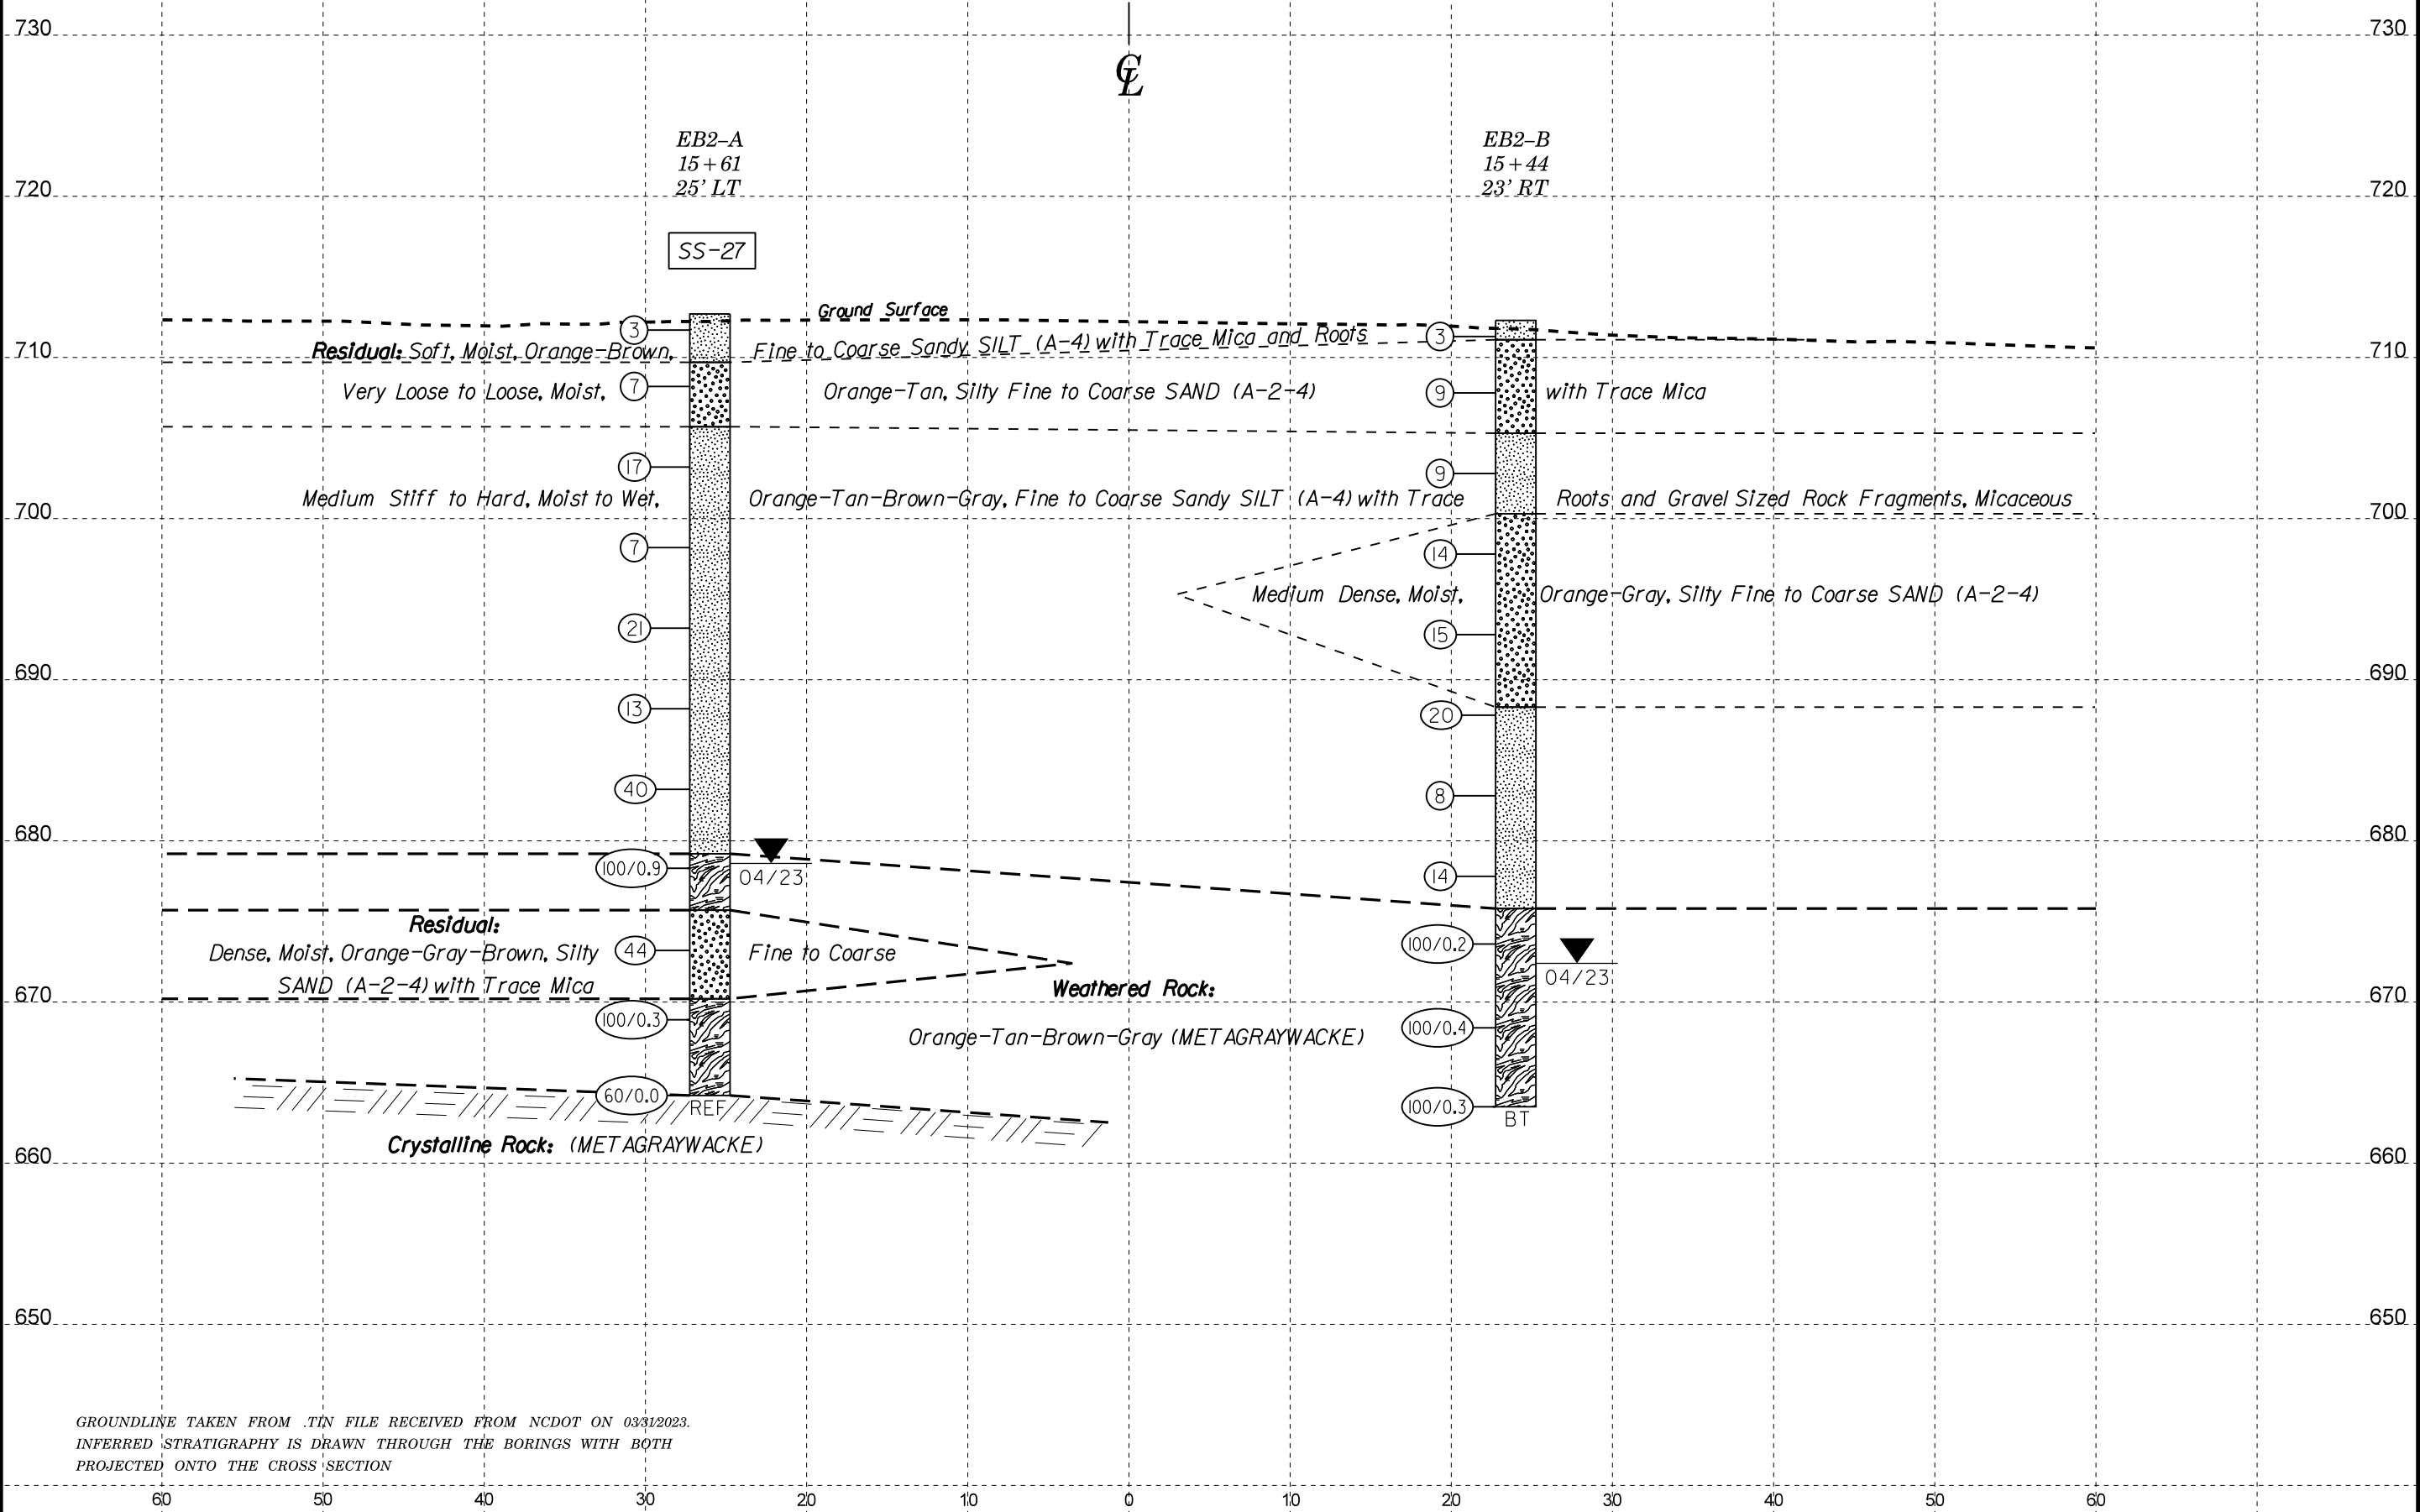

GROUNDLINE TAKEN FROM TIN FILE RECEIVED FROM NCDOT ON 03/31/2023.
INFERRED STRATIGRAPHY IS DRAWN THROUGH THE BORINGS WITH BOTH
PROJECTED ONTO THE CROSS SECTION

GEOTECHNICAL BORING REPORT
BORE LOG

WBS 67096.1.1			TIP BR-0096			COUNTY ROCKINGHAM			GEOLOGIST C. Ranieri							
SITE DESCRIPTION Replace Bridge 780176 on SR 1700 over NC14/NC87									GROUND WTR (ft)							
BORING NO. EB2-A			STATION 15+61			OFFSET 25 ft LT			ALIGNMENT -L-							
COLLAR ELEV. 712.7 ft			TOTAL DEPTH 48.5 ft			NORTHING 1,013,499			EASTING 1,771,279							
DRILL RIG/HAMMER EFF./DATE F&R3763 CME-550X 87% 05/20/2022						DRILL METHOD H.S. Augers			HAMMER TYPE Automatic							
DRILLER W. Shenberger			START DATE 04/11/23			COMP. DATE 04/11/23			SURFACE WATER DEPTH N/A							
ELEV (ft)	DRIVE ELEV (ft)	DEPTH (ft)	BLOW COUNT			BLOWS PER FOOT					SAMP. NO.	MOI	LOG	SOIL AND ROCK DESCRIPTION		
			0.5ft	0.5ft	0.5ft	0	25	50	75	100				ELEV. (ft)	DEPTH (ft)	
715																
	712.7	0.0												712.7	GROUND SURFACE 0.0	
710	709.2	3.5	1	1	2							W		709.7	RESIDUAL Orange-Brown, Fine to Coarse Sandy SILT (A-4), with Trace Mica and Roots 3.0	
											SS-27	13%		705.7	Orange-Tan, Silty Fine to Coarse SAND (A-2-4)	
705	704.2	8.5	3	3	4											
												M		705.7	Tan-Brown, Fine to Coarse Sandy SILT (A-4) with Trace Mica and Gravel Sized Rock Fragments 7.0	
700	699.2	13.5	9	9	8											
												M				
695	694.2	18.5	3	3	4											
												M				
690	689.2	23.5	9	10	11											
												M				
685	684.2	28.5	5	6	7											
												M				
680	684.2	28.5	12	16	24											
												M				
675	679.2	33.5	39	61/0.4										679.2	WEATHERED ROCK Orange-Tan (METAGRAYWACKE) 33.5	
														675.7	RESIDUAL Orange-Gray-Brown, Silty Fine to Coarse SAND (A-2-4) with Trace Mica 37.0	
670	674.2	38.5	17	18	26							M				
														670.2	WEATHERED ROCK Brown (METAGRAYWACKE) 42.5	
665	669.2	43.5	100/0.3													
														664.2	Boring Terminated with Standard Penetration Test Refusal at Elevation 664.2 ft on CRYSTALLINE ROCK (METAGRAYWACKE) 48.5	
	664.2	48.5	60/0.0											Notes: 1. Surficial Organic Soil: 0.0-0.2' 2. Harder drilling indicated by driller at 42.5'		

WBS 67096.1.1		TIP BR-0096		COUNTY ROCKINGHAM		GEOLOGIST C. Ranieri									
SITE DESCRIPTION Replace Bridge 780176 on SR 1700 over NC14/NC87							GROUND WTR (ft)								
BORING NO. EB2-B		STATION 15+44		OFFSET 23 ft RT		ALIGNMENT -L-		0 HR. 45.5							
COLLAR ELEV. 712.3 ft		TOTAL DEPTH 48.8 ft		NORTHING 1,013,488		EASTING 1,771,328		24 HR. 39.9							
DRILL RIG/HAMMER EFF./DATE F&R3763 CME-550X 87% 05/20/2022				DRILL METHOD H.S. Augers		HAMMER TYPE Automatic									
DRILLER W. Shenberger		START DATE 04/12/23		COMP. DATE 04/12/23		SURFACE WATER DEPTH N/A									
ELEV (ft)	DRIVE ELEV (ft)	DEPTH (ft)	BLOW COUNT			BLOWS PER FOOT					SAMP. NO.	MOI	LOG	SOIL AND ROCK DESCRIPTION	
			0.5ft	0.5ft	0.5ft	0	25	50	75	100					
715															
710	712.3	0.0	WOH	1	2	3						M		712.3 GROUND SURFACE 0.0	
	708.8	3.5		4	5	9						M		711.1 1.2	
705															
	703.8	8.5		3	4	9						M		705.3 7.0	
700															
	698.8	13.5		4	5	14						M		700.3 12.0	
695															
	693.8	18.5		4	6	15						M			
690															
	688.8	23.5		6	8	20						M		688.3 24.0	
685															
	683.8	28.5		2	3	8						W			
680															
	678.8	33.5		3	4	14						W			
675															
	673.8	38.5	100/0.2							100/0.2				675.8 36.5	
670															
	668.8	43.5	100/0.4							100/0.4					
665															
	663.8	48.5	100/0.3							100/0.3				663.5 48.8	

NCDOT BORE DOUBLE 66B-0055 BORING LOGS BRIDGE.GPJ NC_DOT.GDT 5/4/23



PROJECT REFERENCE NO.	SHEET NO.
67096.1.1	8

County: Rockingham
Description: Replace bridge 780176 on SR 1700 over NC 14, NC 87

SOIL TEST RESULTS																
SAMPLE NO.	-L- STATION	LOCATION	OFFSET *	DEPTH INTERVAL	AASHTO CLASS.	L.L.	P.I.	% BY WEIGHT				% PASSING (SIEVES)			% MOISTURE	% ORGANIC
								C. SAND	F. SAND	SILT	CLAY	10	40	200		
SS-48	14+89	EB1-B	18' RT	3.5-5.0	A-4	NP	NP	27.9	37.6	27.7	6.8	93.9	77.6	36.1	21.1	NT
SS-27	15+61	EB2-A	25' LT	3.5-5.0	A-2-4	NP	NP	35.9	45.8	14.4	3.9	100.0	76.8	22.9	13.4	NT

NP = Not Plastic
NT = Not Tested
ND = Not Determined

D. Council
Lab Manager, Certification No. 101-02-0603


C.Wang, P.E.
Soils Engineer




Replace bridge 780176 on SR 1700 over NC14/NC87
SITE PHOTOGRAPHS



Photograph No. 1: View looking south at End Bent 2

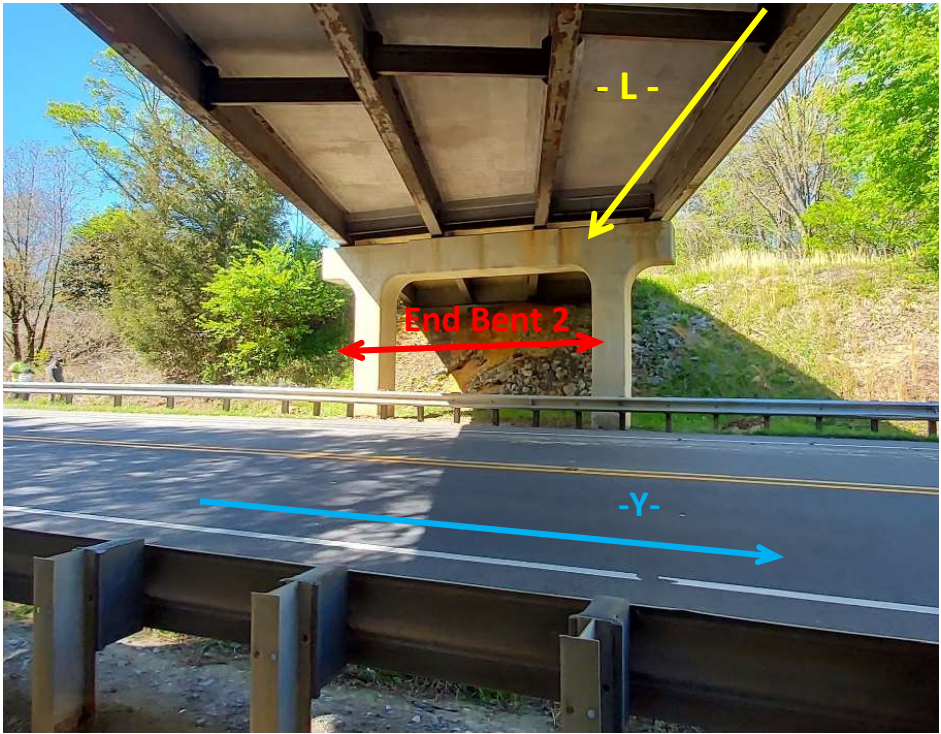

Photograph No. 3: View below bridge looking north at End Bent 2

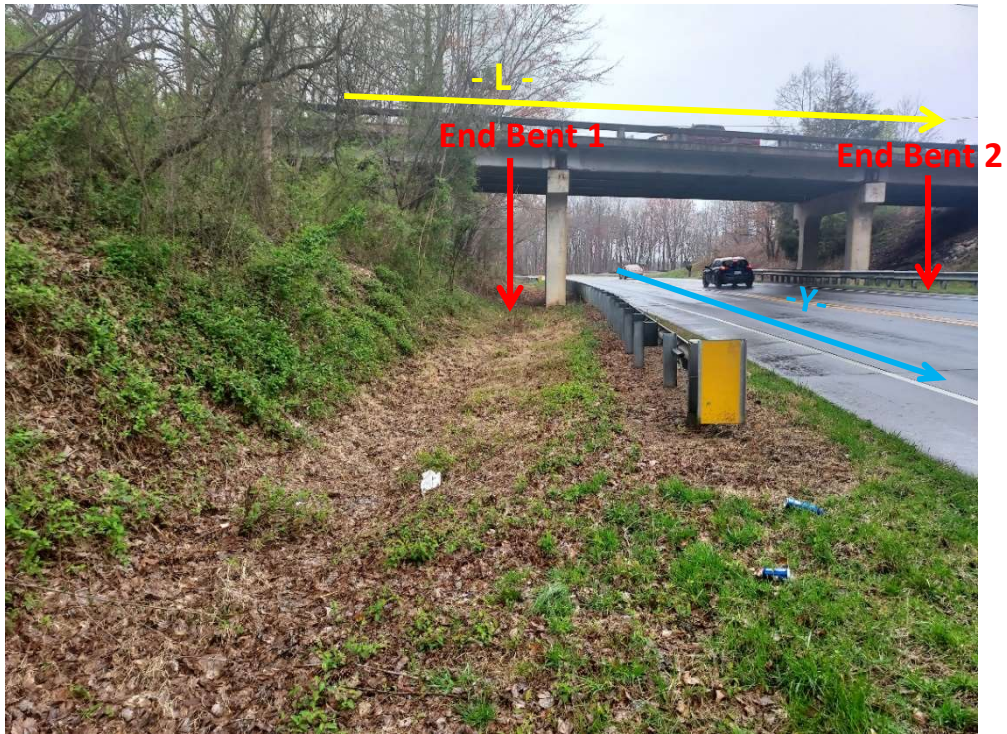

Photograph No. 2: View looking west at End Bent 1 and End Bent 2



Photograph No. 4: The existing slope surface below bridge deck at End Bent 2